Date: Mar. 9, 2011

RENESAS TECHNICAL UPDATE

1753, Shimonumabe, Nakahara-ku, Kawasaki-shi, Kanagawa 211-8668 Japan Renesas Electronics Corporation

Product Category	MPU/MCU		Document No.	TN-SH7-A799A/E	Rev.	1.00
Title	Usage note on Serial Sound Interface		Information Category	Technical Notification		
Applicable Product	SH7262 Group SH7264 Group SH7266 Group SH7267 Group	Lot No.	Reference Document	 SH7262 Group, SH7264 Group Hardware Manual Rev.2.00 (REJ09B0445-0200) SH7266 Group, SH7267 Group Hardware Manual Rev.1.00 (REJ09B0566-0100) 		

We would like to inform you of the notice about Serial Sound Interface included in the above-mentioned applicable product.

[Notice]

Transmit operation may not be started, even though the TEN bit in Control register (SSICR) is set to 1.

[Workaround]

To start transmit operation, please follow the procedure in figure 1 or figure 2 below.

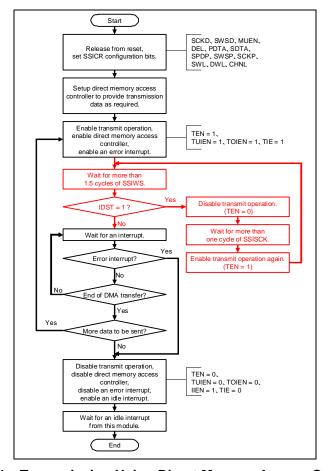


Figure 1 Transmission Using Direct Memory Access Controller

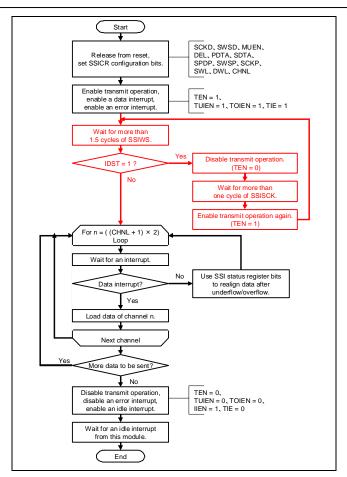


Figure 2 Transmission Using Interrupt-Driven Data Flow Control