## **RENESAS TECHNICAL UPDATE**

1753, Shimonumabe, Nakahara-ku, Kawasaki-shi, Kanagawa 211-8668 Japan Renesas Electronics Corporation

Prod Categ		MPU/MCU		Document No.	TN-V85-A024A/E	Rev.	1.00		
Title	e	V850E/Sx3-H Usage function.	ontrol	Informatior Category	Usage Restriction				
Applica Prodi		V850E/Sx3-H series	Lot No. All lots	Reference Document	Manual:Hardware R	H,V850E/SK3-H User's /are Rev5.00 (the 5th /EJ0500			
Whe state in <u>1. Det</u> Whe under i	n using isertion <u>ail of re</u> n a bus dle Stat	g a bus control functi by a multi-bus mode <u>estriction</u> s control function of <sup>1</sup> te	of plaques are corrected	mentioning as follows.	contents of	the pin status which is at AD15 terminal becomes			
User's manual are corrected as follo			Current state.			After restriction			
1.	64.	Table 2-3 Pin Operation status in Various Modes.	$ \begin{array}{ c c c c c c c c c c c c c c c c c c c$						
2.	310.	(1) Bus cycle control register (BCC)	Cautions 1. The internal ROM, internal RAM, and on-chi state insertion. 2. Write to the BCC register after reset, and th not access an external memory area until to been specified.	hen do not change the set va	lues. Also, do	Cautions 1. The Internal RAM, Internal RAM, and on-chip peripheral Vio areas are not subject to idle state insertion. 2. Write to the BCC register after reset, and then do not change the set values. Also, do not access an external memory area until the initial settings of the BCC register have been specified. 3. In the idle state and AD0-AD15 terminal will be unsettled output.			
3.	314.	Multiplexed Bus Read Timing (Bus Size:	Figure 5-6. Multiplexed Bus Read Timing (Bus Size: 16 Bits, 16-Bit Access)			Figure 5-6. Multiplexed Bus Read Timing (Bus Size: 16 Bits, 16-Bit Accees)           Image: Size: 16 Bits, 16-Bit Accees           Image: Size: 16 Bits, 16-			
		16 Bits, 16-Bit Access)	AD15 to AD0 AT D1 AD1 AD2 AD1 AD1 AD2 AD1	Programmatile External wall wait	state	15 to 200 HD HD	External wat		



## 2. Workaround

When using the bus function, be careful so that a signal of AD0-AD15 terminal doesn't collide with idle state.

This issue is not planned for correction. It will be made usage restriction.

Please inquire to our salesperson about details.

