

[Notes]

R20TS0290EJ0100

Rev.1.00

Mar. 16, 2018

CS+ Code Generator for RL78 (CS+ for CC),  
CS+ Code Generator for RL78 (CS+ for CA,CX),  
e<sup>2</sup> studio Code Generator Plug-in,  
AP4 Coding Assistance Tool for RL78

---

## Outline

When using the products in the title, note the following point.

1. When opening a project for RL78/G11 created by a previous version of code generator

## 1. When Opening a Project for RL78/G11 Created by a Previous Version of Code Generator

### 1.1 Applicable Products

- V2.15.00 of the CS+ Code Generator for RL78 (V6.01 of CS+ for CC)
- V2.15.00 of the CS+ Code Generator for RL78 (V6.01 of CS+ for CA,CX)
- V2.10.0 of the e<sup>2</sup> studio Code Generator plug-in (V6.2.0 of e<sup>2</sup> studio)
- V1.14.00 of the AP4 coding assistance tool for RL78

### 1.2 Applicable MCUs

- RL78 family: RL78/G11 group (20-pin R5F1056A)

### 1.3 Details

When an attempt is made to open a project for RL78/G11 (R5F1056A) created by any of the following previous versions of code generator using a product shown in section 1.1, an error occurs and the project cannot be opened.

- Previous version products
  - V2.12.00 to V2.14.00 of the CS+ Code Generator for RL78 (V4.01 to V6.00 of CS+ for CC)
  - V2.12.00 to V2.14.00 of the CS+ Code Generator for RL78 (V3.03 to V4.00 of CS+ for CA,CX)
  - V2.0.5 to V2.9.0 of the e<sup>2</sup> studio Code Generator plug-in (V5.2.0 to V6.1.0 of e<sup>2</sup> studio)
  - V1.11.00 to V1.13.00 of the AP4 coding assistance tool for RL78

Example: Error dialog box to be displayed when an attempt is made to open a project for RL78/G11 (R5F1056A) created by a previous version of code generator in CS+ for CC V6.01.00

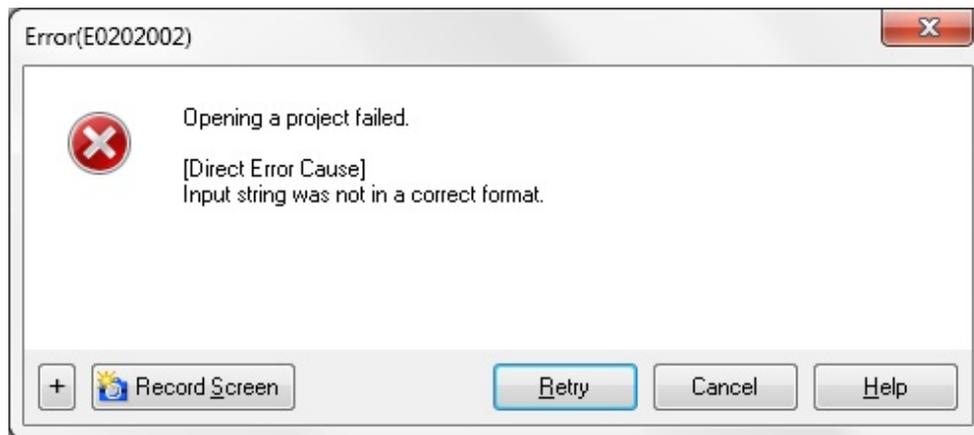


Figure 1. Error (E0202002) dialog box

## 1.4 Workaround

Do not use the products listed in section 1.1. Use the previous products listed in section 1.3. The workarounds depend on the applicable products you are using. Refer to the following description for details.

- CS+ for CC  
Uninstall the applicable product listed in section 1.1. Go to the following URL, download the installer for the previous version, and install it.  
<https://www.renesas.com/en-us/software/D4000428.html>  
CS+ for CC V6.00.00

For details about how to install and uninstall CS+, see the following user's manual:  
<https://www.renesas.com/search/keyword-search.html#genre=document&q=r20out3990>  
CS+ V6.00.00 Integrated Development Environment User's Manual: Installer

- CS+ for CA,CX  
Uninstall the applicable product listed in section 1.1. Go to the following URL, download the installer for the previous version, and install it.  
<https://www.renesas.com/en-us/software/D4000408.html>  
CS+ for CA,CX V4.00.01

For details about how to install and uninstall CS+, see the following user's manual:  
<https://www.renesas.com/search/keyword-search.html#genre=document&q=r20out3990>  
CS+ V6.00.00 Integrated Development Environment User's Manual: Installer

- e<sup>2</sup> studio  
Go to the following URL, download the installer for the previous version, and install it. Before you do so, uninstall the applicable product listed in section 1.1. If you want to keep the product, select the name of a new folder as the installation destination.  
<https://www.renesas.com/en-eu/software/D4000532.html>  
e<sup>2</sup> studio V6.1.0
- AP4 coding assistance tool for RL78  
Go to the following URL, download the installer for the previous version, and install it.  
<https://www.renesas.com/en-eu/software/D4000490.html>  
AP4 for RL78 V1.13.00

## 1.5 Schedule for Fixing the Problem

This problem will be fixed in a later version. A revised version will be available in July 2018.

**Revision History**

Rev.	Date	Description	
		Page	Summary
1.00	Mar. 16, 2018	-	First edition issued

TOYOSU FORESIA, 3-2-24 Toyosu, Koto-ku, Tokyo 135-0061 Japan  
 Renesas Electronics Corporation

■Inquiry

<https://www.renesas.com/contact/>

Renesas Electronics has used reasonable care in preparing the information included in this document, but Renesas Electronics does not warrant that such information is error free. Renesas Electronics assumes no liability whatsoever for any damages incurred by you resulting from errors in or omissions from the information included herein.

The past news contents have been based on information at the time of publication. Now changed or invalid information may be included.

The URLs in the Tool News also may be subject to change or become invalid without prior notice.

All trademarks and registered trademarks are the property of their respective owners.