

CUSTOMER NOTIFICATION

SUD-TT-0013-3-E

July 15, 2002

Koji Nishibayashi, Project Manager
Microcomputer Group
System LSI Solutions Engineering Div.
NEC Electron Devices
NEC Corporation

CP (K), O

IE-703089-MC-EM1 (Control Code: A, B, C, D, E, F)

Operating Precautions

Be sure to read this document before using the product.

1. Product Version	2
2. Product History	2
3. Details of Bugs and Added Specifications	3
4. Other Cautions.....	6

Notes on Using IE-703089-MC-EM1

1. Product Version

Control Code	Board Version	Peripheral Chip	Remark
A	1.00	uPD703089 (DS1.1)	
B	1.10	uPD703089 (DS1.1)	
C	1.11	uPD703089 (DS1.2)	
D	1.22	uPD703089 (DS2.0 or later)	
E	1.23	uPD703089 (DS2.0 or later)	
F	1.33	uPD703089 (DS2.0 or later)	

Employ an IE-703002-MC with a control code of H or later when using this option board.

2. Production History

No.	Bugs and Changes/Additions to Specification	Control Code					
		A	B	C	D	E	F
1	Bug that emulation impossible with target supply voltage below 4.2 V	×	√	√	√	√	√
2	Connection with socket using “YQ-Guide” or with “SWEX-144SD” impossible ^{Note}	×	√	√	√	√	√
3	Bug that the register values related to 3-wire serial I/O channels 5 & 6 cannot be read correctly	×	×	√	√	√	√
4	Bug in timer clock selection of timer 6	×	×	√	√	√	√
5	Bug in I/O of port 00	×	×	×	√	√	√
6	Bug in accessing the external expansion area	×	×	×	√	√	√
7	Bug when two FCAN channels are used simultaneously and support for specification change	×	×	×	√	√	√
8	Support for addition of device functions (1) Addition to the IIC bus function (2) Addition to the watch timer function	×	×	×	√	√	√
9	ROM correction function cannot be emulated	Permanent restriction					
10	Emulation during oscillation stabilization time after RESET release cannot be performed	Permanent restriction					
11	Restriction on interrupts in STOP/IDLE mode	×	×	×	×	√	√
12	Hi-Z output from the CLKOUT pin cannot be emulated	Permanent restriction					
13	Bug in external bus interface	×	×	×	×	×	√

×: Applicable, √: Not applicable or already corrected

Note “YQ-Guide” and “SWEX-144SD” are products of TOKYO ELETECH CORPORATION.

The “control code” is the second digit from the left in the 10-digit serial number in the warranty supplied with the product you purchased (if it has not been upgraded). If the product has been upgraded, the version can be checked by the label attached to the product.

3. Details of Bugs and Added Specifications

No.1 Bug that emulation impossible with target supply voltage below 4.2 V

[Description]

Emulation cannot be performed if the target power supply voltage (Vdd0, Vdd1) is below 4.2 V.

[Workaround]

When the target board is connected, use a power supply voltage (Vdd0, Vdd1) of at least 4.2 V. This bug has been corrected in control code B and later products.

No.2 Connection with socket using “YQ-Guide” or with “SWEX-144SD” impossible

[Description]

A connection cannot be made with a socket using the “YQ-Guide” or with the “SWEX-144SD”.

[Workaround]

When using a socket that uses the “YQ-Guide”, remove the “YQ-Guide” before use. This bug has been corrected in control code B and later products.

No.3 Bug that the register values related to 3-wire serial I/O channels 5 & 6 cannot be read correctly

[Description]

I/O register values related to 3-wire serial I/O channels 5 and 6 cannot be read when the CPU clock (f_{CPU}) is greater than 10 MHz.

*** This bug only applies to the emulator; it does not occur in the actual CPU.**

[Workaround]

When reading the I/O register values related to 3-wire serial I/O channels 5 and 6 with f_{CPU} operating at more than 10 MHz, set f_{CPU} to 10 MHz or less.

Note that I/O registers can be written as usual when f_{CPU} is operating at more than 10 MHz.

This bug has been corrected in control code C and later products.

No.4 Bug in timer clock selection of timer 6

[Description]

If the timer clock selection of timer 6 is set to “TM0 overflow signal” (TCL60 = 07h, TCL61 = 01h), the timer clock will be set to f_{xx}/256, and the TM0 overflow signal will not be able to be selected. (Reading/writing TCL60 = 07h, TCL61 = 01h is possible.)

[Workaround]

There is no workaround.

This bug has been corrected in control code C and later products.

No.5 Bug in I/O of port 00

[Description]

Port 00 cannot perform output operations even if set as an output port.

Moreover, port 00 cannot read the correct input value even if set as an input port while the NMI pin function is masked in the debugger. (The operation is performed correctly if port 00 is set as an input port and the NMI pin function is not masked in the debugger.)

[Workaround]

There is no workaround.

This bug has been corrected in control code D and later products.

No.6 Bug in accessing the external expansion area

[Description]

The external expansion area (including the FCAN memory area) cannot be read/written.

[Workaround]

There is no workaround.

This bug has been corrected in control code D and later products.

No.7 Correction of bug when two FCAN channels are used simultaneously and support for specification change

[Description]

- (1) When two FCAN channels are used simultaneously, the received data may be stored in an incorrect message buffer (the last message buffer) or may be discarded.
- (2) When two FCAN channels are used simultaneously, incorrect data (the last message buffer) may be transmitted.
- (3) The TMR bit of the CANn control register (CnCTRL) was changed.

TMR	Control Bit for Reception Time Stamp
0	The value in the time stamp counter is not captured.
1	The value in the time stamp counter is counted when an EOF is detected on the CAN bus (judged as a valid message).

* The value in the time stamp counter is not counted even when an SOF is detected on the CAN bus.

[Workaround]

There is no workaround.

This bug has been corrected in control code D and later products.

No.8 Support for addition of device functions

[Description]

- (1) Addition to the IIC bus function
The IICF0 (FFFFFF368H) and IICF1 (FFFFFF36AH) registers have been added.
- (2) Addition to the watch timer function
The WTNHC (FFFFFF366H) register has been added.

[Workaround]

There is no workaround.

This bug has been corrected in control code D and later products.

No. 9 ROM correction function cannot be emulated

[Description]

The ROM correction function cannot be emulated.

[Workaround]

There is no workaround.

This will be designated as a permanent restriction.

No. 10 Emulation during oscillation stabilization time after RESET release cannot be performed

[Description]

Emulation during the oscillation stabilization time after RESET release cannot be performed. Emulation during the oscillation stabilization time after STOP mode release is possible.

[Workaround]

There is no workaround.



This will be designated as a permanent restriction.

No. 11 Restriction on interrupts in STOP/IDLE mode

[Description]

The emulator is deadlocked if the device is shifted to the STOP/IDLE mode while the interrupt request flag for an interrupt that is not masked is set.

[Workaround 1]

Be sure to clear the non-masked interrupt request flag before shifting to the STOP/IDLE mode. If the device is inadvertently shifted before clearing the flag, execute "Run" → "Stop" or click the  button on the debugger. The program is forcibly terminated. Then, execute "Run" → "CPU Reset" or click the  button.

[Workaround 2]

Do not allow the device to shift to the STOP/IDLE mode while the interrupt request flag for an interrupt that is not masked is set.

This bug has been corrected in control code E and later products.

No. 12 Hi-Z output from the CLKOUT pin cannot be emulated

[Description]

The Hi-Z output from the CLKOUT pin cannot be emulated. Even if the power save control register (PSC) is set to “Hi-Z output (DCLK1 = 0, DCLK0 = 1)” in the emulator, the same operation as “output enable (DCLK1 = 0, DCLK0 = 0)” is performed.

[Workaround]

There is no workaround.

This will be designated as a permanent restriction.

No. 13 Bug in external bus interface

[Description]

When using the external bus interface, the values of read data D0 to D4 may not be read correctly.

[Workaround]

There is no workaround.

This bug has been corrected in control code F and later products.

4. Other Cautions

This product has the following restrictions.

No.	Restrictions
1	Satisfy the following conditions when using the IE-703089-MC-EM1 with other than VDD0 = VDD1 = ADCVDD = PORTVDD0 = PORTVDD1 = PORTVDD2. (1) PORTVDD1 ≤ PORTVDD2 when using the FCAN controller (restriction of the emulator) (2) VDD0 = ADCVDD = 4.5 to 5.5 V when using the A/D converter