

RENESAS TOOL NEWS on April 16, 2005: RSO-E8_2-050416D

A Note on Using the E8 Emulator Software V.2.01 Release 00

Please take note of the following problem in using the emulator software for the E8 on-chip debugging emulator:

- On running the emulator software on Windows 98 or Me
-

1. Product Concerned

E8 emulator software V.2.01 Release 00

2. Description

If you run the M16C/Tiny, M16C/62P E8 emulator debugger V.1.00.00 included in the product concerned on Windows 98 or Me, the High-performance Embedded Workshop may abnormally be shut down or an emulator connection error may arise.

3. Conditions

This problem occurs if the following conditions are all satisfied:

- (1) Windows 98SE or Windows Me is used as the host OS.
- (2) Any of the following MCUs is selected out of the Device list in the Select Emulator mode dialog box at connecting the High-performance Embedded Workshop to emulator:
M30624FGP, M30625FGP, M30626FHP, M30626FJP,
and M30627FHP

4. Workaround

When you debug MCUs involved, use Windows 2000 or XP as the host OS.

5. **Schedule of Fixing the Problem**

We plan to fix this problem in the E8 emulator software V.2.02 Release 00, which will be released in this May 11.

[Disclaimer]

The past news contents have been based on information at the time of publication. Now changed or invalid information may be included. The URLs in the Tool News also may be subject to change or become invalid without prior notice.

© 2010-2016 Renesas Electronics Corporation. All rights reserved.