

RENESAS TOOL NEWS on April 23, 2013: 130423/tn1

Emulator Utility for CubeSuite+ Revised to V1.00.06

We have updated the emulator utility included in the CubeSuite+ package V2.00.00 to revise the following note.

- The note for debugging RL78 family and 78K0R microcontroller with CubeSuite+ V2.00.00 and E1 emulator.

1. Versions to Be Updated

The following emulator utilities included in the CubeSuite+ package.

- Emulator Utility V1.00.04 (included in CubeSuite+ package V1.03.00)
- Emulator Utility V1.00.05 (included in CubeSuite+ package V2.00.00)

To check to see your product's version, follow these steps:

For Windows 7:

- (1)Click the Programs and Features on the Windows Control Panel.
- (2)Select the "CubeSuite+ Emulator Utilities", and the Version Information dialog box appears on the bottom of the screen.
The version is displayed by the "1.xx.xxyy" format.
Ignore last 2 digits "yy".

The CubeSuite+ Package V2.00.00 is included in the following Evaluation Editions

- Evaluation Software CubeSuite+ V2.00.00 (Single Download)
- Evaluation Software CubeSuite+ V2.00.00 (Multipart Download)

The CubeSuite+ Package V1.03.00 is included in the following product versions or Evaluation Editions

- CubeSuite+ License Pack for RL78, 78K V1
- CubeSuite+ License Pack for RX V1
- CubeSuite+ License Pack for V850 V1
- Evaluation Software CubeSuite+ V1.03.00 (Multipart Download)
- Evaluation Software CubeSuite+ V1.03.00 (Single Download)

2. Description of Revision

The emulator utility for the CubeSuite+ has been revised from V1.00.05

to V1.00.06.

The following item has been fixed. For details, see 3. "Problem Fixed".

3. Problem Fixed

3.1 The note for debugging RL78 family and 78K0R microcontroller with CubeSuite+ V2.00.00 and E1 emulator.

If the CubeSuite+ Package V2.00.00 is overwritten to a host PC which the CubeSuite+ package V1.03.00 including Emulator Utility V1.00.04 has been installed, users cannot debug systems designed with MCUs of the RL78 Family and 78K0R. (Connection to Debug Tool will not be established.)

The problem is caused by inconsistencies during installation process, which have been confirmed in the CubeSuite+ Package V1.03.00 and V2.00.00 including the emulator utility V1.00.04 and V1.00.05, respectively.

The problem does not arise if:

- Evaluation Software CubeSuite+ V2.00.00 is newly installed.
- Evaluation Software CubeSuite+ V2.00.00 is overwritten to CubeSuite+ V1.02.01 or earlier.

However, the problem arises if the emulator utility has been updated to V1.00.04 before the installation of CubeSuite+ V2.00.00.

4. Updating Your Product

4.1 For those who have already installed CubeSuite+ Package V2.00.00

On the Start menu, select Programs and then Renesas Electronics CubeSuite+ to start the Update Manager.

This service will be available on and after April 24.

4.2 For those who have not installed the CubeSuite+ Package V2.00.00

Download CubeSuite+ Package V2.00.00 from the Web site at:

https://www.renesas.com/cs+_download

Then install it.

The above program will be published on this April 24.

The above URL is one of our global sites.

NOTE:

The letter "a" is appended at the end of the file name of the CubeSuite+ Package V2.00.00 including the revised emulator utility.

- Evaluation Software CubeSuite+ V2.00.00 (Single Download)
CubeSuitePlus_Package_V20000a.exe
- Evaluation Software CubeSuite+ V2.00.00 (Multipart Download)
CubeSuitePlus_Package_V20000a1.exe
CubeSuitePlus_Package_V20000a2.cab through V20000a9.cab

[Disclaimer]

The past news contents have been based on information at the time of publication. Now changed or invalid information may be included. The URLs in the Tool News also may be subject to change or become invalid without prior notice.

© 2010-2016 Renesas Electronics Corporation. All rights reserved.