

[Notes]

R20TS1038JJ0100

Rev.1.00

Jun. 06, 20

C/C++ Compiler Package for RX Family (No.67)

Outline

When using the CC-RX C/C++ Compiler Package for RX Family, note the following point.

1. Notes on the use of the CC-RX compiler on Linux (No.67)
 - * The number in the parentheses is the identification number of the note.

The details and workaround for this note are the same as in the FAQs below.

[E0511182 error occurs by building with compiler for Linux \(CC-RL/CC-RX/CC-RH\)](#)

1. Notes on the use of the CC-RX compiler on Linux (No.67)

1.1 Applicable Products

CC-RX V3.06.01

1.2 Details

When building using the Linux compiler on Linux, the following error may occur.

E0511182:File access error.(evaluation version)

1.3 Workaround

Perform the following step (1) to (3):

- (1) If you have registered the license key, delete it with the following command.
However, please make a note of the license key before deleting it, as it should be re-registered later.

```
$ /usr/local/renesas-mcutools/bin/license-manager --delete <license key>
```

The registered license key can be checked with the following command.

```
$ /usr/local/renesas-mcutools/bin/license-manager --list
```

- (2) Start the linker(rlink) with the following command.
(A list of options will be displayed, but please ignore it.)

```
$ /usr/local/Renesas/CC-RX/V3.06.01/bin/rlink
```

- (3) If you deleted the license key in step (1), re-register it with the following command.

```
$ /usr/local/renesas-mcutools/bin/license-manager --add <license key>
```

1.4 Schedule for Fixing the Problem

A release of the compiler fixing the problem is planned. The release date has not yet been decided.

Revision History

Rev.	Date	Description	
		Page	Summary
1.00	Jun.20.24	-	First edition issued

Renesas Electronics has used reasonable care in preparing the information included in this document, but Renesas Electronics does not warrant that such information is error free. Renesas Electronics assumes no liability whatsoever for any damages incurred by you resulting from errors in or omissions from the information included herein.

The past news contents have been based on information at the time of publication. Now changed or invalid information may be included.

The URLs in the Tool News also may be subject to change or become invalid without prior notice.

Corporate Headquarters

TOYOSU FORESIA, 3-2-24 Toyosu,
Koto-ku, Tokyo 135-0061, Japan
www.renesas.com

Trademarks

Renesas and the Renesas logo are trademarks of Renesas Electronics Corporation. All trademarks and registered trademarks are the property of their respective owners.

Contact information

For further information on a product, technology, the most up-to-date version of a document, or your nearest sales office, please visit:
www.renesas.com/contact/