Date: Apr. 7, 2015

## **RENESAS TECHNICAL UPDATE**

1753, Shimonumabe, Nakahara-ku, Kawasaki-shi, Kanagawa 211-8668 Japan Renesas Electronics Corporation

Product Category	MPU/MCU	Document No.	TN-R8C-A051A/E Rev		Rev	1.00
Title	Notification about malfunction in flash-memory-read operation.		Information Category	Technical Notification		
Applicable Products	Described below.	Lot No.	Reference Document			
		Described below				

Renesas informs that some products which were shipped in the past have possibility to cause malfunction in flash-memory-read operation

1. Products:

R8C/L36A Group, R8C/L38A Group, R8C/L3AA Group,

R8C/L38B Group, R8C/L3AB Group

R8C/L36C Group, R8C/L38C Group, R8C/L3AC Group,

2. Notification about malfunction in flash-memory-read operation.

Some products which were shipped during a period from June, 2011 to June, 2012,

possibly can not read the embedded flash memory correctly under some conditions described below.

Defective error on reading program, since that does not happen on all devices in the concerned lots, customer can use the device which the error has not happened on board without any concerns.

3. Conditions about malfunction in flash-memory-read operation.

The ambient temperature is less than 0 degrees Celsius.

And

In the case Software satisfies the following conditions

a. When an instruction with the jump functions such as JMP instruction is allocated from address 10000h to address 20000h and jumps in address 4000h to address BFFFh.

OR

- b. When JSR instruction is allocated from address 4000h to address FFFFh. And RTS instruction in the subroutine to be executed is allocated from address 10000h to address 2FFFFh.
- 4. Target lot

Customers can check which products have possibility of this issue by the LotNo printed on the package according to the table below.



R8C/L36A Group, R8C/L38A Group, R8C/L3AA Group

Product Name	Lot No.	shipment	
R5F2L368ANFP	126BZ00	2,019	
	146BZ00	5,307	
	201BZ00	2,444	
	201BZ01	4,894	
	211BZ00	4,797	
	215BZ00	7,869	
	total	27,330	
R5F2L38CADFP	125BZ00	4,508	
	949AZ00	212	
	total	4,720	
R5F2L3ACANFP	215BZ00	464	
	total	464	

## R8C/L38B Group, R8C/L3AB Group

Product Name	Lot No.	shipment	
R5F2L38ABDFP	122B109	400	
	125B105	1,000	
	total	1,400	
R5F2L3ACBDFP	110AZ00	1,907	
	129BZ00	2,583	
	144BZ00	418	
	144BZ01	942	
	total	5,850	

## R8C/L36C Group, R8C/L38C Group, R8C/L3AC Group

Product Name	Lot No.	shipment	
R5F2L368CNFA	133AZ00	16,642	
	137AZ00	26,832	
	total	43,474	
R5F2L368CNFP	132AZ00	5,551	
	total	5,551	
R5F2L36CCNFP	132AZ00	5,724	
	total	5,724	
R5F2L388CNFP	129AZ03	16,081	
	129AZ04	15,796	
	136AZ05	17,387	
	137AZ00	20,325	
	152AZ02	5,732	
	152AZ03	22,177	
	total	97,498	
R5F2L3ACCNFP	132AZ00	2,802	
	total	2,802	

Please contact Renesas when customers find the problem which is expected due to this issue, or have the stock listed on the table above.

Date: Apr. 7, 2015