Old Company Name in Catalogs and Other Documents

On April 1st, 2010, NEC Electronics Corporation merged with Renesas Technology Corporation, and Renesas Electronics Corporation took over all the business of both companies. Therefore, although the old company name remains in this document, it is a valid Renesas Electronics document. We appreciate your understanding.

Renesas Electronics website: http://www.renesas.com

April 1st, 2010 Renesas Electronics Corporation

Issued by: Renesas Electronics Corporation (http://www.renesas.com)

Send any inquiries to http://www.renesas.com/inquiry.



Date: Oct.30.2008

RENESAS TECHNICAL UPDATE

Nippon Bldg., 2-6-2, Ohte-machi, Chiyoda-ku, Tokyo 100-0004, Japan Renesas Technology Corp.

Product Category	MPU&MCU	Document No.	TN-SH7-A686A/E	Rev.	1.00	
Title	Correction of SH7785 CPG Hardware Manua	Information Category	Technical Notification			
	SH7785 Group	Lot No.				
Applicable Product		All lots	Reference Document	SH7785 Hardware Manual Rev.1.0 (REJ09B0261-0100)		

The SH7785 CPG Hardware Manual has following errors.

[Summary]

There are some prohibited division ratio of the divider 2 in table 15.8 and table 15.9.

[Correction]

Table 15.8 Selectable Combinations of Clock Frequency (CPU Clock: x1/2, DDR Clock: x1/4) and table 15.9 Selectable Combinations of Clock Frequency (CPU Clock: x1/4, DDR Clock: x1/4) are corrected as following table.

	Page	FRQMR1 read value	Before Correction	After Correction		
Table 15.8	p751	H'1226 244A				
		H'1226 246A				
		H'1226 24AA	Corresponding FRQMR1 Division ratio			
		H'122A 244A		Corresponding FRQMR1 Division ratio of divider 2: Not Available		
		H'122A 246A				
		H'122A 24AA				
	p752	H'2226 244A	of divider 2:			
		H'2226 246A	Available			
Table 15.9		H'2226 24AA				
	p753	H'222A 244A				
		H'222A 246A				
		H'222A 24AA				

[Note]

The value of the FRQMR1 in above table is illegal. This means the division ratio of corresponding value must not specify to the FRQCR1.

- End of Correction -