

Smart Configurator for RX Plug-in in e² studio 2022-04

Smart Configurator for RX V2.13.0

Release Note

Introduction

Thank you for using the Smart Configurator for RX.

This document describes the restrictions and points for caution. Read this document before using the product.

Contents

1. Introduction.....	3
1.1 System requirements.....	3
1.1.1 PC.....	3
1.1.2 Development Environments	3
2. Support List	4
2.1 Support Devices List.....	4
2.2 Support Components List.....	9
2.3 New support	15
2.3.1 BSP (Board Support Package) revision update	15
2.3.2 New package support.....	15
2.3.3 Code Generation software component support for RI600V4 project	15
2.3.4 Turn off function support for automated code generation feature after build	16
3. Changes	17
3.1 Correction of issues/limitations.....	17
3.1.1 Fixed the CLKOUT pin setting issue on the clock page.....	18
3.1.2 Fixed the comment block missing issue when using communication components	18
3.1.3 Fixed the incorrect function category issue for Touch QE API component	18
3.1.4 Fixed the build error when using AN107 in S12AD Continuous Scan Mode component	18
3.1.5 Fixed the build error for Smart Configurator C++ project.....	18
3.1.6 Fixed the SC Code Generation builder setting re-generation issue after disabling it	18
3.1.7 Fixed the build error for Smart Configurator RTOS C++ project.....	18
3.1.8 Fixed the interrupt disable issue in repeat mode when using Data Transfer Controller component ..	18
3.1.9 Fixed the file re-generation issue when file content has no change	18
3.2 Specification changes	19
3.2.1 The function categories that do not have any components are removed	20
3.2.2 The file generation console messages are only output for files that are generated	20
3.2.3 The IAR IPCF file structure has been improved to support RTOS project.....	21
4. List of RENESAS TOOL NEWS AND TECHNICAL UPDATE	22

5.	Points for Limitation	27
5.1	List of Limitation.....	27
5.2	Details of Limitation	28
5.2.1	Note on the inconsistent code generation behavior issue when loading existing project with Port configuration	28
5.2.2	Note on the general I/O port direction issue on MCU package view when using Port Component....	28
5.2.3	Note on the resource tree in the FIT component GUI configuration	28
5.2.4	Note on address bus when using external bus	29
5.2.5	Note on section address issue when configuring bank mode to dual mode	29
5.2.6	Note on the function pin SS12# when using RX140 32 pin packages	29
6.	Points for Caution	30
6.1	List of Caution.....	30
6.2	Details of Caution	32
6.2.1	Note on configuring GPT interrupts.....	32
6.2.2	Note on SCR.TE bit setting sequence in SCI Clock Synchronous Mode and SCI Clock Asynchronous Mode.....	33
6.2.3	Note on using only reception in SCI Clock Synchronous Mode.....	33
6.2.4	Note on using high transfer speed in SCIF Synchronous Mode	33
6.2.5	Note on device change functionality	34
6.2.6	Note on using Smart Configurator for GCC project in e2 studio 7.4.0	34
6.2.7	Note on using Data Transfer Controller	34
6.2.8	Note on Ports setting when using S12AD components	34
6.2.9	Note on section build warning when using FIT components.....	34
6.2.10	Note on C++ project support in CS+ and IAR	35
6.2.11	Note on Installation directory.....	36
6.2.12	Note on the build error of existing RTOS C++ project.....	36
	Revision History	37

1. Introduction

Smart Configurator is a utility for combining software to meet your needs. It supports the following three functions related to the embedding of Renesas drivers in your systems: importing middleware, generating driver code, and setting pins.

Smart Configurator for RX V2.13.0 is equivalent to Smart Configurator for RX plug-in in e² studio 2022-04.

1.1 System requirements

The operating environment is as follows.

1.1.1 PC

- IBM PC/AT compatibles (Windows® 8.1 64-bit and Windows® 10 64-bit)
- Processor: 1 GHz or higher (must support hyper-threading, multi-core CPUs)
- Memory capacity: 4 GB or more recommended.
- Hard disk capacity: 300 MB or more spare capacity
- Display: 1024 x 768 or higher resolution, 65,536 or more colors

1.1.2 Development Environments

- Renesas electronics Compiler for RX [CC-RX] V3.01.00 or later
- GCC for Renesas 4.8.4.201902 or later
- IAR Embedded Workbench 4.12.1 or later

2. Support List

2.1 Support Devices List

Below is a list of devices supported by the Smart Configurator for RX V2.13.0.

Table 2-1 Support Devices

Group (HW Manual number)	PIN	Device name
RX110 Group (R01UH0421EJ0120)	36pin	R5F5110HAxLM, R5F5110JAxLM, R5F51101AxLM, R5F51103AxLM
	40pin	R5F51101AxNF, R5F51103AxNF, R5F5110HAxNF, R5F5110JAxNF
	48pin	R5F51101AxNE, R5F51103AxNE, R5F51104AxNE, R5F51105AxNE, R5F5110JAxNE, R5F51101AxFL, R5F51103AxFL, R5F51104AxFL, R5F51105AxFL, R5F5110JAxFL
	64pin	R5F51101AxLF, R5F51103AxLF, R5F51104AxLF, R5F51105AxLF, R5F5110JAxLF, R5F51101AxFK, R5F51103AxFK, R5F51104AxFK, R5F51105AxFK, R5F5110JAxFK, R5F51101AxFM, R5F51103AxFM, R5F51104AxFM, R5F51105AxFM, R5F5110JAxFM
RX111 Group (R01UH0365EJ0130)	36pin	R5F51111AxLM, R5F51113AxLM, R5F5111JAxLM
	40pin	R5F51111AxNF, R5F51113AxNF, R5F5111JAxNF
	48pin	R5F51111AxFL, R5F51113AxFL, R5F51114AxFL, R5F51115AxFL, R5F51116AxFL, R5F51117AxFL, R5F51118AxFL, R5F5111JAxFL, R5F51111AxNE, R5F51113AxNE, R5F51114AxNE, R5F51115AxNE, R5F51116AxNE, R5F51117AxNE, R5F51118AxNE, R5F5111JAxNE
	64pin	R5F51111AxFM, R5F51113AxFM, R5F51114AxFM, R5F51115AxFM, R5F51116AxFM, R5F51117AxFM, R5F51118AxFM, R5F5111JAxFM, R5F51111AxFK, R5F51113AxFK, R5F51114AxFK, R5F51115AxFK, R5F51116AxFK, R5F51117AxFK, R5F51118AxFK, R5F5111JAxFK, R5F51111AxLF, R5F51113AxLF, R5F51114AxLF, R5F51115AxLF, R5F51116AxLF, R5F51117AxLF, R5F51118AxLF, R5F5111JAxLF
RX113 Group (R01UH0448EJ0110)	64pin	R5F51135AxFM, R5F51136AxFM, R5F51137AxFM, R5F51138AxFM
	100pin	R5F51135AxLJ, R5F51136AxLJ, R5F51137AxLJ, R5F51138AxLJ, R5F51135AxFP, R5F51136AxFP, R5F51137AxFP, R5F51138AxFP
RX130 Group (R01UH0560EJ0200)	48pin	R5F51303AxFL, R5F51305AxFL, R5F51303AxNE, R5F51305AxNE, R5F51306AxNE, R5F51306AxFL, R5F51307AxNE, R5F51307AxFL, R5F51308AxNE, R5F51308AxFL, R5F51306BxFL
	64pin	R5F51303AxFM, R5F51305AxFM, R5F51303AxFK, R5F51305AxFK, R5F51306AxFK, R5F51306AxFM, R5F51307AxFK, R5F51307AxFM, R5F51308AxFK, R5F51308AxFM R5F51308AxFK, R5F51308AxFM, R5F51306BxFK, R5F51306BxFM
	80pin	R5F51303AxFN, R5F51305AxFN, R5F51306AxFN, R5F51306BxFN
	100pin	R5F51305AxFP, R5F51306AxFP, R5F51307AxFP, R5F51308AxFP, R5F51305BxFP, R5F51306BxFP
RX13T Group (R01UH0822EJ0100)	32pin	R5F513T3AxFJ, R5F513T5AxFJ, R5F513T3AxNH, R5F513T5AxNH
	48pin	R5F513T5AxFL, R5F513T3AxFL, R5F513T5AxNE, R5F513T3AxNE
RX230 Group (R01UH0496EJ0110)	48pin	R5F52305AxNE, R5F52306AxNE, R5F52305AxFL, R5F52306AxFL
	64pin	R5F52305AxND, R5F52306AxND, R5F52305AxFM, R5F52306AxFM, R5F52305AxLF, R5F52306AxLF
	100pin	R5F52305AxLA, R5F52306AxLA, R5F52305AxFP, R5F52306AxFP

Table 2-2 Support Devices

Group (HW Manual number)	PIN	Device name
RX231 Group (R01UH0496EJ0110)	48pin	R5F52315AxNE, R5F52316AxNE, R5F52317AxNE, R5F52318AxNE, R5F52315CxNE, R5F52316CxNE, R5F52317BxNE, R5F52318BxNE, R5F52315AxFL, R5F52316AxFL, R5F52317AxFL, R5F52318AxFL, R5F52315CxFL, R5F52316CxFL, R5F52317BxFL, R5F52318BxFL
	64pin	R5F52315AxND, R5F52316AxND, R5F52317AxND, R5F52318AxND, R5F52315CxND, R5F52316CxND, R5F52317BxND, R5F52318BxND, R5F52315AxFM, R5F52316AxFM, R5F52317AxFM, R5F52318AxFM, R5F52315CxFM, R5F52316CxFM, R5F52317BxFM, R5F52318BxFM, R5F52315CxLF, R5F52316CxLF
	100pin	R5F52315AxLA, R5F52316AxLA, R5F52317AxLA, R5F52318AxLA, R5F52315CxLA, R5F52316CxLA, R5F52317BxLA, R5F52318BxLA, R5F52315AxFP, R5F52316AxFP, R5F52317AxFP, R5F52318AxFP, R5F52315CxFP, R5F52316CxFP, R5F52317BxFP, R5F52318BxFP
RX23E-A Group (R01UH0801EJ0100)	40pin	R5F523E5AxNF, R5F523E6AxNF, R5F523E5SxNF, R5F523E6SxNF
	48pin	R5F523E5AxFL, R5F523E6AxFL, R5F523E5SxFL, R5F523E6SxFL
RX23T Group (R01UH0520EJ0110)	48pin	R5F523T3AxFL, R5F523T5AxFL
	52pin	R5F523T5AxFD, R5F523T3AxFD
	64pin	R5F523T5AxFM, R5F523T3AxFM
RX23W Group (R01UH0823EJ0100)	56pin	R5F523W8BxNG, R5F523W8AxNG, R5F523W7BxNG, R5F523W7AxNG
	83pin	R5F523W8CxLN, R5F523W8DxLN
	85pin	R5F523W7AxBL, R5F523W8AxBL, R5F523W8BxBL, R5F523W7BxBL
RX24T Group (R01UH0576EJ0200)	64pin	R5F524TAAxFM, R5F524T8AxFM, R5F524TAAxFK, R5F524T8AxFK
	80pin	R5F524TAAxFF, R5F524T8AxFF, R5F524TAAxFN, R5F524T8AxFN
	100pin	R5F524TCAxFP, R5F524T8AxFP, R5F524TBAxFP, R5F524TEAxFP, R5F524TAAxFP
RX24U Group (R01UH0658EJ0100)	100pin	R5F524UEAxFP, R5F524UCAxFP, R5F524UBAxFP
	144pin	R5F524UEAxFB, R5F524UBAxFB, R5F524UCAxFB
RX64M Group (R01UH0377EJ0110)	100pin	R5F564MFCxFP, R5F564MFCxLJ, R5F564MFDxFP, R5F564MFDxLJ, R5F564MGCxFP, R5F564MGCxLJ, R5F564MGDxFP, R5F564MGDxLJ, R5F564MJCxFP, R5F564MJCxLJ, R5F564MJDxFP, R5F564MJDxLJ, R5F564MLCxFP, R5F564MLCxLJ, R5F564MLDxFP, R5F564MLDxLJ
	144/145pin	R5F564MFCxFB, R5F564MFCxLK, R5F564MFDxFB, R5F564MFDxLK, R5F564MGCxFB, R5F564MGCxLK, R5F564MGDxFB, R5F564MGDxLK, R5F564MJCxFB, R5F564MJCxLK, R5F564MJDxFB, R5F564MJDxLK, R5F564MLCxFB, R5F564MLCxLK, R5F564MLDxFB, R5F564MLDxLK
	176/177pin	R5F564MFDxFC, R5F564MFDxBG, R5F564MFDxLC, R5F564MFCxFC, R5F564MFCxBG, R5F564MFCxLC, R5F564MGDxFC, R5F564MGDxBG, R5F564MGDxLC, R5F564MGCxFC, R5F564MGCxBG, R5F564MGCxLC, R5F564MJDxFC, R5F564MJDxBG, R5F564MJDxLC, R5F564MJCxFC, R5F564MJCxBG, R5F564MJCxLC, R5F564MLDxFC, R5F564MLDxBG, R5F564MLDxLC, R5F564MLCxFC, R5F564MLCxBG, R5F564MLCxLC

Table 2-3 Support Devices

Group (HW Manual number)	PIN	Device name
RX65N Group (R01UH0590EJ0210)	100pin	R5F565N9AxLJ, R5F565N9BxLJ, R5F565N9ExLJ, R5F565N9FxLJ, R5F565N7AxLJ, R5F565N7BxLJ, R5F565N7ExLJ, R5F565N7FxLJ, R5F565N4AxLJ, R5F565N4BxLJ, R5F565N4ExLJ, R5F565N4FxLJ, R5F565N9AxFP, R5F565N9BxFP, R5F565N9ExFP, R5F565N9FxFP, R5F565N7AxFP, R5F565N7BxFP, R5F565N7ExFP, R5F565N7FxFP, R5F565N4AxFP, R5F565N4BxFP, R5F565N4ExFP, R5F565N4FxFP, R5F565NCHxLJ, R5F565NCDxLJ, R5F565NEHxLJ, R5F565NEDxLJ, R5F565NCHxFP, R5F565NCDxFP, R5F565NEHxFP, R5F565NEDxFP
	144/145 pin	R5F565N9AxFB, R5F565N9BxFB, R5F565N9ExFB, R5F565N9FxFB, R5F565N7AxFB, R5F565N7BxFB, R5F565N7ExFB, R5F565N7FxFB, R5F565N4AxFB, R5F565N4BxFB, R5F565N4ExFB, R5F565N4FxFB, R5F565NCHxFB, R5F565NCDxFB, R5F565NEHxFB, R5F565NEDxFB, R5F565N9AxLK, R5F565N9BxLK, R5F565N9ExLK, R5F565N9FxLK, R5F565N7AxLK, R5F565N7BxLK, R5F565N7ExLK, R5F565N7FxLK, R5F565N4AxLK, R5F565N4BxLK, R5F565N4ExLK, R5F565N4FxLK, R5F565NCHxLK, R5F565NCDxLK, R5F565NEHxLK, R5F565NEDxLK
	176/177 pin	R5F565NCHxBG, R5F565NCDxBG, R5F565NEHxBG, R5F565NEDxBG, R5F565NCHxFC, R5F565NCDxFC, R5F565NEHxFC, R5F565NEDxFC, R5F565NCHxLC, R5F565NCDxLC, R5F565NEHxLC, R5F565NEDxLC
RX651 Group (R01UH0590EJ0210)	64pin	R5F5651CHxFM, R5F56514FxFM, R5F5651EHxFM, R5F5651CDxFM, R5F56514FxBP, R5F56514BxFM, R5F56519FxBP, R5F5651CDxBP, R5F5651EDxBP, R5F5651EDxFM, R5F56517BxBP, R5F5651EHxBP, R5F56519BxBP, R5F56517FxBP, R5F5651CHxBP, R5F56519FxFM, R5F56517BxFM, R5F56514BxBP, R5F56519BxFM, R5F56517FxFM
	100pin	R5F56519AxLJ, R5F56519BxLJ, R5F56519ExLJ, R5F56519FxLJ, R5F56517AxLJ, R5F56517BxLJ, R5F56517ExLJ, R5F56517FxLJ, R5F56514AxLJ, R5F56514BxLJ, R5F56514ExLJ, R5F56514FxLJ, R5F56519AxFP, R5F56519BxFP, R5F56519ExFP, R5F56519FxFP, R5F56517AxFP, R5F56517BxFP, R5F56517ExFP, R5F56517FxFP, R5F56514AxFP, R5F56514BxFP, R5F56514ExFP, R5F56514FxFP
	144/145 pin	R5F56519AxFB, R5F56519BxFB, R5F56519ExFB, R5F56519FxFB, R5F56517AxFB, R5F56517BxFB, R5F56517ExFB, R5F56517FxFB, R5F56514AxFB, R5F56514BxFB, R5F56514ExFB, R5F56514FxFB, R5F5651CDxFB, R5F5651CHxFB, R5F5651EDxFB, R5F5651EHxFB, R5F56519AxLK, R5F56519BxLK, R5F56519ExLK, R5F56519FxLK, R5F56517AxLK, R5F56517BxLK, R5F56517ExLK, R5F56517FxLK, R5F56514AxLK, R5F56514BxLK, R5F56514ExLK, R5F56514FxLK, R5F5651CDxLK, R5F5651CHxLK, R5F5651EDxLK, R5F5651EHxLK
	176/177 pin	R5F5651CDxBG, R5F5651CDxFC, R5F5651CHxBG, R5F5651CHxFC, R5F5651EDxBG, R5F5651EDxFC, R5F5651EHxBG, R5F5651EHxFC, R5F5651CDxLC, R5F5651CHxLC, R5F5651EDxLC, R5F5651EHxLC
RX66N Group (R01UH0825EJ0100)	100pin	R5F566NNDxFP, R5F566NNHxFP, R5F566NDDxFP, R5F566NDHxFP
	144pin	R5F566NNDxFB, R5F566NNHxFB, R5F566NDDxFB, R5F566NDHxFB
	145pin	R5F566NNDxLK, R5F566NNHxLK, R5F566NDDxLK, R5F566NDHxLK
	176pin	R5F566NNDxFC, R5F566NNHxFC, R5F566NDDxFC, R5F566NDHxFC, R5F566NNDxBG, R5F566NNHxBG, R5F566NDDxBG, R5F566NDHxBG
	244pin	R5F566NNDxBD, R5F566NNHxBD, R5F566NDDxBD, R5F566NDHxBD

Table 2-4 Support Devices

Group (HW Manual number)	PIN	Device name
RX66T Group (R01UH0749EJ0120)	48pin	R5F566TABxFL, R5F566TAFxFL, R5F566TEBxFL, R5F566TEFxFL
	64pin	R5F566TAAxFM, R5F566TAExFM, R5F566TEAxFM, R5F566TEExFM
	80pin	R5F566TAAxFF, R5F566TAExFF, R5F566TEAxFF, R5F566TEExFF, R5F566TAAxFN, R5F566TAExFN, R5F566TEAxFN, R5F566TEExFN
	100pin	R5F566TKCxFP, R5F566TAExFP, R5F566TFFxFP, R5F566TFCxFP, R5F566TFExFP, R5F566TFBxFP, R5F566TFAxFP, R5F566TABxFP, R5F566TAFxFP, R5F566TEFxFP, R5F566TKFxFP, R5F566TKGxFP, R5F566TKAxFP, R5F566TKExFP, R5F566TKBxFP, R5F566TEBxFP, R5F566TEExFP, R5F566TEAxFP, R5F566TAAxFP, R5F566TFGxFP
	112pin	R5F566TAAxFH, R5F566TAExFH, R5F566TEExFH, R5F566TEAxFH
	144pin	R5F566TKCxFB, R5F566TFGxFB, R5F566TFCxFB, R5F566TKGxFB
RX71M Group (R01UH0493EJ0110)	100pin	R5F571MLCxFP, R5F571MLDxFP, R5F571MLGxFP, R5F571MLHxFP, R5F571MJCxFP, R5F571MJDxFP, R5F571MJGxFP, R5F571MJHxFP, R5F571MGCxFP, R5F571MGDxFP, R5F571MFGxFP, R5F571MGHxFP, R5F571MFCxFP, R5F571MFDxFP, R5F571MFGxFP, R5F571MFHxFP, R5F571MLCxLJ, R5F571MLDxLJ, R5F571MLGxLJ, R5F571MLHxLJ, R5F571MJCxLJ, R5F571MJDxLJ, R5F571MJGxLJ, R5F571MJHxLJ, R5F571MGCxLJ, R5F571MGDxLJ, R5F571MGGxLJ, R5F571MGHxLJ, R5F571MFCxLJ, R5F571MFDxLJ, R5F571MFGxLJ, R5F571MFHxLJ
	144/145pin	R5F571MLCxLK, R5F571MLDxLK, R5F571MLGxLK, R5F571MLHxLK, R5F571MJCxLK, R5F571MJDxLK, R5F571MJGxLK, R5F571MJHxLK, R5F571MGCxLK, R5F571MGDxLK, R5F571MGGxLK, R5F571MGHxLK, R5F571MFCxLK, R5F571MFDxLK, R5F571MFGxLK, R5F571MFHxLK, R5F571MLCxLB, R5F571MLDxLB, R5F571MLGxLB, R5F571MLHxLB, R5F571MJCxLB, R5F571MJDxLB, R5F571MJGxLB, R5F571MJHxLB, R5F571MGCxLB, R5F571MGDxLB, R5F571MGGxLB, R5F571MGHxLB, R5F571MFCxLB, R5F571MFDxLB, R5F571MFGxLB, R5F571MFHxLB
	176/177pin	R5F571MLCxFC, R5F571MLDxFC, R5F571MLGxFC, R5F571MLHxFC, R5F571MJCxFC, R5F571MJDxFC, R5F571MJGxFC, R5F571MJHxFC, R5F571MGCxFC, R5F571MGDxFC, R5F571MGGxFC, R5F571MGHxFC, R5F571MFCxFC, R5F571MFDxFC, R5F571MFGxFC, R5F571MFHxFC, R5F571MLCxLC, R5F571MLDxLC, R5F571MLGxLC, R5F571MLHxLC, R5F571MJCxLC, R5F571MJDxLC, R5F571MJGxLC, R5F571MJHxLC, R5F571MGCxLC, R5F571MGDxLC, R5F571MGGxLC, R5F571MGHxLC, R5F571MFCxLC, R5F571MFDxLC, R5F571MFGxLC, R5F571MFHxLC, R5F571MLCxBG, R5F571MLDxBG, R5F571MLGxBG, R5F571MLHxBG, R5F571MJCxBG, R5F571MJDxBG, R5F571MJGxBG, R5F571MJHxBG, R5F571MGCxBG, R5F571MGDxBG, R5F571MGGxBG, R5F571MGHxBG, R5F571MFCxBG, R5F571MFDxBG, R5F571MFGxBG, R5F571MFHxBG
RX72M Group (R01UH0804EJ0110)	100pin	R5F572MDDxFP, R5F572MDHxFP, R5F572MNDxFP, R5F572MNHxFP
	144pin	R5F572MDDxFB, R5F572MDHxFB, R5F572MNDxFB, R5F572MNHxFB
	176pin	R5F572MNHxFC, R5F572MDDxBG, R5F572MNDxFC, R5F572MDHxBG, R5F572MDDxFC, R5F572MNHxBG, R5F572MNDxBG, R5F572MDHxFC
	224pin	R5F572MDDxBD, R5F572MDHxBD, R5F572MNHxBD, R5F572MNDxBD

Table 2-5 Support Devices

Group (HW Manual number)	PIN	Device name
RX72N Group (R01UH0824EJ0100)	100pin	R5F572NNDxFP, R5F572NNHxFP, R5F572NDDxFP, R5F572NDHxFP
	144pin	R5F572NNDxFB, R5F572NNHxFB, R5F572NDDxFB, R5F572NDHxFB
	145pin	R5F572NNDxLK, R5F572NNHxLK, R5F572NDDxLK, R5F572NDHxLK
	176pin	R5F572NNDxFC, R5F572NNHxFC, R5F572NDDxFC, R5F572NDHxFC, R5F572NNDxBG, R5F572NNHxBG, R5F572NDDxBG, R5F572NDHxBG
	224pin	R5F572NNDxBD, R5F572NNHxBD, R5F572NDDxBD, R5F572NDHxBD
RX72T Group (R01UH0803EJ0100)	100pin	R5F572TKExFP, R5F572TFFxFP, R5F572TKFxFP, R5F572TFGxFP, R5F572TKCxFP, R5F572TFBxFP, R5F572TFExFP, R5F572TFCxFP, R5F572TFAxFP, R5F572TKAxFP, R5F572TKBxFP, R5F572TKGxFP
	144pin	R5F572TKGxFB, R5F572TKCxFB, R5F572TFGxFB, R5F572TFCxFB
RX671 Group (R01UH0899EJ0100)	48pin	R5F5671EHxNE, R5F5671EDxNE, R5F5671CHxNE, R5F5671CDxNE, R5F56719HxNE, R5F56719DxNE
	64pin	R5F5671EHxFM, R5F5671EDxFM, R5F5671CHxFM, R5F5671CDxFM, R5F56719HxFM, R5F56719DxFM, R5F5671EHxBP, R5F5671EDxBP, R5F5671CHxBP, R5F5671CDxBP, R5F56719HxBP, R5F56719DxBP
	100pin	R5F5671EHxFP, R5F5671EDxFP, R5F5671CHxFP, R5F5671CDxFP, R5F56719HxFP, R5F56719DxFP, R5F5671EHxLJ, R5F5671EDxLJ, R5F5671CHxLJ, R5F5671CDxLJ, R5F56719HxLJ, R5F56719DxLJ
	144pin	R5F5671EHxFB, R5F5671EDxFB, R5F5671CHxFB, R5F5671CDxFB, R5F56719HxFB, R5F56719DxFB
	145pin	R5F5671EHxLE, R5F5671EDxLE, R5F5671CHxLE, R5F5671CDxLE, R5F56719HxLE, R5F56719DxLE, R5F5671EHxLK, R5F5671EDxLK, R5F5671CHxLK, R5F5671CDxLK, R5F56719HxLK, R5F56719DxLK
RX140 Group (R01UH0905EJ0110)	32pin	R5F51403AxFJ, R5F51403AxNH
	48pin	R5F51403AxFL, R5F51403AxNE, R5F51405AxFL, R5F51405AxNE, R5F51405BxFL, R5F51405BxNE, R5F51406AxFL, R5F51406AxNE, R5F51406BxFL, R5F51406BxNE
	64pin	R5F51403AxFK, R5F51403AxFM, R5F51405AxFK, R5F51405AxFM, R5F51405BxFK, R5F51405BxFM, R5F51406AxFK, R5F51406AxFM, R5F51406BxFK, R5F51406BxFM
	80pin	R5F51405AxFN R5F51405BxFN, R5F51406AxFN, R5F51406BxFN

2.2 Support Components List

Below is a list of Components supported by the Smart Configurator for RX V2.13.0.

Table 2-6 Support Components (RX100, RX200 family)

✓ : Support, - : Non-support

No	Components	Mode	RX110	RX111	RX113	RX130	RX13T	RX140	RX230, RX231	RX23E-A	RX23T	RX23W	RX24T, RX24U	Remarks
1	8-Bit Timer	-	-	-	✓	✓	-	✓	✓	✓	✓	✓	✓	
2	CRC Calculator	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
3	D-A Converter	-	-	✓	✓	✓	✓	✓	✓	-	✓	✓	✓	
4	DMA Controller	-	-	-	-	-	-	-	✓	✓	-	✓	-	
5	I2C Slave Mode	I2C mode	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		SMBus mode	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
6	I2C Master Mode	I2C mode	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		SMBus mode	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
7	LCD Controller	-	-	✓	-	-	-	-	-	-	-	-	-	
8	PWM Mode Timer	PWM mode 1	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		PWM mode 2	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
9	SCI/SCIF Clock Synchronous Mode	Transmission	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 1, 2
		Reception	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 1, 2
		Transmission/Reception	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 1, 2
10	SCI/SCIF Asynchronous Mode	Transmission	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 1
		Reception	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 1
		Transmission/Reception	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 1
		Multi-processor Transmission	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 1
		Multi-processor Reception	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 1
		Multi-processor Transmission/Reception	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 1
11	SPI Clock Synchronous Mode	Slave transmit/receive	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Slave transmit only	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Master transmit/receive	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Master transmit only	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
12	SPI Operation Mode	Slave transmit/receive	✓	✓	✓	✓	-	✓	✓	✓	✓	✓	✓	
		Slave transmit only	✓	✓	✓	✓	-	✓	✓	✓	✓	✓	✓	
		Master transmit/receive	✓	✓	✓	✓	-	✓	✓	✓	✓	✓	✓	
		Master transmit only	✓	✓	✓	✓	-	✓	✓	✓	✓	✓	✓	
		Multi-master transmit/receive	✓	✓	✓	✓	-	✓	✓	✓	✓	✓	✓	
		Multi-master transmit only	✓	✓	✓	✓	-	✓	✓	✓	✓	✓	✓	
13	Event Link Controller	-	-	✓	✓	✓	-	✓	✓	✓	-	✓	-	
14	Watchdog Timer	-	✓	✓	✓	✓	-	✓	✓	✓	✓	✓	✓	
15	Clock Frequency Accuracy Measurement Circuit	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	

Note 1. Refer to No 2, 3 in Table 6-2

Note 2. Refer to No 4 in Table 6-2

Table 2-7 Support Components (RX100, RX200 family)

✓: Support, -: Non-support

No	Components	Mode	RX110	RX111	RX113	RX130	RX13T	RX140	RX230, RX231	RX23E-A	RX23T	RX23W	RX24T, RX24U	Remarks
16	Group Scan Mode S12AD	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
17	Comparator	-	-	-	✓	✓	✓	✓	✓	-	-	✓	-	
18	Compare Match Timer	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
19	Single Scan Mode S12AD	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
20	Smart Card Interface Mode	Transmission	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Reception	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Transmission/Reception	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
21	Dead-time Compensation Counter	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	-	✓	
22	Data Transfer Controller	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 3
23	Data Operation Circuit	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
24	Normal Mode Timer	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
25	Buses	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
26	Programmable Pulse Generator	-	-	-	-	-	-	-	-	-	-	-	-	
27	Ports	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
28	Port Output Enable	-	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
29	Real Time Clock	Binary	✓	✓	✓	✓	-	✓	✓	-	-	✓	-	
		Calendar	✓	✓	✓	✓	-	✓	✓	-	-	✓	-	
30	Remote Control Signal Receiver	-	-	-	✓	-	-	-	-	-	-	-	-	
31	Low-Power Timer	-	-	-	✓	✓	-	✓	✓	✓	-	✓	-	
32	Phase Counting Mode Timer	16-Bit Phase Counting Mode	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Cascade Connection 32-Bit Phase Counting Mode	-	-	-	-	✓	-	-	-	✓	-	✓	
33	Interrupt Controller	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
34	General PWM Timer	Saw-wave PWM mode	-	-	-	-	-	-	-	-	✓	-	✓	Note 4
		Saw-wave one-shot pulse mode	-	-	-	-	-	-	-	-	✓	-	✓	Note 4
		Triangle-wave PWM mode 1	-	-	-	-	-	-	-	-	✓	-	✓	Note 4
		Triangle-wave PWM mode 2	-	-	-	-	-	-	-	-	✓	-	✓	Note 4
		Triangle-wave PWM mode 3	-	-	-	-	-	-	-	-	✓	-	✓	Note 4
35	Low Power Consumption	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
36	Complementary PWM Mode Timer	Complementary PWM mode 1	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Complementary PWM mode 2	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Complementary PWM mode 3	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
37	Continuous Scan Mode S12AD	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		

Note 3. Refer to No 8 in Table 6-1

Note 4. Refer to No 1 in Table 6-1

Table 2-8 Support Components (RX100, RX200 family)

✓ : Support, -: Non-support

No	Components	Mode	RX110	RX111	RX113	RX130	RX13T	RX140	RX230, RX231	RX23E-A	RX23T	RX23W	RX24T, RX24U	Remarks
38	Voltage Detection Circuit	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
39	Delta-Sigma Modulator Interface	Master	-	-	-	-	-	-	-	-	-	-	-	
		Slave	-	-	-	-	-	-	-	-	-	-	-	
40	Single Scan Mode DSAD	-	-	-	-	-	-	✓	-	✓	-	-	-	
41	Continuous Scan Mode DSAD	-	-	-	-	-	-	✓	-	✓	-	-	-	
42	Analog Front End	-	-	-	-	-	-	✓	-	✓	-	-	-	
43	Motor	3-Phase Brushless DC Motor	-	-	-	-	✓	-	-	-	✓	-	✓	
		2-Phase Stepping Motor (Fast Decay)	-	-	-	-	✓	-	-	-	✓	-	✓	
		2-Phase Stepping Motor (Slow Decay)	-	-	-	-	✓	-	-	-	✓	-	✓	

Table 2-9 Support Components (RX600, RX700 family)

✓ : Support, - : Non-support

No	Components	Mode	RX64M	RX65N, RX651	RX66N	RX66T	RX671	RX71M	RX72M	RX72N	RX72T	Remarks
1	8-Bit Timer	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	
2	CRC Calculator	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	
3	D/A Converter	-	✓	✓	✓	✓	-	✓	✓	✓	✓	
4	DMA Controller	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	
5	I2C Slave Mode	I2C mode	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		SMBus mode	✓	✓	✓	✓	✓	✓	✓	✓	✓	
6	I2C Master Mode	I2C mode	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		SMBus mode	✓	✓	✓	✓	✓	✓	✓	✓	✓	
7	LCD Controller	-	-	-	-	-	-	-	-	-	-	
8	PWM Mode Timer	PWM mode 1	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		PWM mode 2	✓	✓	✓	✓	✓	✓	✓	✓	✓	
9	SCI/SCIF Clock Synchronous Mode	Transmission	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 1, 2
		Reception	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 1, 2
		Transmission/Reception	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 1, 2
10	SCI/SCIF Asynchronous Mode	Transmission	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 1
		Reception	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 1
		Transmission/Reception	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 1
		Multi-processor Transmission	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 1
		Multi-processor Reception	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 1
		Multi-processor Transmission/Reception	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 1
11	SPI Clock Synchronous Mode	Slave transmit/receive	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Slave transmit only	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Master transmit/receive	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Master transmit only	✓	✓	✓	✓	✓	✓	✓	✓	✓	
12	SPI Operation Mode	Slave transmit/receive	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Slave transmit only	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Slave receive only	-	-	-	-	✓	-	-	-	-	
		Master transmit/receive	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Master transmit only	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Multi-master transmit/receive	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Multi-master transmit only	✓	✓	✓	✓	✓	✓	✓	✓	✓	
13	Event Link Controller	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	
14	Watchdog Timer	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	
15	Clock Frequency Accuracy Measurement Circuit	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	

Note 1. Refer to No 2, 3 in Table 6-2

Note 2. Refer to No 4 in Table 6-2

Table 2-10 Support Components (RX600, RX700 family)

✓ : Support, - : Non-support

No	Components	Mode	RX64M	RX65N, RX651	RX66N	RX66T	RX671	RX71M	RX72M	RX72N	RX72T	Remarks
16	Group Scan Mode S12AD	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	
17	Comparator	-	-	-	-	✓	-	-	✓	-	✓	
18	Compare Match Timer	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	
19	Single Scan Mode S12AD	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	
20	Smart Card Interface Mode	Transmission	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Reception	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Transmission/Reception	✓	✓	✓	✓	✓	✓	✓	✓	✓	
21	Dead-time Compensation Counter	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	
22	Data Transfer Controller	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	Note 3
23	Data Operation Circuit	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	
24	Normal Mode Timer	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	
25	Buses	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	
26	Programmable Pulse Generator	-	✓	✓	✓	-	✓	✓	-	✓	-	
27	Ports	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	
28	Port Output Enable	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	
29	Real Time Clock	Binary	✓	✓	✓	-	✓	✓	-	✓	-	
		Calendar	✓	✓	✓	-	✓	✓	-	✓	-	
30	Remote Control Signal Receiver	-	-	-	-	✓	-	-	-	-	-	
31	Low-Power Timer	-	-	-	-	-	-	-	-	-	-	
32	Phase Counting Mode Timer	16-Bit Phase Counting Mode	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Cascade Connection 32-Bit Phase Counting Mode	✓	✓	✓	✓	✓	✓	✓	✓	✓	
33	Interrupt Controller	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	
34	General PWM Timer	Saw-wave PWM mode	✓	-	✓	✓	-	✓	✓	✓	✓	Note 4
		Saw-wave one-shot pulse mode	✓	-	✓	✓	-	✓	✓	✓	✓	Note 4
		Triangle-wave PWM mode 1	✓	-	✓	✓	-	✓	✓	✓	✓	Note 4
		Triangle-wave PWM mode 2	✓	-	✓	✓	-	✓	✓	✓	✓	Note 4
		Triangle-wave PWM mode 3	✓	-	✓	✓	-	✓	✓	✓	✓	Note 4
35	Low Power Consumption	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	
36	Complementary PWM Mode Timer	Complementary PWM mode 1	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Complementary PWM mode 2	✓	✓	✓	✓	✓	✓	✓	✓	✓	
		Complementary PWM mode 3	✓	✓	✓	✓	✓	✓	✓	✓	✓	
37	Continuous Scan Mode S12AD	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	

Note 3. Refer to No 8 in Table 6-1

Note 4. Refer to No 1 in Table 6-1

Table 2-11 Support Components (RX600, RX700 family)

✓ : Support, -: Non-support

No	Components	Mode	RX64M	RX65N, RX651	RX66N	RX66T	RX671	RX71M	RX72M	RX72N	RX72T	Remarks
38	Voltage Detection Circuit	-	✓	✓	✓	✓	✓	✓	✓	✓	✓	
39	Delta-Sigma Modulator Interface	Master	-	-	-	-	-	-	✓	-	-	
		Slave	-	-	-	-	-	-	✓	-	-	
40	Single Scan Mode DSAD	-	-	-	-	-	-	-	-	-	-	
41	Continuous Scan Mode DSAD	-	-	-	-	-	-	-	-	-	-	
42	Analog Front End	-	-	-	-	-	-	-	-	-	-	
43	Motor	3-Phase Brushless DC Motor	-	-	-	✓	-	-	✓	-	✓	
		2-Phase Stepping Motor (Fast Decay)	-	-	-	✓	-	-	✓	-	✓	
		2-Phase Stepping Motor (Slow Decay)	-	-	-	✓	-	-	✓	-	✓	

2.3 New support

2.3.1 BSP (Board Support Package) revision update

From Smart Configurator for RX V2.13.0, BSP rev7.10 is supported and will be added as default BSP when creating project.

2.3.2 New package support

From Smart Configurator for RX V2.13.0, the following new packages have been supported.

RX140 Group (R01UH0905EJ0110)	48 pins	R5F51405AxFL, R5F51405AxNE, R5F51405BxFL, R5F51405BxNE, R5F51406AxFL, R5F51406AxNE, R5F51406BxFL, R5F51406BxNE
	64 pins	R5F51405AxFK, R5F51405AxFM, R5F51405BxFK, R5F51405BxFM, R5F51406AxFK, R5F51406AxFM, R5F51406BxFK, R5F51406BxFM
	80 pins	R5F51405AxFN, R5F51405BxFN, R5F51406AxFN, R5F51406BxFN
RX66T Group (R01UH0749EJ0120)	48 pins	R5F566TABxFL, R5F566TAFxFL, R5F566TEBxFL, R5F566TEFxFL

Table 2-1: New supported packages

2.3.3 Code Generation software component support for RI600V4 project

From Smart Configurator for RX V2.13.0, Code Generation software components have supported RI600V4 project, they are now available for selection on the "New Component" dialog.

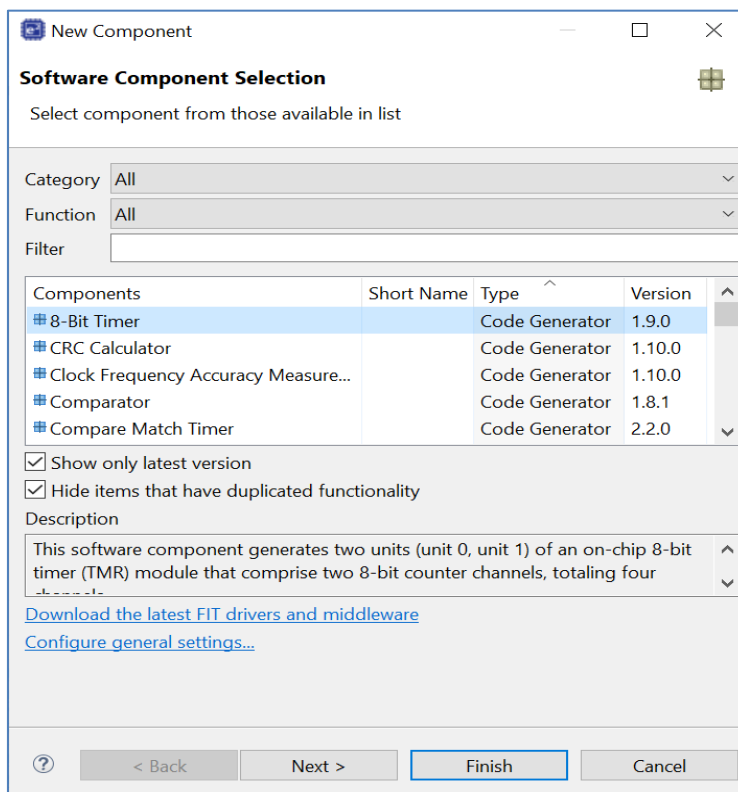


Figure 2-1: CG software components are selectable on the "New component" dialog

2.3.4 Turn off function support for automated code generation feature after build

From Smart Configurator for RX V2.13.0, automated code generation feature can be turned off by unchecking the “SC Code Generation Builder” setting in the project property of e² studio.

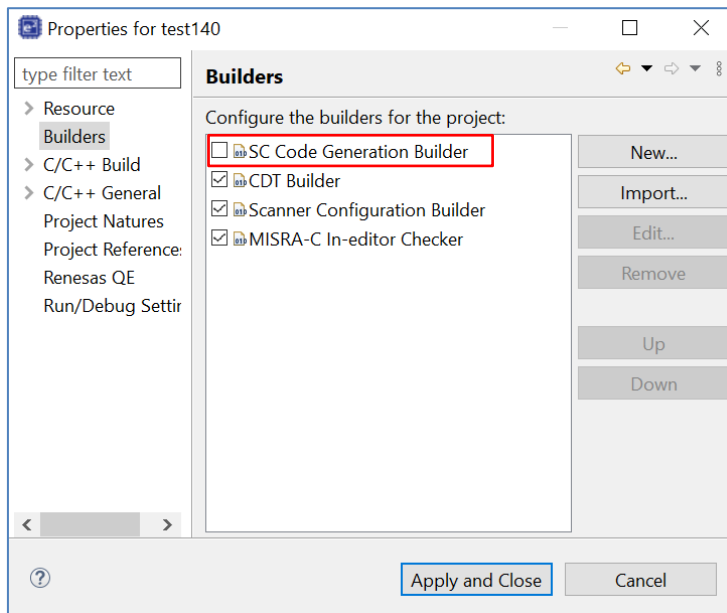


Figure 2-2: “SC Code Generation Builder” setting in the project property

3. Changes

This chapter describes changes to the Smart Configurator for RX V2.13.0.

3.1 Correction of issues/limitations

Table 3-1 List of Correction of issues/limitations (RX100, RX200 Family) ✓ : Applicable, -: Not Applicable

No	Description	RX110	RX111	RX113	RX130	RX13T	RX140	RX230, RX231	RX23E-A	RX23T	RX23W	RX24T, RX24U	Remarks
1	Fixed the CLKOUT pin setting issue on the clock page	✓	✓	✓	✓	-	✓	✓	-	-	-	-	
2	Fixed the comment block missing issue when using communication components	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
3	Fixed the incorrect function category issue for Touch QE API component	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
4	Fixed the build error when using AN107 in S12AD Continuous Scan Mode component	-	-	-	-	-	-	-	-	-	-	-	
5	Fixed the build error for Smart Configurator C++ project	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
6	Fixed the SC Code Generation builder setting re-generation issue after disabling it	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
7	Fixed the build error for Smart Configurator RTOS C++ project	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
8	Fixed the interrupt disable issue in repeat mode when using Data Transfer Controller component	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
9	Fixed the file re-generation issue when file content has no change	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	

Table 3-2 List of Correction of issues/limitations (RX600, RX700 Family) ✓ : Applicable, -: Not Applicable

No	Description	RX64M	RX65N, RX651	RX66N	RX66T	RX671	RX71M	RX72M	RX72N	RX72T	Remarks
1	Fixed the CLKOUT pin setting issue on the clock page	-	-	-	-	-	-	-	-	-	
2	Fixed the comment block missing issue when using communication components	✓	✓	✓	✓	✓	✓	✓	✓	✓	
3	Fixed the incorrect function category issue for Touch QE API component	✓	✓	✓	✓	✓	✓	✓	✓	✓	
4	Fixed the build error when using AN107 in S12AD Continuous Scan Mode component	-	-	-	✓	-	-	-	-	✓	
5	Fixed the build error for Smart Configurator C++ project	✓	✓	✓	✓	✓	✓	✓	✓	✓	
6	Fixed the SC Code Generation builder setting re-generation issue after disabling it	✓	✓	✓	✓	✓	✓	✓	✓	✓	
7	Fixed the build error for Smart Configurator RTOS C++ project	✓	✓	✓	✓	✓	✓	✓	✓	✓	
8	Fixed the interrupt disable issue in repeat mode when using Data Transfer Controller component	✓	✓	✓	✓	✓	✓	✓	✓	✓	
9	Fixed the file re-generation issue when file content has no change	✓	✓	✓	✓	✓	✓	✓	✓	✓	

3.1.1 Fixed the CLKOUT pin setting issue on the clock page

When configuring the clock settings on the clock page, the CLKOUT pin setting is not configurable even it is allowable based on Hardware User Manual. This issue has been fixed from SC for RX V2.13.0

3.1.2 Fixed the comment block missing issue when using communication components

When using the communication components and using DTC/DMAC for data handling, the comment block for user codes protection is not generated in the interrupt service handler API. This issue has been fixed from SC for RX V2.13.0

3.1.3 Fixed the incorrect function category issue for Touch QE API component

When using the "Capacitive touch" function category to filter out corresponding components from "New component" dialog, the Touch QE API component is not listed out from the component list. This issue has been fixed from SC for RX V2.13.0

3.1.4 Fixed the build error when using AN107 in S12AD Continuous Scan Mode component

When using AN107 in S12AD Continuous Scan Mode component, after generating codes and build, there will be a build error saying "E0520136: Struct "<unnamed>" has no field "ANSA107"" in the output console. This issue has been fixed from SC for RX V2.13.0

3.1.5 Fixed the build error for Smart Configurator C++ project

When open the existing C++ project created by Smart Configurator for RX V2.11.0 (equivalent to e² studio 2021-10) or earlier version into Smart Configurator for RX V2.12.0 (equivalent to e² studio 2022-01) and updating the BSP component version to 7.00 onwards, there will be a build error saying "F0520035: #error directive: "This version of FIT needs C99 (or later)"" in the output console when building the project with this new BSP version codes. This issue has been fixed from SC RX V2.13.0

3.1.6 Fixed the SC Code Generation builder setting re-generation issue after disabling it

When disable the SC Code Generation builder in the e² studio builder setting, a new SC Code Generation builder setting will be re-generated out after restarting e2 studio. This issue has been fixed from SC for RX V2.13.0

3.1.7 Fixed the build error for Smart Configurator RTOS C++ project

When create a new Smart Configurator RTOS C++ CCRX project (FreeRTOS & Azure RTOS) and update BSP version to v7.00 in e² studio, then generate codes and build, there will be a build error saying "E0562310: Undefined external symbol "_abort" referenced in "error"" in the output console. This issue has been fixed from SC for RX V2.13.0

3.1.8 Fixed the interrupt disable issue in repeat mode when using Data Transfer Controller component

When using Data Transfer Controller (DTC) component, the interrupt cannot be disabled when selecting repeat mode. This issue has been fixed from SC for RX V2.13.0

3.1.9 Fixed the file re-generation issue when file content has no change

When clicking the "Generate Code" button to generate codes, the following files are always generated even their content has no change. This issue has been fixed from SC for RX V2.13.0

Clock files	r_smc_cgc.c; r_smc_cgc.h; r_smc_cgc_user.c
Interrupt files	r_smc_interrupt.c; r_smc_interrupt.h
BSP files	platform.h; r_bsp_config.h; r_bsp_interrupt_config.h
Pin files	pin.c, pin.h

3.2 Specification changes

Table 3-3 List of Specification changes (RX100, RX200 family)

o: Applicable, /: Not Applicable

No	Description	RX110	RX111	RX113	RX130	RX13T	RX140	RX230, RX231	RX23E-A	RX23T	RX23W	RX24T, RX24U	Remarks
1	The function categories that do not have any components are removed	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
2	File generations console messages are only output for files that are generated	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
3	IAR IPCF file structure has been improved to support RTOS project	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	

Table 3-4 List of Specification changes (RX600, RX700 family)

o: Applicable, /: Not Applicable

No	Description	RX64M	RX65N, RX651	RX66N	RX66T	RX671	RX71M	RX72M	RX72N	RX72T	Remarks
1	The function categories that do not have any components are removed	✓	✓	✓	✓	✓	✓	✓	✓	✓	
2	File generations console messages are only output for files that are generated	✓	✓	✓	✓	✓	✓	✓	✓	✓	
3	IAR IPCF file structure has been improved to support RTOS project	✓	✓	✓	✓	✓	✓	✓	✓	✓	

3.2.1 The function categories that do not have any components are removed

From Smart Configurator RX V2.13.0, the function categories that do not have any components have been removed from the “Function” combo box on the “New Component” dialog.

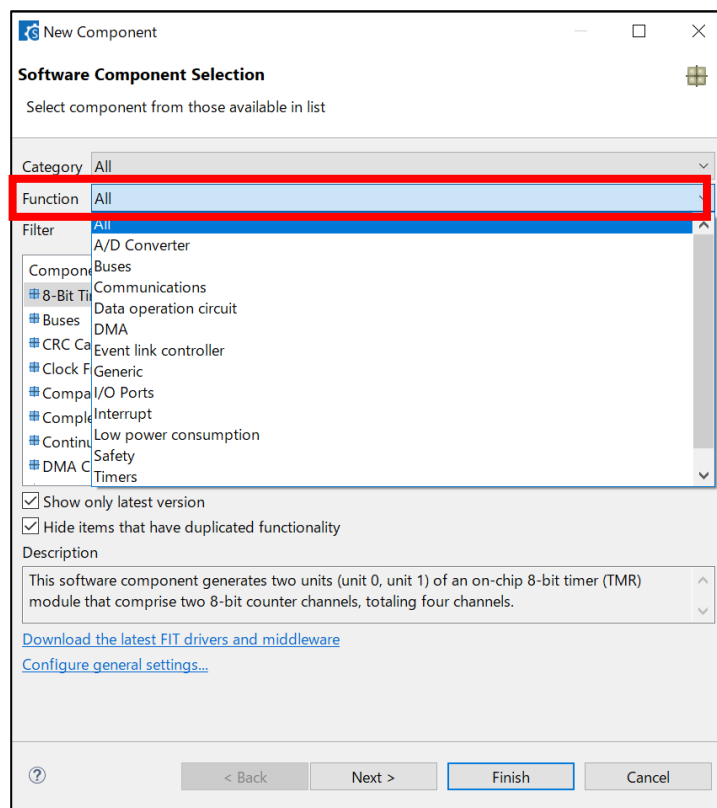


Figure 3-1 "New Component" dialog

3.2.2 The file generation console messages are only output for files that are generated

From Smart Configurator RX V2.13.0, the file generation console messages are only output for files that are generated, which is different from previous specification in V2.12.0 where file generation console messages are output for all files, even for files that are not re-generated as content has no change.

3.2.3 The IAR IPCF file structure has been improved to support RTOS project

From Smart Configurator RX V2.13.0, to assure loading all generated files of RTOS project into IAR project, the root of the IPCF file structure has been changed from "smc_gen" to "src".

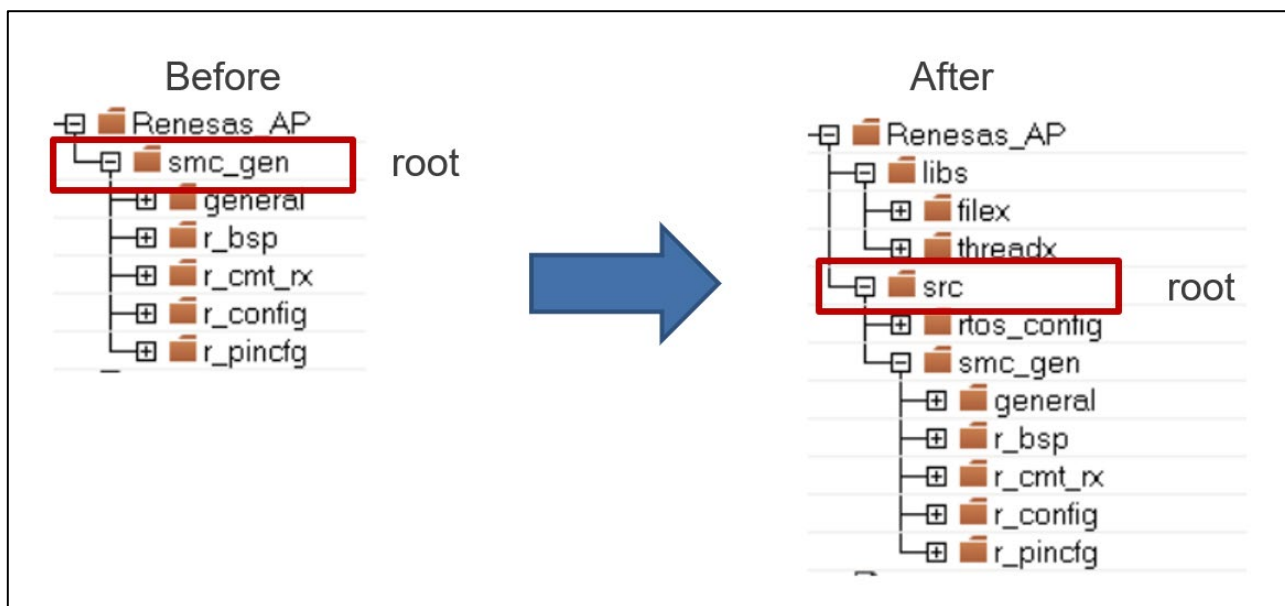


Figure 3-2 Improvement of IAR IPCF file structure

4. List of RENESAS TOOL NEWS AND TECHNICAL UPDATE

Below is a list of notifications delivered by RENESAS TOOL NEWS and TECHNICAL UPDATE.

Issue date	Document No.	Description	Applicable MCUs	Fixed version
Sep. 1, 2017	R20TS0198	1. When using the I2C bus interface in slave mode https://www.renesas.com/document/tnn/notes-e-studio-smart-configurator-plug-smart-configurator-rx	RX130, RX64M, RX651, RX65N	V1.3.0
Apr. 1, 2018	R20TS0294	1. When using the bus for peripheral functions https://www.renesas.com/document/tnn/notes-cs-smart-configurator-rx-e-studio-smart-configurator-plug	RX230, RX231	V1.4.0
Oct. 01, 2018	R20TS0351	1. Setting TPU0 channel of PWM Mode Timer https://www.renesas.com/document/tnn/notes-e-studio-smart-configurator-plug-smart-configurator-rx-0	RX65N, RX651, RX64M	V1.5.0
Feb.01, 2019	R20TS0401	1. Point for caution when using the GTIOcnm pin (n = 0 to 9, m = A, B) of the general PWM timer (GPTW) as a hardware source https://www.renesas.com/document/tnn/notes-e-studio-smart-configurator-plug-smart-configurator-rx-1	RX66T	V2.1.0
Apr.16, 2019	R20TS0425	1. When using the I2C bus interface in master mode https://www.renesas.com/document/tnn/notes-e-studio-smart-configurator-plug-smart-configurator-rx-2	RX110, RX111, RX113, RX130, RX230, RX231, RX23T, RX24T, RX24U, RX64M, RX651, RX65N, RX71M	V2.2.0
Jun.01, 2019	R20TS0434	1. When using self-diagnosis function of 12-bit A/D converter in Single Scan Mode 2. When using Serial Peripheral Interface clock synchronous mode in slave transmit 3. When using I2C Bus Interface with Fast-mode Plus enabled https://www.renesas.com/document/tnn/notes-e-studio-smart-configurator-plug-smart-configurator-rx-3	RX230, RX231, RX66T, RX72T, RX64M, RX651, RX65N, RX71M	V2.2.0

Issue date	Document No.	Description	Applicable MCUs	Fixed version
Jun.16, 2019	R20TS0436	1. When using general PWM timer https://www.renesas.com/document/tnn/notes-e-studio-smart-configurator-plug-smart-configurator-rx-4	RX66T, RX72T	V2.2.0
Aug.01, 2019	R20TS0466	1. When using the NACK reception transfer suspension function on the I ² C bus interface https://www.renesas.com/document/tnn/notes-e-studio-smart-configurator-plug-smart-configurator-rx-5	RX110, RX111, RX113, RX130, RX230, RX231, RX23T, RX24T, RX24U, RX64M, RX651, RX65N, RX66T, RX71M, RX72M, RX72T	V2.3.0
Sep.16, 2019	R20TS0477	1. When Using the Automatic Adjustment Function for Time Error Adjustment on the Realtime Clock https://www.renesas.com/document/tnn/notes-e-studio-smart-configurator-plug-smart-configurator-rx-6	RX110, RX111, RX113, RX130, RX230, RX231, RX64M, RX651, RX65N	V2.4.0
Dec.16, 2019	R20TS0522	1. When using temperature sensor output or internal reference voltage for comparison function on S12AD components (Single Scan Mode, Group Scan Mode and Continuous Scan Mode) 2. When using calendar mode API to set counter value on RTC component 3. When using window B for comparison function on S12AD Continuous Scan Mode component 4. When using double trigger mode on S12AD Single Scan Mode component https://www.renesas.com/document/tnn/notes-e-studio-smart-configurator-plug-smart-configurator-rx-7	RX64M, RX651, RX65N, RX66T, RX71M, RX72M, RX72T	V2.4.0
Feb. 01, 2020	R20TS0546	1. When using the PLL frequency synthesizer of the clock https://www.renesas.com/document/tnn/notes-e-studio-smart-configurator-plug-smart-configurator-rx-8	RX64M, RX651, RX65N, RX66T, RX71M, RX72T	V2.5.0

Issue date	Document No.	Description	Applicable MCUs	Fixed version
Mar. 16, 2020	R20TS0555	<ol style="list-style-type: none"> When using the TGIC7 and TGID7 interrupts in Normal Mode Timer or PWM Mode Timer When creating a project with RX24T 64-pin FK packages When using compare level of AN109 in Single Scan Mode S12AD https://www.renesas.com/document/tnn/notes-e-studio-smart-configurator-plug-smart-configurator-rx-9	RX24T, RX24U, RX71M	V2.5.0
Apr.03, 2020	TN-RX*-A0222	Errata to RX72N Group User's Manual: Hardware Rev.1.00 https://www.renesas.com/document/tcu/errata-rx72n-group-users-manual-hardware-rev100	RX72N	V2.5.0
May.16, 2020	R20TS0579	<ol style="list-style-type: none"> When using Stop API in Continuous Scan Mode DSAD and Single Scan Mode DSAD components https://www.renesas.com/document/tnn/notes-e-studio-smart-configurator-plug-smart-configurator-rx-10	RX23E-A	V2.6.0
Jun.16, 2020	R20TS0591	<ol style="list-style-type: none"> When using Data Transfer Controller (DTC) component and making configuration for its vector base address When using SCI/SCIF Asynchronous Mode component and making configuration for its bit-rate When using AN007 or AN107 as analog input pins in S12AD components https://www.renesas.com/document/tnn/notes-e-studio-smart-configurator-plug-smart-configurator-rx-11	RX230, RX231, RX651, RX65N, RX66T, RX72T	V2.6.0
Aug. 21, 2020	TN-RX*-A0234A/E	Errata to the RX113 Group User's Manual: Hardware Rev.1.10 https://www.renesas.com/document/tcu/errata-rx113-group-users-manual-hardware	RX113	V2.8.0
Sep. 01, 2020	R20TS0611	When using PWM Mode component and making configuration with MTU channel 1 and 2 https://www.renesas.com/document/tnn/notes-e-studio-smart-configurator-plug-smart-configurator-rx-13	RX13T, RX23T, RX24T, RX24U	V2.7.0

Issue date	Document No.	Description	Applicable MCUs	Fixed version
Sep. 24, 2020	TN-RX*-A0235B/E	Notes on the Transmit Data Empty Interrupt When the FIFO is in Use with the Serial Communications Interface (SCI) https://www.renesas.com/document/tcu/notes-transmit-data-empty-interrupt-when-fifo-use-serial-communications-interface-sci	RX651, RX65N, RX66N, RX66T, RX72M, RX72N, RX72T	V2.7.0
Oct. 01, 2020	R20TS0623	1. When using “r_sci_rx” component and making pin configurations for RXD and TXD 2. When using “r_sci_rx” component, duplicate SCI11 channels are displayed in the Components configuration panel https://www.renesas.com/document/tnn/notes-e-studio-smart-configurator-plug-smart-configurator-rx-12	RX651, RX65N, RX66N, RX72M, RX72N	V2.7.0
Dec. 01, 2020	R20TS0638	1. Note on setting timer operation period in Motor component. 2. When loading project with port configuration created in V2.5.0 or version before into V2.6.0 version onwards https://www.renesas.com/document/tnn/notes-e-studio-smart-configurator-plug-smart-configurator-rx-14	RX13T, RX23T, RX24T, RX24U, RX651, RX65N, RX66T, RX72T, RX72M	V2.8.0
Aug. 29, 2017	TN-RX*-A180A/E	Restriction for the PH7/XCIN Pin https://www.renesas.com/document/tcu/restriction-ph7xcin-pin	RX110, RX111, RX113	V2.9.1
May. 16, 2021	R20TS0696	When using PORT component and configuring PORTC multiplexed pins as input https://www.renesas.com/us/en/document/tnn/notes-e-studio-smart-configurator-plug-smart-configurator-rx-15	RX130, RX230, RX231	V2.10.0
Aug. 01, 2021	R20TS0735	When using Port Output Enable (POE) component and configuring MTU pins as high impedance https://www.renesas.com/sq/zh/document/tnn/notes-e2-studio-smart-configurator-plug-smart-configurator-rx	RX23W, RX24T, RX64M, RX651, RX71M, RX72M	V2.11.0

Issue date	Document No.	Description	Applicable MCUs	Fixed version
Nov. 16, 2021	R20TS0770	When using Port component and configuring port pins' driving ability as high drive output https://www.renesas.com/us/en/document/tnn/notes-e-studio-smart-configurator-plugin-smart-configurator-rx-16	RX651, RX65N	V2.12.0
Mar. 01, 2022	R20TS0820	<ol style="list-style-type: none"> When importing existing C++ project and updating BSP component version to 7.00 onwards When build or clean e² studio Smart Configurator project When using AN107 in S12AD Continuous Scan Mode component https://www.renesas.com/document/tnn/notes-e-studio-smart-configurator-plugin-smart-configurator-rx-17 	RX110, RX111, RX113, RX130, RX13T, RX140, RX230, RX231, RX23E-A, RX23T, RX23W, RX24T, RX24U, RX651, RX65N, RX66N, RX66T, RX671, RX72M, RX72N, RX72T, RX64M, RX71M	V2.13.0

5. Points for Limitation

This section describes points for limitation regarding the Smart Configurator for RX V2.13.0. Regarding to FIT component driver limitation, please refer to its document generated out after code generation.

5.1 List of Limitation

Table 5-1 List of limitations (RX100, RX200 Family)

✓: Applicable, -: Not Applicable

No	Description	RX110	RX111	RX113	RX130	RX13T	RX140	RX230, RX231	RX23E-A	RX23T	RX23W	RX24T, RX24U	Remarks
1	Note on the inconsistent code generation behavior issue when loading existing project with Port configuration	✓	✓	✓	✓	-	-	✓	-	-	-	-	
2	Note on general I/O port direction issue on MCU package view when using Port Component	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
3	Note on the resource tree in the FIT component GUI configuration	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
4	Note on address pin when using external bus	-	-	-	-	-	-	✓	-	-	✓	-	
5	Note on section address issue when configuring bank mode to dual mode	-	-	-	-	-	-	-	-	-	-	-	
6	Note on the function pin SS12# when using RX140 32 pin packages	-	-	-	-	-	✓	-	-	-	-	-	

Table 5-2 List of Limitation (RX600, RX700 family)

✓: Applicable, -: Not Applicable

No	Description	RX64M	RX65N, RX651	RX66N	RX66T	RX671	RX71M	RX72M	RX72N	RX72T	Remarks
1	Note on the inconsistent code generation behavior issue when loading existing project with Port configuration	✓	✓	-	✓	-	✓	-	-	✓	
2	Note on the general I/O port direction issue on MCU package view when using Port Component	✓	✓	✓	✓	✓	✓	✓	✓	✓	
3	Note on the resource tree in the FIT component GUI configuration	✓	✓	✓	✓	✓	✓	✓	✓	✓	
4	Note on address pin when using external bus	✓	✓	✓	✓	✓	✓	✓	✓	✓	
5	Note on section address issue when configuring bank mode to dual mode	-	✓	✓	-	✓	-	✓	✓	-	
6	Note on the function pin SS12# when using RX140 32 pin packages	-	-	-	-	-	-	-	-	-	

5.2 Details of Limitation

5.2.1 Note on the inconsistent code generation behavior issue when loading existing project with Port configuration

When loading old Smart Configurator project (V2.4.0 or before) with Port configuration into later version (V2.6.0 or later), and some port pins not configured as GPIO, if clicking "Generate Code" button without opening Port configuration GUI, then CMOS register setting codes will not be generated, but these codes will be generated out if clicking "Generate Code" button with Port configuration GUI open, this inconsistent behavior will have an impact on customer application and it will be fixed from next release.

5.2.2 Note on the general I/O port direction issue on MCU package view when using Port Component

When adding two configurations for Port component and set different direction for the same port pin in these two configurations, e.g. set P14 as output in 1st configuration while P14 as input in the 2nd configuration, after that remove the 2nd configuration, but now the P14 direction is marked as 'I' on the MCU package view for 1st configuration.

5.2.3 Note on the resource tree in the FIT component GUI configuration

When configuring the FIT component, the resource tree is still visible even there is no pins under it, for such case it will be hidden from next release.

Property	Value
# RX FIFO threshold for channel 9	8
# RX FIFO threshold for channel 10	8
# RX FIFO threshold for channel 11	8
# Received data match function for chann	Not
# Received data match function for chann	Not
# Received data match function for chann	Not
# Received data match function for chann	Not
# Received data match function for chann	Not
# Received data match function for chann	Not
# Received data match function for chann	Not
# Received data match function for chann	Not
# Received data match function for chann	Not
# Received data match function for chann	Not
# Received data match function for chann	Not
# Received data match function for chann	Not
# Received data match function for chann	Not
# Received data match function for chann	Not
# Received data match function for chann	Not
Resources	
SCI	

Figure 5-1: Resource tree without any pin in FIT component GUI

5.2.4 Note on address bus when using external bus

When using Address/Data multiplexed bus in external bus, disable all unnecessary address output pin settings.

Address output pin setting

<input type="checkbox"/> A7-A0, BC0#, DQM2, DQM3				Settings for External Address Buses A0 to A7: Set PA0 to PA7. Settings for External Address Buses A16 to A23: (Option 1) Set PC0 to PC7. (Option 2) Set PC0, PC1, P71, P72, P74, and PC5 to PC7. (Option 3) Set P90 to P97.
<input type="checkbox"/> A8	<input type="checkbox"/> A9	<input type="checkbox"/> A10	<input type="checkbox"/> A11	
<input type="checkbox"/> A12	<input type="checkbox"/> A13	<input type="checkbox"/> A14	<input type="checkbox"/> A15	
<input type="checkbox"/> A16	<input type="checkbox"/> A17	<input type="checkbox"/> A18	<input type="checkbox"/> A19	
<input type="checkbox"/> A20	<input type="checkbox"/> A21	<input type="checkbox"/> A22	<input type="checkbox"/> A23	

Figure 5-2: “Address output pin setting” value should be disabled

5.2.5 Note on section address issue when configuring bank mode to dual mode

When configuring the bank mode setting to dual mode via the BSP GUI and then generate codes, the “C_1” section address is incorrect as it is still for linear mode. Please do not configure it. This issue will be fixed from next release.

5.2.6 Note on the function pin SS12# when using RX140 32 pin packages

When using Smart Configurator with RX140 32 pin package devices, function pin SS12# is still configurable on the pin page although it is not supported by these packages. Please do not configure it. This issue will be fixed from next release.

6. Points for Caution

This section describes points for caution regarding the Smart Configurator for RX V2.13.0. Regarding to FIT component driver caution, please refer to its document generated out after code generation.

6.1 List of Caution

Table 6-1 List of Caution (RX100, RX200 Family)

✓: Applicable, -: Not Applicable

No	Description	RX110	RX111	RX113	RX130	RX13T	RX140	RX230, RX231	RX23E-A	RX23T	RX23W	RX24T, RX24U	Remarks
1	Note on configuring GPT interrupt	-	-	-	-	-	-	-	-	-	-	✓	
2	Note on SCR.TE bit setting sequence in SCI Clock Synchronous Mode and SCI Clock Asynchronous Mode	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
3	Note on using only reception in SCI Clock Synchronous Mode	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
4	Notes on using high transfer speed in SCIF Synchronous Mode	-	-	-	-	-	-	-	-	-	-	-	
5	Note on device change functionality	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
6	Note on using Smart Configurator for GCC project in e ² studio 7.4.0	✓	✓	✓	✓	✓	-	✓	✓	✓	-	✓	
7	Note on using Data Transfer Controller	-	-	-	-	✓	✓	-	✓	-	-	-	
8	Note on Ports setting when using S12AD components	✓	-	✓	✓	-	✓	-	-	-	✓	-	
9	Note on section build warning when using FIT components	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
10	Note on C++ project support in CS+ and IAR	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
11	Note on Installation directory	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	
12	Note on the build error of RTOS C++ project	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	

Table 6-2 List of Caution (RX600, RX700 Family)

✓: Applicable, -: Not Applicable

No	Description	RX64M	RX65N, RX651	RX66N	RX66T	RX671	RX71M	RX72M	RX72N	RX72T	Remarks
1	Note on configuring GPT interrupt	✓	-	✓	✓	-	✓	✓	✓	✓	
2	Note on SCR.TE bit setting sequence in SCI Clock Synchronous Mode and SCI Clock Asynchronous Mode	✓	✓	✓	✓	✓	✓	✓	✓	✓	
3	Note on using only reception in SCI Clock Synchronous Mode	✓	✓	✓	✓	✓	✓	✓	✓	✓	
4	Notes on using high transfer speed in SCIF Synchronous Mode	✓	-	-	-	-	✓	-	-	-	
5	Note on device change functionality	✓	✓	✓	✓	✓	✓	✓	✓	✓	
6	Note on using Smart Configurator for GCC project in e ² studio 7.4.0	✓	✓	✓	✓	-	✓	-	✓	✓	
7	Note on using Data Transfer Controller	-	✓	✓	-	✓	-	✓	✓	-	
8	Note on Ports setting when using S12AD components	✓	✓	✓	-	✓	✓	✓	✓	-	
9	Note on section build warning when using FIT components	✓	✓	✓	✓	✓	✓	✓	✓	✓	
10	Note on C++ project support in CS+ and IAR	✓	✓	✓	✓	✓	✓	✓	✓	✓	
11	Note on Installation directory	✓	✓	✓	✓	✓	✓	✓	✓	✓	
12	Note on the build error of existing RTOS C++ project	✓	✓	✓	✓	✓	✓	✓	✓	✓	

6.2 Details of Caution

6.2.1 Note on configuring GPT interrupts

The GPT interrupts are not specified as the Software Configurable Interrupt in the initial state even after the GPT interrupts are configured by GPT component. To specify GPT interrupts as Software Configurable Interrupt source, release unused Software Configurable interrupt source on the Interrupt sheet and allocate GPT interrupts instead.

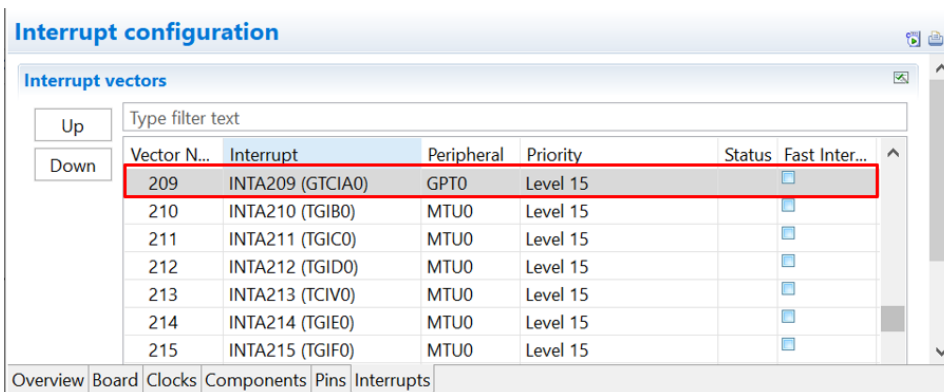
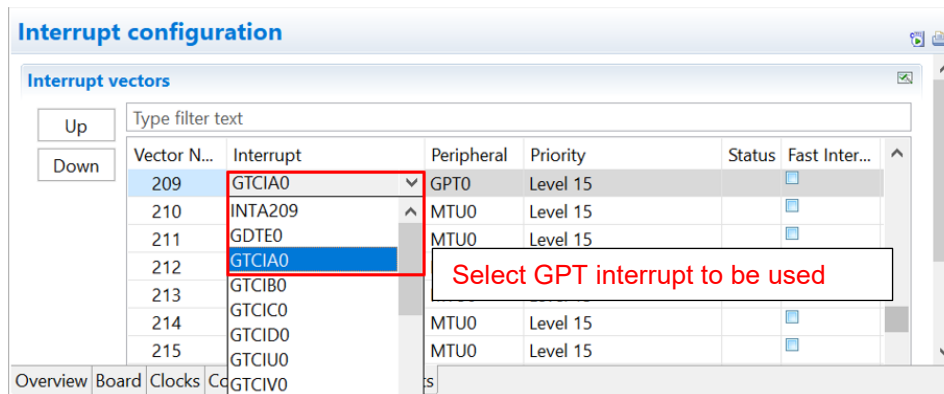
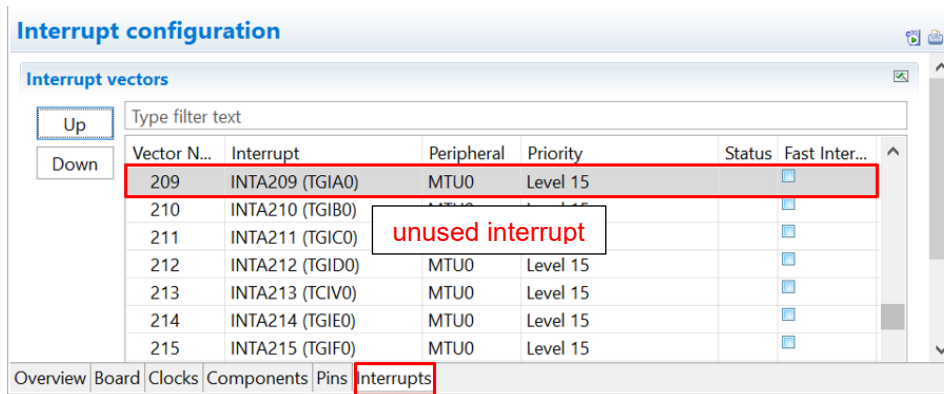


Figure 6-1: “Address output pin setting” value should be disable

6.2.2 Note on SCR.TE bit setting sequence in SCI Clock Synchronous Mode and SCI Clock Asynchronous Mode

Sequence of setting SCR.TE bit does not follow the usage note in User’s Manual: Hardware. Instead, SCR.TE bit is set to 1 after changing the pin function to TXDn. Output of TXDn pin becomes high impedance. Please connect a pull-up resistor to the TXDn line, prevent the TXDn line from becoming high impedance.

6.2.3 Note on using only reception in SCI Clock Synchronous Mode

In SCI Clock Synchronous Mode using internal clock, if only reception is enabled in high communication speed, extra clocks are generated even though reception has been completed. This is due to the delay in disabling RE to stop the clock after the desired number of data is received. To prevent this issue, select Transmission/Reception work mode when using Smart Configurator. Use “R_<Configuration Name>_Serial_Send_Receive” function instead of “R_<Configuration Name>_Serial_Receive”. The same number of data for tx_num and rx_num should be specified. Disable TXDn pin in Smart Configurator Pins page and send dummy data if transmission is not required. There will be warnings when TXDn pin is disabled. These warnings can be ignored as TXDn pin is not intended to be used originally.

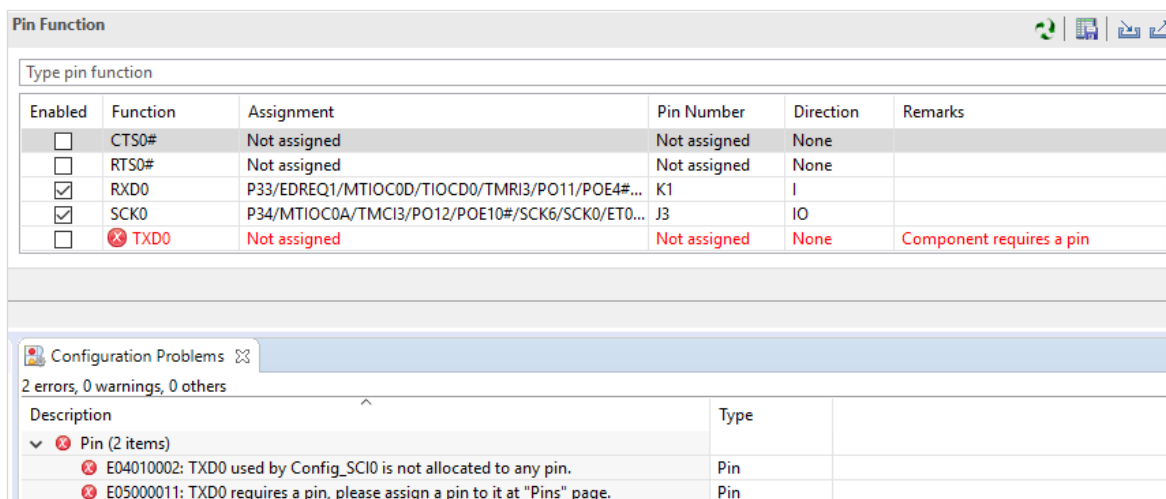


Figure 6-2: Ignore warnings when TXDn pin is disabled (Example with TXD0)

6.2.4 Note on using high transfer speed in SCIF Synchronous Mode

If the number of reception data specified for the API (R_<Configuration Name>_Serial_Receive or R_<Configuration Name>_Serial_Send_Receive) and reception FIFO threshold specified on GUI do not satisfy the formula below:

$$(\text{Reception Data Size}) = n * (\text{Reception FIFO threshold}) \quad (n=1,2,3,\dots)$$

extra clock generation may occur after the desired number of data is received in high communication speed when using internal clock.

To prevent this issue, specify the reception data size and reception FIFO threshold that satisfy the formula.

6.2.5 Note on device change functionality

Save project settings before performing change device operation. After change device, perform these operations:

1. Visual check on Components window and Configuration Problems window. Resolve error and conflicts if there is any.
2. Check each component and converted settings.
3. Re-generate codes.

6.2.6 Note on using Smart Configurator for GCC project in e2 studio 7.4.0

When using default options to create new "GCC for Renesas RX Executable Project" with Smart Configurator in e2 studio 7.4.0, build error occurs.

```
C:\example\src\smc_gen\r_bsp\mcu/all/r_bsp_common.h:55:24:
fatal error: stdbool.h: No such file or directory
```

As workaround, use e2 studio 7.5.0 to create new "GCC for Renesas RX Executable Project" with Smart Configurator.

6.2.7 Note on using Data Transfer Controller

Smart Configurator does not support sequence transfer, write-back skip, write-skip disable and displacement addition features.

6.2.8 Note on Ports setting when using S12AD components

Some pins cannot be configured as output pin when S12AD components (Single Scan Mode, Continuous Scan Mode and Group Scan Mode) are used. For more information, refer to User's Manual: Hardware of the affected groups, "12-Bit A/D Converter" chapter, "Pin Setting When Using the 12-bit A/D Converter" usage note. From SC for RX 2.4.0, this note has been highlighted on the top GUI of S12AD components.

Device groups	Port pins
RX110, RX113	P40 to P44, P46
RX113	P40 to P44, P46 P90 to P92
RX130, RX140, RX23W	P40 to P47
RX64M, RX651, RX65N, RX66N, RX71M, RX72M, RX72N	P00 to P02, P03, P05, P07 P40 to P47 P90 to P93 PD0 to PD7 PE0 to PE7
RX671	P00 to P02, P03, P05, P07 P40 to P47 P90 PD0 to PD7 PE0, PE1

6.2.9 Note on section build warning when using FIT components

When using FIT components (e.g. r_ether_rx) with section settings, these section settings will be added automatically into IDE C/C++ builder setting, but these section settings will not automatically removed from the C/C++ builder setting when these FIT components are deleted from SC, thus there are build warnings for not finding section declaration when execute build operation after these FIT components are removed, please ignore these build warnings.

6.2.10 Note on C++ project support in CS+ and IAR

When using Smart Configurator for C++ project application in CS+ and IAR Embedded Workbench for RX, please be noted to manually prepare the following content in the main.cpp generated out by these IDEs to make it work properly with Smart Configurator source codes.

- CS+: please manually add the following highlighted one line of code into main.cpp

```
#ifndef __cplusplus
//#include <ios> // Remove the comment when you use ios
//_SINT ios_base::Init::init_cnt; // Remove the comment when you use ios
#endif

void main(void);
#ifdef __cplusplus
extern "C" {
#include "r_smc_entry.h"
void abort(void);
}
#endif

void main(void)
{
}

#ifdef __cplusplus
void abort(void)
{
}
#endif
```

- IAR Embedded Workbench for RX: please add the following highlighted 5 lines of codes into main.cpp

```
#ifndef __cplusplus
extern "C" {
#include "r_smc_entry.h"
}
#endif

int main(void)
{
    return ();
}
```

6.2.11 Note on Installation directory

When installing Smart Configurator, you may get an error message "The specified path is too long" if the installation file path is longer than the maximum length permitted by Windows. The suggested way is to re-install the CS+ into its default path (C:\Program Files (x86)\Renesas Electronics\), or a folder whose paths' length is less than 65 characters, then install Smart Configurator again.

6.2.12 Note on the build error of existing RTOS C++ project

When building existing RTOS C++ CCRX project (FreeRTOS & Azure RTOS) in e² studio, there will be a build error saying "E0562310: Undefined external symbol "_abort" referenced in "error"" in the output console, these existing projects were created by Smart Configurator for RX V2.12.0 and before version while BSP version was updated to V7.00. To resolve this build error, please add the "abort" function manually into main program file.

e.g. Add the "abort" function for FreeRTOS C++ CCRX project

```
#include "FreeRTOS.h"
#include "task.h"

void main_task(void *pvParameters)
{
    /* Create all other application tasks here */

    while(1);

    vTaskDelete(NULL);
}

void abort (void)
{
}
```

Revision History

Rev.	Date	Description	
		Page	Summary
2.20	Jul.22.19	-	Create new
2.21	Oct.08.19	-	Update to Rev.2.2.1
2.30	Nov.05.19	-	Update to Rev.2.3.0
2.40	Jan.20.20	-	Update to Rev.2.4.0
2.50	Apr.20.20	-	Update to Rev.2.5.0
2.60	Jul.20.20	-	Update to Rev.2.6.0
2.70	Oct.20.20	-	Update to Rev.2.7.0
2.71	Oct.20.20	32-33	Add 3 limitations. <ul style="list-style-type: none"> Note on generated codes issue when using Motor component Note on write protection issue for pin function control registers when using Motor component Note on pin conflict error issue when using r_sci_rx FIT component
2.80	Jan.20.21	-	Update to Rev.2.8.0
2.81	Mar.22.21	-	Update to Rev.2.8.1
2.91	Apr.13.21	-	Update to Rev.2.9.1
2.92	Jul. 21.21	-	Update to Rev.2.10.0
2.93	Sep.29.21	-	Update to Rev.2.11.0
2.94	Jan.20.22	-	Update to Rev.2.12.0
2.95	Apr.20.22	-	Update to Rev.2.13.0
		7-8	Update chapter 2.1 to add new supported packages
		15-16	Create chapter 2.3 with new supported features <ul style="list-style-type: none"> Default BSP revision is updated to 7.10 RX140 ROM 256K packages and RX66T 48 packages are supported Code generation software components have supported for RI600V4 project Turn off function is supported for automated code generation feature after build
		17-18	Create chapter 3.1 with correction of issues and limitation
		19-21	Create chapter 3.2 with specification changes
		26	Add tool news R20TS0820 into chapter 4 table list
		29	Add 2 more limitation with 5.2.5 and 5.2.6 <ul style="list-style-type: none"> Note on section address issue when configuring bank mode to dual mode Note on the function pin SS12# when using RX140 32 pin packages
		36	Add one more caution note with 6.2.12 <ul style="list-style-type: none"> Note on the build error of existing RTOS C++ project

General Precautions in the Handling of Microprocessing Unit and Microcontroller Unit Products

The following usage notes are applicable to all Microprocessing unit and Microcontroller unit products from Renesas. For detailed usage notes on the products covered by this document, refer to the relevant sections of the document as well as any technical updates that have been issued for the products.

1. Precaution against Electrostatic Discharge (ESD)

A strong electrical field, when exposed to a CMOS device, can cause destruction of the gate oxide and ultimately degrade the device operation. Steps must be taken to stop the generation of static electricity as much as possible, and quickly dissipate it when it occurs. Environmental control must be adequate. When it is dry, a humidifier should be used. This is recommended to avoid using insulators that can easily build up static electricity.

Semiconductor devices must be stored and transported in an anti-static container, static shielding bag or conductive material. All test and measurement tools including work benches and floors must be grounded. The operator must also be grounded using a wrist strap. Semiconductor devices must not be touched with bare hands. Similar precautions must be taken for printed circuit boards with mounted semiconductor devices.

2. Processing at power-on

The state of the product is undefined at the time when power is supplied. The states of internal circuits in the LSI are indeterminate and the states of register settings and pins are undefined at the time when power is supplied. In a finished product where the reset signal is applied to the external reset pin, the states of pins are not guaranteed from the time when power is supplied until the reset process is completed. In a similar way, the states of pins in a product that is reset by an on-chip power-on reset function are not guaranteed from the time when power is supplied until the power reaches the level at which resetting is specified.

3. Input of signal during power-off state

Do not input signals or an I/O pull-up power supply while the device is powered off. The current injection that results from input of such a signal or I/O pull-up power supply may cause malfunction and the abnormal current that passes in the device at this time may cause degradation of internal elements. Follow the guideline for input signal during power-off state as described in your product documentation.

4. Handling of unused pins

Handle unused pins in accordance with the directions given under handling of unused pins in the manual. The input pins of CMOS products are generally in the high-impedance state. In operation with an unused pin in the open-circuit state, extra electromagnetic noise is induced in the vicinity of the LSI, an associated shoot-through current flows internally, and malfunctions occur due to the false recognition of the pin state as an input signal become possible.

5. Clock signals

After applying a reset, only release the reset line after the operating clock signal becomes stable. When switching the clock signal during program execution, wait until the target clock signal is stabilized. When the clock signal is generated with an external resonator or from an external oscillator during a reset, ensure that the reset line is only released after full stabilization of the clock signal. Additionally, when switching to a clock signal produced with an external resonator or by an external oscillator while program execution is in progress, wait until the target clock signal is stable.

6. Voltage application waveform at input pin

Waveform distortion due to input noise or a reflected wave may cause malfunction. If the input of the CMOS device stays in the area between V_{IL} (Max.) and V_{IH} (Min.) due to noise, for example, the device may malfunction. Take care to prevent chattering noise from entering the device when the input level is fixed, and also in the transition period when the input level passes through the area between V_{IL} (Max.) and V_{IH} (Min.).

7. Prohibition of access to reserved addresses

Access to reserved addresses is prohibited. The reserved addresses are provided for possible future expansion of functions. Do not access these addresses as the correct operation of the LSI is not guaranteed.

8. Differences between products

Before changing from one product to another, for example to a product with a different part number, confirm that the change will not lead to problems. The characteristics of a microprocessing unit or microcontroller unit products in the same group but having a different part number might differ in terms of internal memory capacity, layout pattern, and other factors, which can affect the ranges of electrical characteristics, such as characteristic values, operating margins, immunity to noise, and amount of radiated noise. When changing to a product with a different part number, implement a system-evaluation test for the given product.

Notice

1. Descriptions of circuits, software and other related information in this document are provided only to illustrate the operation of semiconductor products and application examples. You are fully responsible for the incorporation or any other use of the circuits, software, and information in the design of your product or system. Renesas Electronics disclaims any and all liability for any losses and damages incurred by you or third parties arising from the use of these circuits, software, or information.
2. Renesas Electronics hereby expressly disclaims any warranties against and liability for infringement or any other claims involving patents, copyrights, or other intellectual property rights of third parties, by or arising from the use of Renesas Electronics products or technical information described in this document, including but not limited to, the product data, drawings, charts, programs, algorithms, and application examples.
3. No license, express, implied or otherwise, is granted hereby under any patents, copyrights or other intellectual property rights of Renesas Electronics or others.
4. You shall be responsible for determining what licenses are required from any third parties, and obtaining such licenses for the lawful import, export, manufacture, sales, utilization, distribution or other disposal of any products incorporating Renesas Electronics products, if required.
5. You shall not alter, modify, copy, or reverse engineer any Renesas Electronics product, whether in whole or in part. Renesas Electronics disclaims any and all liability for any losses or damages incurred by you or third parties arising from such alteration, modification, copying or reverse engineering.
6. Renesas Electronics products are classified according to the following two quality grades: "Standard" and "High Quality". The intended applications for each Renesas Electronics product depends on the product's quality grade, as indicated below.
 - "Standard": Computers; office equipment; communications equipment; test and measurement equipment; audio and visual equipment; home electronic appliances; machine tools; personal electronic equipment; industrial robots; etc.
 - "High Quality": Transportation equipment (automobiles, trains, ships, etc.); traffic control (traffic lights); large-scale communication equipment; key financial terminal systems; safety control equipment; etc.Unless expressly designated as a high reliability product or a product for harsh environments in a Renesas Electronics data sheet or other Renesas Electronics document, Renesas Electronics products are not intended or authorized for use in products or systems that may pose a direct threat to human life or bodily injury (artificial life support devices or systems; surgical implantations; etc.), or may cause serious property damage (space system; undersea repeaters; nuclear power control systems; aircraft control systems; key plant systems; military equipment; etc.). Renesas Electronics disclaims any and all liability for any damages or losses incurred by you or any third parties arising from the use of any Renesas Electronics product that is inconsistent with any Renesas Electronics data sheet, user's manual or other Renesas Electronics document.
7. No semiconductor product is absolutely secure. Notwithstanding any security measures or features that may be implemented in Renesas Electronics hardware or software products, Renesas Electronics shall have absolutely no liability arising out of any vulnerability or security breach, including but not limited to any unauthorized access to or use of a Renesas Electronics product or a system that uses a Renesas Electronics product. RENESAS ELECTRONICS DOES NOT WARRANT OR GUARANTEE THAT RENESAS ELECTRONICS PRODUCTS, OR ANY SYSTEMS CREATED USING RENESAS ELECTRONICS PRODUCTS WILL BE INVULNERABLE OR FREE FROM CORRUPTION, ATTACK, VIRUSES, INTERFERENCE, HACKING, DATA LOSS OR THEFT, OR OTHER SECURITY INTRUSION ("Vulnerability Issues"). RENESAS ELECTRONICS DISCLAIMS ANY AND ALL RESPONSIBILITY OR LIABILITY ARISING FROM OR RELATED TO ANY VULNERABILITY ISSUES. FURTHERMORE, TO THE EXTENT PERMITTED BY APPLICABLE LAW, RENESAS ELECTRONICS DISCLAIMS ANY AND ALL WARRANTIES, EXPRESS OR IMPLIED, WITH RESPECT TO THIS DOCUMENT AND ANY RELATED OR ACCOMPANYING SOFTWARE OR HARDWARE, INCLUDING BUT NOT LIMITED TO THE IMPLIED WARRANTIES OF MERCHANTABILITY, OR FITNESS FOR A PARTICULAR PURPOSE.
8. When using Renesas Electronics products, refer to the latest product information (data sheets, user's manuals, application notes, "General Notes for Handling and Using Semiconductor Devices" in the reliability handbook, etc.), and ensure that usage conditions are within the ranges specified by Renesas Electronics with respect to maximum ratings, operating power supply voltage range, heat dissipation characteristics, installation, etc. Renesas Electronics disclaims any and all liability for any malfunctions, failure or accident arising out of the use of Renesas Electronics products outside of such specified ranges.
9. Although Renesas Electronics endeavors to improve the quality and reliability of Renesas Electronics products, semiconductor products have specific characteristics, such as the occurrence of failure at a certain rate and malfunctions under certain use conditions. Unless designated as a high reliability product or a product for harsh environments in a Renesas Electronics data sheet or other Renesas Electronics document, Renesas Electronics products are not subject to radiation resistance design. You are responsible for implementing safety measures to guard against the possibility of bodily injury, injury or damage caused by fire, and/or danger to the public in the event of a failure or malfunction of Renesas Electronics products, such as safety design for hardware and software, including but not limited to redundancy, fire control and malfunction prevention, appropriate treatment for aging degradation or any other appropriate measures. Because the evaluation of microcomputer software alone is very difficult and impractical, you are responsible for evaluating the safety of the final products or systems manufactured by you.
10. Please contact a Renesas Electronics sales office for details as to environmental matters such as the environmental compatibility of each Renesas Electronics product. You are responsible for carefully and sufficiently investigating applicable laws and regulations that regulate the inclusion or use of controlled substances, including without limitation, the EU RoHS Directive, and using Renesas Electronics products in compliance with all these applicable laws and regulations. Renesas Electronics disclaims any and all liability for damages or losses occurring as a result of your noncompliance with applicable laws and regulations.
11. Renesas Electronics products and technologies shall not be used for or incorporated into any products or systems whose manufacture, use, or sale is prohibited under any applicable domestic or foreign laws or regulations. You shall comply with any applicable export control laws and regulations promulgated and administered by the governments of any countries asserting jurisdiction over the parties or transactions.
12. It is the responsibility of the buyer or distributor of Renesas Electronics products, or any other party who distributes, disposes of, or otherwise sells or transfers the product to a third party, to notify such third party in advance of the contents and conditions set forth in this document.
13. This document shall not be reprinted, reproduced or duplicated in any form, in whole or in part, without prior written consent of Renesas Electronics.
14. Please contact a Renesas Electronics sales office if you have any questions regarding the information contained in this document or Renesas Electronics products.

(Note1) "Renesas Electronics" as used in this document means Renesas Electronics Corporation and also includes its directly or indirectly controlled subsidiaries.

(Note2) "Renesas Electronics product(s)" means any product developed or manufactured by or for Renesas Electronics.

(Rev.5.0-1 October 2020)

Corporate Headquarters

TOYOSU FORESIA, 3-2-24 Toyosu,
Koto-ku, Tokyo 135-0061, Japan

www.renesas.com

Trademarks

Renesas and the Renesas logo are trademarks of Renesas Electronics Corporation. All trademarks and registered trademarks are the property of their respective owners.

Contact information

For further information on a product, technology, the most up-to-date version of a document, or your nearest sales office, please visit:

www.renesas.com/contact/.