Old Company Name in Catalogs and Other Documents

On April 1st, 2010, NEC Electronics Corporation merged with Renesas Technology Corporation, and Renesas Electronics Corporation took over all the business of both companies. Therefore, although the old company name remains in this document, it is a valid Renesas Electronics document. We appreciate your understanding.

Renesas Electronics website: http://www.renesas.com

April 1st, 2010 Renesas Electronics Corporation

Issued by: Renesas Electronics Corporation (http://www.renesas.com)

Send any inquiries to http://www.renesas.com/inquiry.

REFIESAS TECHNICAL UPD

Nippon Bldg., 2-6-2, Ohte-machi, Chiyoda-ku, Tokyo 100-0004, Japan Renesas Technology Corp.

Product Category	User Development Environment		Document No.	TN-EML-A122A/E	Rev.	1.0
Title	Limitation on operation of the watchdog timer (WDT) due to a problem with the library for programming and erasing data in the flash memory		Information Category	Technical Notification		
		Lot No.		• H8S/2218 Group, H8S/2212 Group		
Applicable Product	H8S/2218F E10A Emulator (V1.00 or later) (HS2218KCM01H or HS2218KCI01H) H8S/2378F E10A Emulator (V1.01 or later) (HS2378KCM01H or HS2378KCI01H) H8S/2339F E10A Emulator (V1.00 or later) (HS2339KCM01H or HS2339KCI01H) H8/3048F-ONE E10T Emulator (V1.00 or later) (HS3048BTCM01H or HS3048BTCI01H) SH7047F E10A Emulator (V1.00 or later) (HS7047KCM01H, HS7047KCM02H, HS7047KCI01H, or HS7047KCI02H) SH7144F E10A Emulator (V1.00 or later) (HS7144KCM01H, HS7144KCM02H, HS7144KCI01H, or HS7144KCI02H)	r)	Reference Document	 Hardware Manual (RE J09B0074-03000 Rev.3 H8S/2378 Group, H8S/2378R Hardware Manual (RE J09B0109-04000 Rev.4 H8S/2339 Series, H8S/2338 S H8S/2329 Series, H8S/2388 S H8S/2319 Series, H8S/2318 S Hardware Manual (ADE-602-171A Rev.2.0) H8/3048B Group Hardware M (ADE-602-292A Rev.2.0) SH-2 SH7047 Group Hardware (RE J09B0020-0200Z Rev.2. SH7144 Group, SH7145 Grout Hardware Manual (RE J09B0108-0300Z Rev.3. 		R Group .00) Series, Series, Series, Ianual re Manual .00) up

If you use the E10A or E10T emulator, the limitation on usage of the devices listed below will be applied.

[Devices that apply]

H8S/2218F, H8S/2212F, H8S/2319EF, H8S/2329EF, H8S/2339EF, H8S/2367F, H8S/2377F, H8/3048F-ONE (H8/3048BF), SH7047F, SH7144F, and SH7145F

[Problem]

While the E10A or E10T emulator is connected, the program execution or stepping that causes programming to the flash memory will write an undefined value to register RSTCSR of the watchdog timer (WDT).

[How to prevent this problem]

While debugging the user program by using the WDT, note the followings:

- Execute [Step In] before running the user program by [Reset Go].
- If the above problem occurs, open the [IO] window and set the RSTCSR value again *.
- Use Break Condition or a forced break.
- Do not use Break point (software break).

* For how to write data to the RSTCSR, refer to the usage notes in the section of the WDT contained in the reference documents listed above.

If you use any of the devices listed in the previous page, be sure to use a debugged device to check the final state of the system.

(c) 2004. Renesas Technology Corp., All rights reserved.

