

To our customers,

Old Company Name in Catalogs and Other Documents

On April 1st, 2010, NEC Electronics Corporation merged with Renesas Technology Corporation, and Renesas Electronics Corporation took over all the business of both companies. Therefore, although the old company name remains in this document, it is a valid Renesas Electronics document. We appreciate your understanding.

Renesas Electronics website: <http://www.renesas.com>

April 1st, 2010
Renesas Electronics Corporation

Issued by: Renesas Electronics Corporation (<http://www.renesas.com>)

Send any inquiries to <http://www.renesas.com/inquiry>.

RENESAS TECHNICAL UPD

Nippon Bldg., 2-6-2, Ohte-machi, Chiyoda-ku, Tokyo 100-0004, Japan
 RenesasTechnology Corp.

Product Category	MPU&MCU	Document No.	TN-H8*-266A/EA	Rev.	1.0
Title	H8/3664Group, H8/3672Group address break Usage note.		Information Category	Correction or Supplement of Documents.	
Applicable Product	H8/3664Group, H8/3664N, H8/3672Group	Lot No.	Reference Document	H8/3664 Serise Hardware Manual, ADE-602-202C (Rev. 4.0) H8/3672 Serise Hardware Manual ADE-602-239A (Rev. 2.0)	
		All			

We would like to inform you about H8/3664 Group and H8/3672 Group address break Usage note.

When an address break is set to an instruction which is located in branch destination address of a conditional branch instruction, although it does not branch with the conditional false and the instruction which is set is not executed, address break interrupt request occurs. Therefore an address break must not be set to the instruction which is located in branch destination address of a conditional branch instruction.

