Date: Aug. 22, 2014

RENESAS TECHNICAL UPDATE

1753, Shimonumabe, Nakahara-ku, Kawasaki-shi, Kanagawa 211-8668 Japan Renesas Electronics Corporation

Product Category	MPU/MCU		Document No.	TN-SH7-A889A/E	Rev.	1.00
Title	SCI Break Detection and Processing in Asynchronous Mode		Information Category	Technical Notification		
Applicable Product	See below.	Lot No.				
		All lots	Reference Document	See below.		

A part of descriptions of serial communication interface (SCI), for the applicable products listed below, in the section of break detection and processing in asynchronous mode contains unclear description and the description is corrected as shown below.

[Corrections in the User's Manual]

Corrections of the User's Manual are described below using the SH7214 Group, SH7216 Group User's Manual: Hardware as an example.

16.7.3 Break Detection and Processing

[Before correction (p.828)]

Break signals can be detected by reading the RXD pin directly when a framing error (FER) is detected. In the break state the input from the RXD pin consists of all 0s, so the FER flag is set and the parity error flag (PER) may also be set. Note that, although transfer of receive data to SCRDR is halted in the break state, the SCI receiver continues to operate.

[After correction]

Break signals can be detected by reading the RXD pin directly when a framing error (FER) is detected. In the break state the input from the RXD pin consists of all 0s, so the FER flag is set and the parity error flag (PER) may also be set.

After a break is received, the SCI halts receive operation. At this time not only transfer of receive data from SCRSR to SCRDR stops; setting in SCRSR of serial data input on the RXD pin stops as well.

To restart receive operation, input a high-level signal on the RXD pin, and clear the overrun error (ORER), FER, and PER flags.



Date: August 22, 2014

[Applicable Products and Reference Documents]								
Series	Group	Reference Document		Ref. No.				
SH7080	SH7083, SH7084,	SH7080 Group User's Manual: Hardware		R01UH0198EJ0500				
	SH7085, SH7086			1.0.0.10.10020000				
SH7137	SH7131, SH7132,	SH7137 Group Hardware Manual	3.00	REJ09B0402-0300				
	SH7136, SH7137							
SH7146	SH7146, SH7149	SH7146 Group User's Manual: Hardware	4.00	R01UH0049EJ0400				
SH7216	SH7214, SH7216	SH7214 Group, SH7216 Group User's Manual: Hardware	4.00	R01UH0230EJ0400				
SH7231	SH7231	SH7231 Group User's Manual: Hardware	2.00	R01UH0073EJ0200				
SH7239	SH7237, SH7239	SH7239 Group, SH7237 Group User's Manual: Hardware	2.00	R01UH0086EJ0200				
SH7243	SH7243	SH7280 Group, SH7243 Group User's Manual: Hardware	3.00	R01UH0229EJ0300				
SH7280	SH7285, SH7286	SH7280 Group, SH7243 Group User's Manual: Hardware	3.00	R01UH0229EJ0300				
SH/Tiny	SH7124, SH7125	SH7125 Group, SH7124 Group Hardware Manual	5.00	REJ09B0243-0500				

End of Document

