## ISL705xRH/EH and ISL706xRH/EH

Single-Event Effects (SEE) Testing of the ISL705xRH/EH and ISL706xRH/EH Radiation Hardened Supervisory Circuits

AN1651 Rev 1.00 August 5, 2014

# Introduction

The intense heavy ion environment encountered in space applications can cause a variety of transient and destructive effects in analog circuits, including single-event latch-up (SEL), single-event transient (SET) and single-event breakdown (SEB). These effects can lead to system-level failures including disruption and permanent damage. For predictable, reliable system operation, these components have to be formally designed and fabricated for SEE hardness, followed by detailed SEE testing to validate the design. This report discusses the results of SEE testing of Intersil's ISL705xRH/EH and ISL706xRH/EH family of microprocessor supervisory circuits.

## **Reference Documents**

• ISL705ARH, ISL705BRH, ISL705CRH, ISL706ARH, ISL706BRH, ISL706CRH Data Sheet

# **Product Description**

The Intersil ISL705x and ISL706x are microprocessor supervisory circuits that monitor power supply voltage and battery functions in microprocessor systems. The ISL705x series is ideal for 5V systems while the ISL706x series is geared toward 3.3V systems. Both are offered in 3 reset options, the A versions have an active low reset option; the B versions have active high reset option and the C version offers an active low open drain reset. All circuits provide the following functions:

- 1. A reset output during power-up, power-down, and brownout conditions.
- 2. A precision 4.65V (ISL705x)/3.08V (ISL706x) power supply voltage monitor.
- 3. A watchdog timer that switches to the LOW state if the timer input has not been toggled within 1.0 second (min).
- 4. A 1.25V (ISL705x)/0.6V (ISL706x) threshold detector to monitor an auxiliary power supply voltage.
- 5. An active-low manual-reset input.

The supervisory circuits are fabricated on a 0.6µm BiCMOS junction isolated process optimized for power management applications. This integrated circuit was hardened by design to achieve a Total Ionizing Dose (TID) rating of at least 100krads(Si) at the standard 50 to 300rad(Si)/s high dose rate as well as the standard <10mrad(Si)/s low dose rate. Well known TID hardening methods were employed such as closed geometry NMOS devices to reduce leakage and optimized bias levels for bipolar devices to compensate for gain reduction. This family of supervisory circuits were also hardened by design to a Linear Energy Transfer (LET) of 86.4MeV/mg/cm<sup>2</sup> by employing various SEE hardening techniques such as proper device sizing, filtering and special layout constraints.

## **SEE Summary**

- No SEL/SEB at LET 86.4 MeV cm<sup>2</sup>/mg with  $V_{DD}$  = 6.5V
- No SET events indicating false RESETs with  $V_{DD} \ge V_{RST}$  max
- No SET events on PFO when PFI input > V<sub>PFI</sub> max

# **SEE Test Objective**

The objectives of SEE testing of the ISL705xRH/EH and ISL706xRH/EH were to evaluate its susceptibility to single-event latch-up and single-event burnout and characterize its SET behavior.

# **SEE Test Facility**

Testing was performed at the Texas A&M University (TAMU) Cyclotron Institute heavy ion facility. This facility is coupled to a K500 super-conducting cyclotron, which is capable of generating a wide range of test particles with the various energy, flux and fluence levels needed for advanced radiation testing.

# **SEE Test Procedure**

The part was tested for single-event effects using Au ions (LET =  $86.4 MeV/mg/cm^2$ ). A schematic of the SEE test circuit is shown in Figure 1.

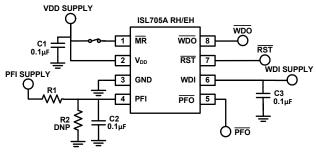


FIGURE 1. ISL705A, ISL706A SEE TEST SCHEMATIC

The device under test was mounted in the beam line and irradiated with heavy ions of the appropriate species. The parts were assembled in dual in-line packages with the metal lid removed for beam exposure. The beam was directed on to the exposed die and the beam flux, beam fluence and errors in the device outputs were measured.

The tests were controlled remotely from the control room. All input power was supplied from portable power supplies connected via cable to the device under test (DUT). The supply currents were monitored along with the device outputs. All currents were measured with digital ammeters, while all the output waveforms were monitored on a digital oscilloscope for ease of identifying the different types of SEE which the part displayed. Events were captured by triggering on changes in the output in time, such as changes in duty cycle or phase shifts.

# Single-Event Latch-up and Burnout Results

Unlike the other Intersil space products, these supervisory circuits are built in a junction-isolated process in which latch-up is at least a theoretical possibility; other Intersil Space Products use various dielectrically isolated (DI) processes in which latch-up is not possible.

Accordingly, the first testing sequence looked at destructive effects. No burnout or latch-up was observed using Au ions (LET = 86.4 MeV/mg/cm<sup>2</sup>) at 0° incidence from perpendicular. Testing was performed on four parts at +125°C (case temperature) and up to the maximum voltage ( $V_{DD} = 6.5V$ ). The first part (part ID 5) commenced testing with V<sub>DD</sub> = 5.5V and on subsequent tests V<sub>DD</sub> voltage was increased to 6V, 6.2V and 6.5V. All other parts were tested with a VDD of 6.2V and 6.5V. All test runs were run to a fluence of  $1 \times 10^7 / \text{cm}^2$ . The WDI and PFI inputs were toggled from OV to V<sub>DD</sub> at 1kHz. The MR input was tied to V<sub>DD</sub> during SEL and SEB testing. Functionality of all outputs was verified after exposure. IDD was recorded pre and post exposure, under continuous power; results are shown in Table 1. No destructive effects of any kind were encountered in these tests. It is also important to note that SEL/SEB testing was done only on the ISL705A. From a design perspective the ISL705A and the ISL706A are exactly the same; however the ISL706 series of supervisors were internally biased to different voltage levels to achieve the 3.3V specifications. The voltage thresholds, even though they are different values, are produced the same way and trimmed through a resistor ladder network. They are built in the same process and functionality is equivalent. Therefore, all ISL705A SEL/SEB results are applicable to the ISL706A.

			PRE EXPOSURE	POST EXPOSURE
PART ID	V <sub>DD</sub> (V)	TEMPERATURE (°C)	Ι <sub>DD</sub> (μΑ)	Ι <sub>DD</sub> (μΑ)
5	5.5	+125	509	509
5	6.0	+125	536	535
5	6.2	+125	546	545
5	6.5	+125	563	562
6	6.2	+125	551	551
6	6.5	+125	565	565
7	6.2	+125	555	555
7	6.5	+125	573	572
8	6.2	+125	552	552
8	6.5	+125	570	570

TABLE 1. IDD PRE AND POST SEL/SEB TESTING

## **Single-Event Transient Testing**

Transient on the outputs (RST, WDO, PFO) were counted for various supply voltages for both the ISL705A (RH/EH) and the ISL706A (RH/EH). Single-event transients (SET) are defined as a digital state change in the output based on crossing the VOH threshold for a low-high-low (LHL) transient and VOL threshold for a high-low-high (HLH) transient. Testing was performed using the same test configuration as described previously for SEB/SEL testing. Au ions with an LET of 86.4MeV/mg/cm<sup>2</sup> were used during testing and all tests were performed at +25°C. All tests were performed on 4 parts and the results are summarized in the following sections.

## **ISL705A Reset Results**

The first test set  $V_{DD}$  at 4.5V and  $\overline{MR}$  at  $V_{DD}$ ; under these conditions, Reset should be low (as  $V_{DD}$  is below the nominal  $V_{DD}$  reset threshold of 4.65V). Using a fluence of  $2 \times 10^6$ /cm<sup>2</sup>, no transients were observed during this test on any of the 4 parts. This was an encouraging result, as it means that during a low V<sub>DD</sub> condition there would be no false signals sent from Reset indicating that V<sub>DD</sub> is within tolerances. The second test set V<sub>DD</sub> at 4.75V and  $\overline{\text{MR}}$  at V<sub>DD</sub>, hence Reset should be high (as V<sub>DD</sub> is above the nominal  $V_{DD}$  reset threshold of 4.65V). Each part was run to a fluence of  $2 \times 10^6$ /cm<sup>2</sup> each and no HLH transients were observed on Reset. V<sub>DD</sub> was then raised to 5V, a more typical application, and still no transients were observed. Lastly, VDD was then raised to 5.5V and no transients were observed. In all cases where V<sub>DD</sub> was above the threshold voltage, no false signals were sent from Reset indicating that V<sub>DD</sub> was below the threshold voltage, when in reality, it wasn't.

When Reset was driven low by setting  $\overline{MR} = 0V (V_{DD} \text{ was} \text{ returned to 5V})$  there were no transients with Au ions. The test was redone with  $V_{DD}$  at 5.5V and again no transients were seen on the Reset output. Observing no transients was not a surprising result, as the SET would have to last longer than the 200ms reset timer period to get a false transition to a "1" level.

In summary, the part has no Reset LHL transients when V<sub>DD</sub> is less than 4.75V or is held low by  $\overline{\text{MR}}$  input being held low. This means the system will not have any false Reset signal telling it that V<sub>DD</sub> is within tolerance when it isn't, or that it can operate while the  $\overline{\text{MR}}$  (manual reset) is being applied. When V<sub>DD</sub> > 4.75V and  $\overline{\text{MR}}$  = "1" there are no HLH transients that would cause the system to go through an unnecessary reset cycle.

## ISL705A WDO Results

WDO has many modes of operation, depending on whether  $V_{DD}$  is below 4.5V or above 4.75V, the state of  $\overline{MR}$  and whether WDI is toggling, DC low, DC high or floating. Table 2 shows these results. With the largest cross section observed in any  $\overline{WDO}$  test being  $3.9 \times 10^{-6}$  cm<sup>2</sup>, natural space transients will be hundreds to thousands of years apart. When used as a low line indicator, ISL706A ( $\overline{WDO}$  left floating) transients were only seen when  $V_{DD}$  was below the reset threshold. Transients observed were in the range of 2µs to 20µs (see Figures 2 and 3). The only other time transients occurred was when WDI was toggling, but again,  $V_{DD}$  was below the reset threshold and the cross section is  $2.5 \times 10^{-6}$  cm<sup>2</sup> (see Figure 4).

Additional testing at lower LET levels was done on the  $\overline{WDO}$  output in the conditions that experienced SETs, e.g.,  $V_{DD} = 4.4V$  with WDI toggling and  $V_{DD} = 4.5V$  with WDI floating. Table 3 shows the cross section versus the different LET levels tested.

Note that the fluence was increased as the LET levels were lowered and that the SET events only occurred when  $V_{DD}$  is equal or slightly below the RESET threshold voltage. A typical application would not hold the supply voltage in this range.

LET (MeV/mg/cm <sup>2</sup> )	WDI STATE	V <sub>DD</sub> (V)	EXPECTED WDO STATE	LHL TRANSITIONS	HLH TRANSITIONS	FLUENCE (/cm <sup>2</sup> )	CROSS SECTION (cm <sup>2</sup> )
86.4	Toggle	4.4	0	20	N/A	8 x 10 <sup>6</sup>	2.5 x 10 <sup>-6</sup>
	Toggle $\overline{MR} = 0$	5	1	N/A	0	8 x 10 <sup>6</sup>	
	Float	4.75	1	N/A	0	8 x 10 <sup>6</sup>	
	Float	4.5	0	31	N/A	8 x 10 <sup>6</sup>	3.9 x 10 <sup>-6</sup>
	5V	5	0	0	N/A	8 x 10 <sup>6</sup>	
	ov	5	0	0	N/A	8 x 10 <sup>6</sup>	

#### TABLE 2. WDD TRANSIENTS vs MODE OF OPERATION (MR = V<sub>DD</sub> unless noted otherwise)

#### TABLE 3. WDO TRANSIENTS vs LET (MR = V<sub>DD</sub> unless noted otherwise)

LET (MeV/mg/cm <sup>2</sup> )	WDI STATE	V <sub>DD</sub> (V)	EXPECTED WDO STATE	LHL TRANSITIONS	HLH TRANSITIONS	FLUENCE (/cm <sup>2</sup> )	CROSS SECTION (cm <sup>2</sup> )		
86.4	Toggle	4.4	0	20	N/A	8 x 10 <sup>6</sup>	2.5 x 10 <sup>-6</sup>		
43	Toggle	4.4	0	4	N/A	1.6 x 10 <sup>7</sup>	2.5 x 10 <sup>-7</sup>		
28	Toggle	4.4	0	0	N/A	4 x 10 <sup>7</sup>			
8.5	Toggle	4.4	0	0	N/A	8 x 10 <sup>7</sup>			
86.4	Float	4.5	0	31	N/A	8 x 10 <sup>6</sup>	3.9 x 10 <sup>-6</sup>		
43	Float	4.5	0	37	N/A	1.6 x 10 <sup>7</sup>	2.3 x 10 <sup>-6</sup>		
28	Float	4.5	0	15	N/A	4 x 10 <sup>7</sup>	3.8 x 10 <sup>-7</sup>		
8.5	Float	4.5	0	0	N/A	8 x 10 <sup>7</sup>			



FIGURE 2. TRANSIENTS ON  $\overline{WDO}$ ,  $V_{DD} = \overline{MR} = 4.5V$ , PFI = 1.15V, WDI IS FLOATING

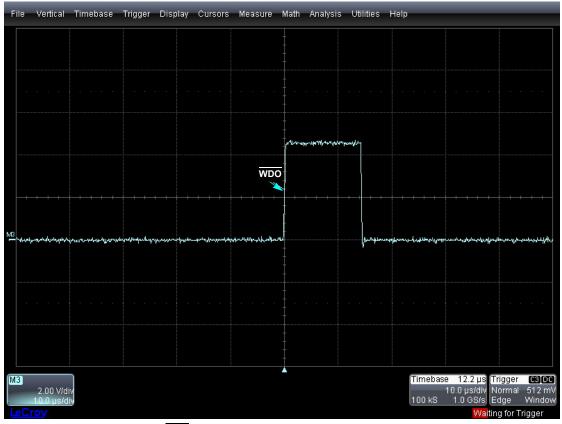


FIGURE 3. SAME WDO TRANSIENT AS Figure 2 WITH 10µs PER DIVISION TIME SCALE





FIGURE 4. TRANSIENT ON WOO (VDD = MR = 4.4V, PFI = 1.15V, WDI IS TOGGLING 0 TO VDD AT 1kHz)

## ISL705A PFO Results

The PFI/PFO function is that of a comparator with the negative input tied to an on-chip 1.25V voltage reference. The PFI input is tied to the positive comparator input and PFO is the comparator output. The specifications allow a ±50mV offset over temperature and radiation. Hence, input voltages below 1.2V set PFO low and voltages above 1.3V set PFO high. Table 4 lists PFO transients as a function of PFI input voltage for Au ions. Transients were seen when driving PFI to the minimum specs of 1.2V. By increasing the comparator overdrive, the transient cross-section can be reduced or eliminated. Even at minimum overdrive conditions (input 1.2V), the transient cross section is so small that the occurrence will be hundreds to thousands of years apart. For further reductions, an off-chip low pass filter could be used. Figure 5 shows scope traces for PFO transients with PFI at 1.2V. Note the LHL transient is 4µs to 6µs long, adding an external low-pass filter would reduce the glitch. This would add delay in the system that the designer would need to evaluate.

Additional testing at lower LET levels was done on the  $\overline{PFO}$  output in the conditions that experienced SETs, e.g.,  $V_{DD}$  = 4.75V with PFI = 1.2V. Table 5 shows the cross section versus the different LET levels tested. Note that the fluence was increased as the LET levels were lowered.

#### **ISL705A Summary**

The key objective of burnout or latch-up hardness to an LET of 86.4MeV/mg/cm<sup>2</sup> has been demonstrated. No Reset LHL SEE transients at an LET of 86.4MeV/mg/cm<sup>2</sup> have been demonstrated once V<sub>DD</sub> is above the maximum threshold voltage. Other functions have demonstrated cross sections so small as to not occur for hundreds to thousands of years. These characteristics must be evaluated by the system designer for the particular environment of interest and the usage of the available features of the ISL705A.

LET (MeV/mg/cm <sup>2</sup> )	PFI VOLTAGE (V)	V <sub>DD</sub> (V)	EXPECTED PFO STATE	LHL TRANSITIONS	HLH TRANSITIONS	FLUENCE (/cm <sup>2</sup> )	CROSS SECTION (cm <sup>2</sup> )
86.4	1.15	4.5	0	0	N/A	8 x 10 <sup>6</sup>	
	1.2	4.75	0	25	N/A	8 x 10 <sup>6</sup>	3.1 x 10 <sup>-6</sup>
	1.3	5	1	N/A	0	8 x 10 <sup>6</sup>	
	1.	5.5	1	N/A	0	8 x 10 <sup>6</sup>	

#### TABLE 4. PFO TRANSIENTS vs PFI INPUT VOLTAGE (MR = V<sub>DD</sub> unless noted otherwise)

#### Single-Event Effects (SEE) Testing of the ISL705xRH/EH and ISL706xRH/EH Radiation Hardened Supervisory Circuits

LET (MeV/mg/cm <sup>2</sup> )	PFI VOLTAGE (V)	V <sub>DD</sub> (V)	EXPECTED PFO STATE	LHL TRANSITIONS	HLH TRANSITIONS	FLUENCE (/cm <sup>2</sup> )	CROSS SECTION (cm <sup>2</sup> )				
86.4	1.2	4.75	0	25	N/A	8 x 10 <sup>6</sup>	3.1 x 10 <sup>-6</sup>				
43	1.2	4.75	0	19	N/A	1.6 x 10 <sup>7</sup>	1.2 x 10 <sup>-6</sup>				
28	1.2	4.75	0	5	N/A	4 x 10 <sup>7</sup>	1.3 x 10 <sup>-7</sup>				
8.5	1.2	4.75	0	0	N/A	8 x 10 <sup>7</sup>					



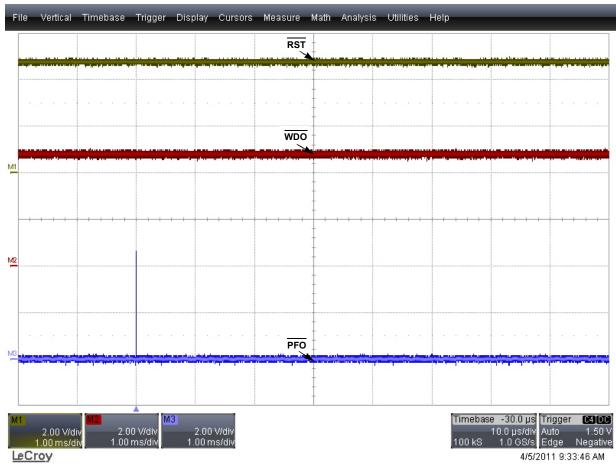


FIGURE 5. TRANSIENT ON  $\overline{PFO}$  (V<sub>DD</sub> =  $\overline{MR}$  = 4.75V, PFI = 1.2V,  $\overline{WDO}$  IS FLOATING)

#### **ISL706A Reset Results**

The ISL706A is the same as the ISL705A with different bias levels for 3.3V operation. Similar results are expected, however, the tighter voltage thresholds and the lower bias levels might introduce more transients. The first test set V<sub>DD</sub> at 3V and  $\overline{\text{MR}}$  at V<sub>DD</sub>; under these conditions, Reset should be low (as V<sub>DD</sub> is below the nominal V<sub>DD</sub> reset threshold of 3.08V). Using a fluence of  $2 \times 10^6/\text{cm}^2$ , no transients or transients were observed during this test on any of the 4 parts. This was an encouraging result, which means that during a low V<sub>DD</sub> condition, there would be no false signals sent from Reset indicating that V<sub>DD</sub> is within tolerances.

The second test set V<sub>DD</sub> at 3.15V and  $\overline{\text{MR}}$  at V<sub>DD</sub>, hence, Reset should be high (as V<sub>DD</sub> is above the nominal V<sub>DD</sub> reset threshold of 3.08V). Each part was run to a fluence of 2x10<sup>6</sup>/cm<sup>2</sup> each

and no HLH transients were observed on Reset. V<sub>DD</sub> was then raised to 3.3V, a more typical application, and still no transients were observed. Lastly, V<sub>DD</sub> was then raised to 3.6V and no transients were observed. All cases where V<sub>DD</sub> was above the threshold voltage, no false signals were sent from Reset indicating a low line condition.

When Reset was driven low by setting  $\overline{\text{MR}} = 0V$  (V<sub>DD</sub> was returned to 3.3V), there were no transients with Au ions. The test was redone with V<sub>DD</sub> at 3.6V and again, no transients were seen on the Reset output. Observing no transients was not a surprising result, as the SET would have to last longer than the 200ms Reset timer period to get a false transition to a "1" level.

In summary, the part has no Reset LHL transients when  $V_{DD}$  is less than 3V or is held low by  $\overline{MR}$  input being held low. This means the system will not have any false Reset signals telling it

that V<sub>DD</sub> is within tolerance when it isn't, or that it can operate while the  $\overline{\text{MR}}$  (manual reset) is being applied. When V<sub>DD</sub> > 3.15V and  $\overline{\text{MR}}$  = "1", there are no HLH transients that would cause the system to go through an unnecessary reset cycle.

## ISL706A WDO Results

WDO has many modes of operation, depending on whether  $V_{DD}$  is below 3.0V or above 3.15V, the state of  $\overline{MR}$  and whether WDI is toggling, DC low, DC high or floating. Table 6 shows these results. With the largest cross section observed in any  $\overline{WDO}$  test being  $98 \times 10^{-6}$  cm<sup>2</sup>, natural space transients will be hundreds to thousands of years apart. When used as a low line indicator ( $\overline{WDO}$  left floating) transients were only seen when  $V_{DD}$  was below the reset threshold. Transients observed were in the range

of 8µs to 24µs (see Figures 6 and 7). The only other time transients occurred was when WDI was toggling, thus again  $V_{DD}$  was below the reset threshold and the cross section is  $2.1 \times 10^{-6} \text{cm}^2$  (see Figures 8 and 9).

Additional testing at lower LET levels was done on the  $\overline{WDO}$  output in the conditions that experienced SETs, e.g.,  $V_{DD} = 2.9V$  with WDI toggling and  $V_{DD} = 3.0V$  with WDI floating. Table 7 shows the cross section versus the different LET levels tested. Note that the fluence was increased as the LET levels were lowered. Once again the only time the device experience SETs when the supply voltage was equal to or slightly below the RESET threshold voltage. In a typical application, the supply voltage would be at 3.3V constantly.

LET (MeV/mg/cm <sup>2</sup> )	WDI STATE	V <sub>DD</sub> (V)	EXPECTED WDO STATE	LHL TRANSITIONS	HLH TRANSITIONS	FLUENCE (/cm <sup>2</sup> )	CROSS SECTION (cm <sup>2</sup> )
86.4	Toggle	2.9	0	17	N/A	8 x 10 <sup>6</sup>	2.1 x 10 <sup>-6</sup>
	Toggle $\overline{\text{MR}} = 0$	3.3	1	N/A	0	8 x 10 <sup>6</sup>	
	Float	3.15	1	N/A	0	8 x 10 <sup>6</sup>	
	Float	3	0	784	N/A	8 x 10 <sup>6</sup>	9.8 x 10 <sup>-5</sup>
	3.3V	3.3	0	0	N/A	8 x 10 <sup>6</sup>	
	OV	3.3	0	0	N/A	8 x 10 <sup>6</sup>	

 TABLE 6. WDO TRANSIENTS vs MODE OF OPERATION (MR = V<sub>DD</sub> unless noted otherwise)

#### **TABLE 7.** WDO TRANSIENTS vs LET ( $\overline{MR} = V_{DD}$ unless noted otherwise)

LET (MeV/mg/cm <sup>2</sup> )	WDI STATE	V <sub>DD</sub> (V)	EXPECTED WDO STATE	LHL TRANSITIONS	HLH TRANSITIONS	FLUENCE (/cm <sup>2</sup> )	CROSS SECTION (cm <sup>2</sup> )
86.4	Toggle	2.9	0	17	N/A	8 x 10 <sup>6</sup>	2.1 x 10 <sup>-6</sup>
43	Toggle	2.9	0	1	N/A	<b>1.6 x 10<sup>7</sup></b>	6.3 x 10 <sup>-8</sup>
28	Toggle	2.9	0	0	N/A	4 x 10 <sup>7</sup>	
8.5	Toggle	2.9	0	0	N/A	8 x 10 <sup>7</sup>	
86.4	Float	3	0	784	N/A	8 x 10 <sup>6</sup>	9.8 x 10 <sup>-5</sup>
43	Float	3	0	1062	N/A	1.6 x 10 <sup>7</sup>	6.6 x 10 <sup>-5</sup>
28	Float	3	0	1909	N/A	4 x 10 <sup>7</sup>	4.8 x 10 <sup>-5</sup>
8.5	Float	3	0	58	N/A	8 x 10 <sup>7</sup>	7.3 x 10 <sup>-7</sup>

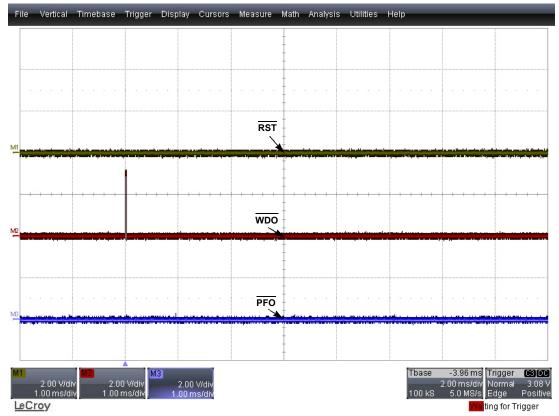


FIGURE 6. TRANSIENTS ON  $\overline{WDO}$ ,  $V_{DD} = \overline{MR} = 3.0V$ , PFI = 0.57V, WDI IS FLOATING

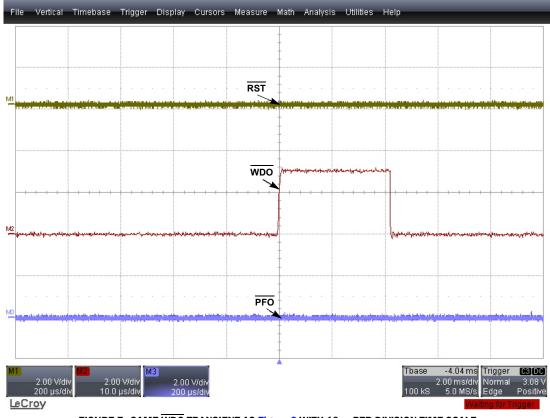


FIGURE 7. SAME WDO TRANSIENT AS Figure 6 WITH 10µs PER DIVISION TIME SCALE



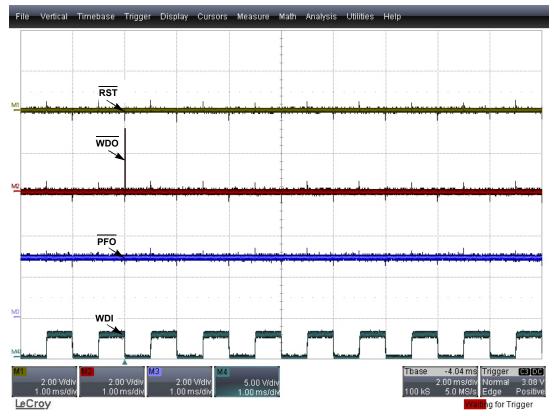


FIGURE 8. TRANSIENT ON WOO (VDD = MR = PFI = 2.9V, WDI IS TOGGLING 0 TO VDD AT 1kHz)

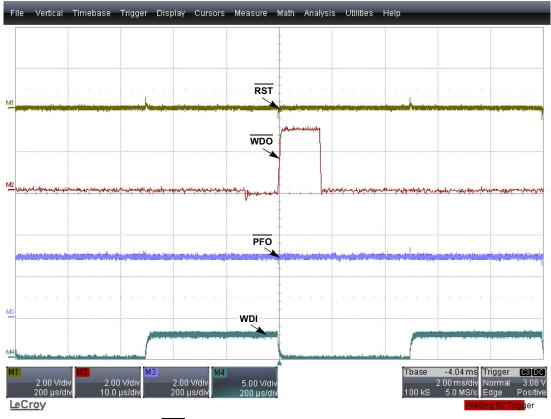


FIGURE 9. SAME WDO TRANSIENT AS Figure 8 WITH 10µs PER DIVISION TIME SCALE



## ISL706A PFO Results

The PFI/ $\overline{PFO}$  function is identical to that of the ISL705A, except the negative input of the comparator is tied to an on-chip 0.6V voltage reference. The specification allows a ±24mV offset over temperature and radiation. Hence input voltages below 0.576V set  $\overline{PFO}$  low and voltages above 0.624V set  $\overline{PFO}$  high. Table 8 lists  $\overline{PFO}$  transients as a function of PFI input voltage for Au ions. One transient was seen when driving PFI to the minimum specs of 0.576V. By increasing the comparator overdrive, the transient cross section was eliminated. Again, even at minimum overdrive conditions (input 0.576V) the transient cross section is so small that the occurrence will be hundreds to thousands of years apart. Figure 10 shows the scope trace for the  $\overline{PFO}$  transient with PFI at 0.576V. Note the LHL transient is 6µs long, adding an external low-pass filter would reduce the glitch. This would add delay in the system that the designer would need to evaluate. When PFI was above the threshold voltage of 0.624V no HLH transitions were observed. This indicates that when an auxiliary voltage is within regulation (above the threshold) the PFI comparator would not indicate otherwise.

Additional testing at lower LET levels was done on the  $\overline{PFO}$  output in the conditions that experienced SETs, e.g.,  $V_{DD} = 3.15V$  with PFI = 0.576V. Table 9 shows the cross section versus the different LET levels tested. Note that the fluence was increased as the LET levels were lowered. The data also shows that for LET < 43MeV • cm<sup>2</sup>/mg there are no SETs on  $\overline{PFO}$  in that test condition.

					55	-	
LET (MeV/mg/cm <sup>2</sup> )	PFI VOLTAGE (V)	V <sub>DD</sub> (V)	EXPECTED PFO STATE	LHL TRANSITIONS	HLH TRANSITIONS	FLUENCE (/cm <sup>2</sup> )	CROSS SECTION (cm <sup>2</sup> )
86.4	0.57	3	0	0	N/A	8 x 10 <sup>6</sup>	
	0.576	3.15	0	1	N/A	8 x 10 <sup>6</sup>	1.3 x 10 <sup>-7</sup>
	0.625	3.3	1	N/A	0	8 x 10 <sup>6</sup>	
	0.75	3.6	1	N/A	0	8 x 10 <sup>6</sup>	

#### TABLE 8. PFO TRANSIENTS vs PFI INPUT VOLTAGE (MR = V<sub>DD</sub> unless noted otherwise)

TADLEO	<b>DEO TRANCIENTE de LET (en DEL - O EZOV</b> (MD) $\lambda$ (multiple en de tradición el este e
IABLE 9.	<b>PFO TRANSIENTS vs LET for PFI = 0.576V</b> (MR = V <sub>DD</sub> unless noted otherwise)

LET (MeV/mg/cm <sup>2</sup> )	PFI VOLTAGE (V)	V <sub>DD</sub> (V)	EXPECTED PFO STATE	LHL TRANSITIONS	HLH TRANSITIONS	FLUENCE (/cm <sup>2</sup> )	CROSS SECTION (cm <sup>2</sup> )
86.4	0.576	3.15	0	1	N/A	8 x 10 <sup>6</sup>	1.3 x 10 <sup>-7</sup>
43	0.576	3.15	0	0	N/A	1.6 x 10 <sup>7</sup>	
28	0.576	3.15	0	0	N/A	4 x 10 <sup>7</sup>	
8.5	0.576	3.15	0	0	N/A	8 x 10 <sup>7</sup>	


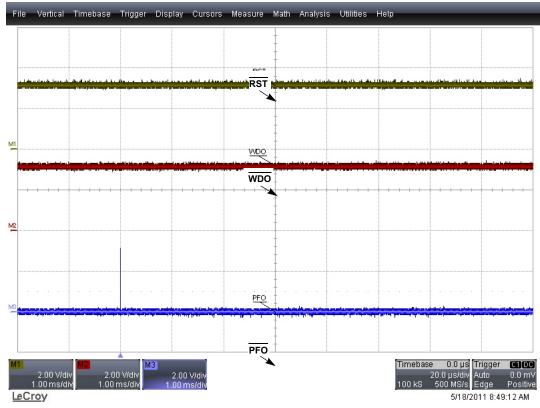


FIGURE 10. TRANSIENT ON  $\overline{PFO}$  (V<sub>DD</sub> =  $\overline{MR}$  = 3.15V, PFI = 0.576V,  $\overline{WDO}$  IS FLOATING)



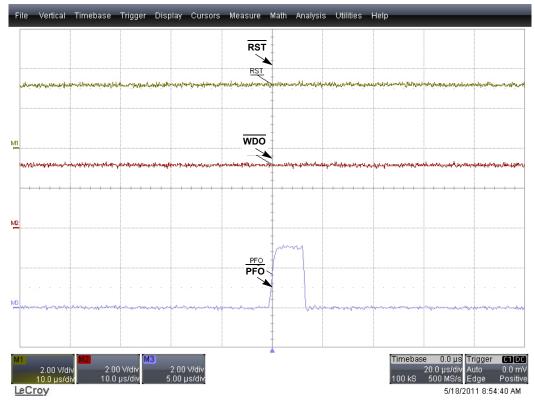

#### **ISL706A Summary**

As with the ISL705A, the ISL706A has no Reset HLH or LHL single-event transients at an LET of 86.4MeV/mg/cm<sup>2</sup>. The WDO output did have 25 times more transients compared to the ISL705A when used as a low line indicator (WDI floating). These transients did occur only when  $V_{\mbox{\scriptsize DD}}$  was below the reset threshold. The increase in the number of transients seen is primarily due to tighter thresholds in the ISL706x family of circuits. Other functions have demonstrated cross sections so small to not occur for hundreds to thousands of years. The PFO output experienced only one transient during SEE testing, compared to the ISL705A testing, which had 25 transients on PFO. The main contribution for the reduction in transients is the internal SEE mitigation filters. Both the ISL705A and ISL706A have these filters; however, in the ISL706A with the lower bias levels, there is less drive capability in the PFO comparator. As a result, the ISL706A benefits by experiencing less and shorter PFO transients at minimal overdrive.

## Conclusion

This Application Note has presented the results of single-event effects testing of the ISL705A and ISL706A supervisory circuits. The integrated circuit has no SEL or SEB with a supply voltage of up to 6.5V at an LET of 86.4MeV/mg/cm<sup>2</sup>. The initial SEE characterization of the ISL705A and ISL706A demonstrated that this device does not create/cause false system shutdowns at 86MeV. Furthermore, testing shows that the part will indicate a "system good" signal when it shouldn't, but the user needs to keep in mind this is in a window of when the general "system" is not in normal operation mode anyway. The additional testing at lower LETs revealed less events and demonstrates lower cross-sections; which may be useful from a cross section analysis. But with a device like this, understanding the way the part will be used in a specific application vs the SEE performance is critical.

## Acknowledgements

I would like to thank Eric Thomson for his hard work and dedication in performing the SEE tests at TAMU.

#### Notice

- 1. Descriptions of circuits, software and other related information in this document are provided only to illustrate the operation of semiconductor products and application examples. You are fully responsible for the incorporation or any other use of the circuits, software, and information in the design of your product or system. Renesas Electronics disclaims any and all liability for any losses and damages incurred by you or third parties arising from the use of these circuits, software, or information
- 2. Renesas Electronics hereby expressly disclaims any warranties against and liability for infringement or any other claims involving patents, copyrights, or other intellectual property rights of third parties, by or arising from the use of Renesas Electronics products or technical information described in this document, including but not limited to, the product data, drawings, charts, programs, algorithms, and application examples
- 3. No license, express, implied or otherwise, is granted hereby under any patents, copyrights or other intellectual property rights of Renesas Electronics or others.
- 4. You shall not alter, modify, copy, or reverse engineer any Renesas Electronics product, whether in whole or in part. Renesas Electronics disclaims any and all liability for any losses or damages incurred by you or third parties arising from such alteration, modification, copying or reverse engineering.
- Renesas Electronics products are classified according to the following two quality grades: "Standard" and "High Quality". The intended applications for each Renesas Electronics product depends on the product's quality grade, as indicated below.
  - "Standard" Computers: office equipment; communications equipment; test and measurement equipment; audio and visual equipment; home electronic appliances; machine tools; personal electronic equipment: industrial robots: etc.

"High Quality": Transportation equipment (automobiles, trains, ships, etc.); traffic control (traffic lights); large-scale communication equipment; key financial terminal systems; safety control equipment; etc. Unless expressly designated as a high reliability product or a product for harsh environments in a Renesas Electronics data sheet or other Renesas Electronics document, Renesas Electronics products are not intended or authorized for use in products or systems that may pose a direct threat to human life or bodily injury (artificial life support devices or systems; surgical implantations; etc.), or may cause serious property damage (space system; undersea repeaters; nuclear power control systems; aircraft control systems; key plant systems; military equipment; etc.). Renesas Electronics disclaims any and all liability for any damages or losses incurred by you or any third parties arising from the use of any Renesas Electronics product that is inconsistent with any Renesas Electronics data sheet, user's manual or other Renesas Electronics document.

- 6. When using Renesas Electronics products, refer to the latest product information (data sheets, user's manuals, application notes, "General Notes for Handling and Using Semiconductor Devices" in the reliability handbook, etc.), and ensure that usage conditions are within the ranges specified by Renesas Electronics with respect to maximum ratings, operating power supply voltage range, heat dissipation characteristics, installation, etc. Renesas Electronics disclaims any and all liability for any malfunctions, failure or accident arising out of the use of Renesas Electronics oroducts outside of such specified ranges
- 7. Although Renesas Electronics endeavors to improve the quality and reliability of Renesas Electronics products, semiconductor products have specific characteristics, such as the occurrence of failure at a certain rate and malfunctions under certain use conditions. Unless designated as a high reliability product or a product for harsh environments in a Renesas Electronics data sheet or other Renesas Electronics document, Renesas Electronics products are not subject to radiation resistance design. You are responsible for implementing safety measures to guard against the possibility of bodily injury, injury or damage caused by fire, and/or danger to the public in the event of a failure or malfunction of Renesas Electronics products, such as safety design for hardware and software, including but not limited to redundancy, fire control and malfunction prevention, appropriate treatment for aging degradation or any other appropriate measures. Because the evaluation of microcomputer software alone is very difficult and impractical, you are responsible for evaluating the safety of the final products or systems manufactured by you.
- 8. Plea e contact a Renesas Electronics sales office for details as to environmental matters such as the environmental compatibility of each Renesas Electronics product. You are responsible for carefully and sufficiently investigating applicable laws and regulations that regulate the inclusion or use of controlled substances, including without limitation, the EU RoHS Directive, and using Renesas Electronics products in compliance with all these applicable laws and regulations. Renesas Electronics disclaims any and all liability for damages or losses occurring as a result of your noncompliance with applicable laws and regulations.
- 9. Renesas Electronics products and technologies shall not be used for or incorporated into any products or systems whose manufacture, use, or sale is prohibited under any applicable domestic or foreign laws or regulations. You shall comply with any applicable export control laws and regulations promulgated and administered by the governments of any countries asserting jurisdiction over the parties or transactions
- 10. It is the responsibility of the buyer or distributor of Renesas Electronics products, or any other party who distributes, disposes of, or otherwise sells or transfers the product to a third party, to notify such third party in advance of the contents and conditions set forth in this document.
- 11. This document shall not be reprinted, reproduced or duplicated in any form, in whole or in part, without prior written consent of Renesas Electronics
- 12. Please contact a Renesas Electronics sales office if you have any questions regarding the information contained in this document or Renesas Electronics products
- (Note 1) "Renesas Electronics" as used in this document means Renesas Electronics Corporation and also includes its directly or indirectly controlled subsidiaries
- (Note 2) "Renesas Electronics product(s)" means any product developed or manufactured by or for Renesas Electronics.

(Rev.4.0-1 November 2017)



#### **Renesas Electronics Corporation**

http://www.renesas.com

SALES OFFICES Refer to "http://www.renesas.com/" for the latest and detailed information Renesas Electronics America Inc. 1001 Murphy Ranch Road, Milpitas, CA 95035, U.S.A. Tel: +1-408-432-8888, Fax: +1-408-434-5351 Renesas Electronics Canada Limited 9251 Yonge Street, Suite 8309 Richmond Hill, Ontario Canada L4C 9T3 Tel: +1-905-237-2004 Renesas Electronics Europe Limited Dukes Meadow, Miliboard Road, Bourne End, Buckinghamshire, SL8 5FH, U.K Tei: +44-1628-651-700, Fax: +44-1628-651-804 Renesas Electronics Europe GmbH Arcadiastrasse 10, 40472 Düsseldorf, Germar Tel: +49-211-6503-0, Fax: +49-211-6503-1327 Renesas Electronics (China) Co., Ltd. Room 1709 Quantum Plaza, No.27 ZhichunLu, Haidian District, Beijing, 100191 P. R. China Tel: +86-10-8235-1155, Fax: +86-10-8235-7679 Renesas Electronics (Shanghai) Co., Ltd. Unit 301, Tower A, Central Towers, 555 Langao Road, Putuo District, Shanghai, 200333 P. R. China Tel: +86-21-2226-0888, Fax: +86-21-2226-0999 Renesas Electronics Hong Kong Limited Unit 1601-1611, 16/F., Tower 2, Grand Century Place, 193 Prince Edward Road West, Mongkok, Kowloon, Hong Kong Tel: +852-2265-6688, Fax: +852 2886-9022 Renesas Electronics Taiwan Co., Ltd. 13F, No. 363, Fu Shing North Road, Taipei 10543, Taiwan Tel: +886-2-8175-9600, Fax: +886 2-8175-9670 Renesas Electronics Singapore Pte. Ltd. 80 Bendemeer Road, Unit #06-02 Hyflux Innovation Centre, Singapore 339949 Tel: +65-6213-0200, Fax: +65-6213-0300 Renesas Electronics Malaysia Sdn.Bhd. Unit 1207, Block B, Menara Amcorp, Amco Amcorp Trade Centre, No. 18, Jln Persiaran Barat, 46050 Petaling Jaya, Selangor Darul Ehsan, Malaysia Unit 1207, Block B, Menara Amcorp, Amcorp Tel: +60-3-7955-9390, Fax: +60-3-7955-9510 Renesas Electronics India Pvt. Ltd. No.777C, 100 Feet Road, HAL 2nd Stage, Indiranagar, Bangalore 560 038, India Tel: +91-80-67208700, Fax: +91-80-67208777 Renesas Electronics Korea Co., Ltd. 17F, KAMCO Yangjae Tower, 262, Gangnam-daero, Gangnam-gu, Seoul, 06265 Korea Tei: +822-558-3737, Fax: +822-558-5338