

## Introduction

Thank you for purchasing the Renesas Flash Programmer (RFP).

This document covers specifications of the RFP that have been added or changed, restrictions, and points for caution. For points for caution, also see the user's manual of the RFP.

See the following documents for restrictions applying to particular target MCUs.

- User's manuals of the target MCUs
- Documents in which restrictions applying to particular target MCUs are listed

## Contents

<b>1. Product Version.....</b>	<b>2</b>
<b>2. Additions and Changes to Specifications .....</b>	<b>2</b>
<b>2.1 List of additions and changes to specifications.....</b>	<b>2</b>
<b>2.2 Details of additions and changes .....</b>	<b>3</b>
<b>3. Restrictions .....</b>	<b>6</b>
<b>3.1 List of restrictions .....</b>	<b>6</b>
<b>3.2 Details of restrictions .....</b>	<b>6</b>

## 1. Product Version

No.	Version Number of RFP	Remark
(1)	V3.00.00	
(2)	V3.01.00	
(3)	V3.02.00	
(4)	V3.02.01	
(5)	V3.03.00	
(6)	V3.03.01	
(7)	V3.04.00	

Note: The version number of the RFP is displayed in the title bar of the main window.

## 2. Additions and Changes to Specifications

### 2.1 List of additions and changes to specifications

No.	Addition/Change	Applicable MCUs	Product Version (Corresponds to the Numbers for the Seven Versions in the Table of Section 1)							
			(1)	(2)	(3)	(4)	(5)	(6)	(7)	
1	Display of the checksums of files	All	×	✓	✓	✓	✓	✓	✓	✓
2	Loading multiple program files	All	×	✓	✓	✓	✓	✓	✓	✓
3	Importing license files	All	×	✓	✓	✓	✓	✓	✓	✓
4	Programming of unique codes	All	×	✓	✓	✓	✓	✓	✓	✓
5	Generating RPI files	All	×	✓	✓	✓	✓	✓	✓	✓
6	Entering user-specified bit-rates for COM connections	All	×	✓	✓	✓	✓	✓	✓	✓
7	Using a board that includes the UPD78F0730 microcontroller, which supports serial (COM) connection through a virtual USB driver	All	×	✓	✓	✓	✓	✓	✓	✓
8	Support for Renesas Synergy microcontrollers	Renesas Synergy	—	—	✓	✓	✓	✓	✓	✓
9	Support for the E2 emulator	RH850	—	—	—	✓	✓	✓	✓	✓
		RL78				—	✓	✓	✓	✓
		RX				—	—	—	—	✓
10	Change to filling with 0xFF	All	—	—	—	—	✓	✓	✓	✓
11	Addition to handling of out-of-range errors for the memory of the MCU	All	×	×	×	×	✓	✓	✓	✓
12	Display of the checksums of files in particular areas of flash memory	RH850, RL78, RX	×	×	×	×	×	×	×	✓
13	Release from license authentication	—	×	×	×	×	×	×	×	✓

—: Not supported, ×: No additions or changes to specifications, ✓: Supported

Note: \*1. Restrictions on the number of files to read have been removed.

## 2.2 Details of additions and changes

### No. 1 Display of the checksums of files

Applicable MCUs:	All
Description:	When a file is selected in the [Program File] area on the [Operation] tabbed page, the checksum of the file as a whole is displayed within the [Program File] area and output in the log output panel.
Resolution:	This feature is supported by V3.01.00 and later versions of the RFP.

### No. 2 Loading multiple program files

Applicable MCUs:	All
Description:	The RFP is now capable of loading multiple program files. All of the files selected by the user are combined before being programmed in the flash memory.
Resolution:	This feature is supported by V3.01.00 and later versions of the RFP.

### No. 3 Importing license files

Applicable MCUs:	All
Description:	The RFP is now capable of importing license files.
Resolution:	This feature is supported by V3.01.00 and later versions of the RFP.

### No. 4 Programming of unique codes

Applicable MCUs:	All
Description:	The RFP now supports programming of a unique code in a designated area of flash memory.
Resolution:	This feature is supported by V3.01.00 and later versions of the RFP.

### No. 5 Generating RPI files

Applicable MCUs:	All
Description:	The RFP is now capable of generating RPI files, which contain data from a designated area of code flash or data flash memory, along with the flash option settings.
Resolution:	This feature is supported by V3.01.00 and later versions of the RFP.

### No. 6 Entering user-specified bit-rates for COM connections

Applicable MCUs:	All
Description:	While the values of [Speed] were only selectable from the pull-down menu on the [Connect Setting] tabbed page in V3.00.00 and earlier versions, V3.01.00 allows the user to enter a desired bit-rate (but only in the case of a COM connection).
Resolution:	This feature is supported by V3.01.00 and later versions of the RFP.

**No. 7 Using a board that includes the UPD78F0730 microcontroller, which supports serial (COM) connection through a virtual USB driver**

Applicable MCUs:	All
Description:	<p>V3.01.00 of the RFP is also capable of programming by using a board that include a UPD78F0730 microcontroller of the 78K0 family, which supports serial (COM) connection through a virtual USB driver. Programming in this way may lead to the following error if V3.00.00 or an earlier version is in use.</p> <p>E4000003: A timeout error occurred.</p> <p>&lt;Example of an applicable board&gt;</p> <p>EZ-0012 evaluation board for DC/DC LED control by the RL78/I1A*</p> <p>*: For other Renesas evaluation boards equipped with the UPD78F0730, check the corresponding user's manuals.</p>
Resolution:	This feature is supported by V3.01.00 and later versions of the RFP.

**No. 8 Support for Renesas Synergy microcontrollers**

Applicable MCUs:	Renesas Synergy
Description:	<p>The RFP now supports Renesas Synergy microcontrollers. Note that the supported versions may differ according to the microcontroller.</p> <p>For details, refer to “Available microcontroller list for Renesas Flash Programmer V3” on the Renesas Website.</p>
Resolution:	This feature is supported by V3.02.00 and later versions of the RFP.

**No. 9 Support for the E2 emulator**

Applicable MCUs:	RH850, RL78
Description:	The RFP now supports programming of flash memory via the E2 emulator.
Resolution:	For RH850 devices, this feature is supported by V3.02.01 and later versions of the RFP. For RL78 devices, this feature is supported by V3.03.00 and later versions of the RFP.

**No. 10 Change to filling with 0xFF**

Applicable MCUs:	All
Description:	<p>For [Fill with 0xFF] in the [Operation Setting] tabbed page, the specification has been changed so that the target area can be selected but the configuration area is not selectable as a target. Since information on the setting for [Fill with 0xFF] is not carried over if a project that was created in V3.02.01 or an earlier version is read, change the setting as required.</p>
Resolution:	This change to the specification applies to V3.03.00 and later versions of the RFP.

**No. 11 Addition to handling of out-of-range errors for the memory of the MCU**

Applicable MCUs:	All
Description:	<p>Previously, when an attempt at access to data out of the range of memory in the MCU was detected, the RFP output a warning message and continued processing. However, in such cases now, the RFP can be set to generate an error and stop processing with an optional function from V3.03.00.</p>
Resolution:	This feature is supported by V3.03.00 and later versions of the RFP.

**No. 12** Display of the checksums of files in particular areas of flash memory

Applicable MCUs:	RH850, RL78, RX
Description:	A [File Checksum] feature has been added under the [File] menu. The checksums of program files in particular areas are displayed in the [Log output] panel. For the RL78, the checksums can be calculated within block-selection ranges.
Resolution:	This feature is supported by V3.04.00 and later versions of the RFP.

**No. 13** Release from license authentication

Applicable MCUs:	All
Description:	A feature for release from license authentication has been added.
Resolution:	This feature is supported by V3.04.00 and later versions of the RFP.

### 3. Restrictions

#### 3.1 List of restrictions

No.	Addition/Change	Applicable MCUs	Product Version (Corresponds to the Numbers for the Seven Versions in the Table of Section 1)							
			(1)	(2)	(3)	(4)	(5)	(6)	(7)	
1	Errors occurring when commands are executed in the boot mode (USB interface) of MCUs of the RX64M and RX71M groups	RX64M RX71M	×	✓	✓	✓	✓	✓	✓	✓
2	Self-checking of the E1 or E2 emulator leading to errors	All	×	✓	✓	✓	✓	✓	✓	✓
3	An Error Occurring during Installation of the USB Driver for USB Boot MCU TypeB	Renesas Synergy RX651 RX65N	—	—	×	×	×	✓	✓	✓
4	A Connection Error Occurring with the E2 Emulator (revision B)	RH850	—	—	—	×	×	✓	✓	✓
		RL78	—	—	—	—	×	✓	✓	✓

—: Not supported, ×: Not fixed, ✓: Fixed

#### 3.2 Details of restrictions

##### No. 1 Errors occurring when commands are executed in the boot mode (USB interface) of MCUs of the RX64M and RX71M groups

Applicable MCUs: RX64M and RX71M groups

Description: The following error will occur if commands such as for writing are executed while a target MCU is connected and is in boot mode (for the USB interface).

E100000D: A flow error occurred in the device. (Response 34:C3)

Resolution: This problem has been fixed and does not arise in V3.01.00 and later versions of the RFP.

##### No. 2 Self-checking of the E1 or E2 emulator leading to errors

Applicable MCUs: All

Description: Executing the self-checking program for an E1 or E2 emulator that has been connected with V3.00.00 of the Renesas Flash Programmer leads to errors.  
The following are the log entries relating to errors in the self-checking program.

[Result of TEST1] FAIL (Error 1103)

[Error Message] The E1/E20 self-check has failed.

[Error Detail] Internal module check has failed.

Facilities other than self-checking (flash programming and debugging) will operate correctly.

Supplementary Note:

Connecting the V3.00.00 Renesas Flash Programmer to an E1 or E20 emulator leads to overwriting of the firmware in the emulator. This leads to errors when the self-checking program for the emulator is executed.

Resolution: This problem has been fixed and does not arise in V3.01.00 and later versions of the RFP.

**No. 3 An Error Occurring during Installation of the USB Driver for USB Boot MCU TypeB**

Applicable MCUs: Renesas Synergy, RX651 and RX65N group

Description: When using the applicable products shown in section 3.1 (No.3), the following error may occur during installation of the USB Driver for USB Boot MCU TypeB V1.00.00 (for Renesas Synergy™ microcontrollers and RX651 and RX65N groups in the RX family), and installation may not succeed. If the error does not occur, installation was successful.

E0140021: Some installations have failed. The installations of the specified tools are not completed

Resolution: This problem has been fixed and does not arise in V3.03.01 and later versions of the RFP.

**No. 4 A Connection Error Occurring with the E2 Emulator (revision B)**


Applicable MCUs: RH850, RL78

Description: When using the applicable products shown in section 3.1 (No.4) and connecting the Renesas Flash Programmer to the MCU via the E2 emulator (revision B), the following error occurs, and connection is not established.


E30002FE: This tool is not supported

Note: E2 emulator revision B can be confirmed by the label on the back of the main unit.

➤ The **ⓑ** mark is attached.

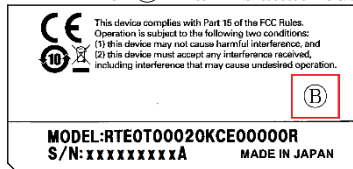

➤ The end of the serial No. is other than "A".

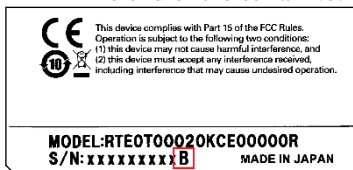

Resolution: This problem has been fixed and does not arise in V3.03.01 and later versions of the RFP.

## **Website and Support**

Renesas Electronics Website

<https://www.renesas.com>

Inquiries

<https://www.renesas.com/contact>

All trademarks and registered trademarks are the property of their respective owners.



## Notice

1. Descriptions of circuits, software and other related information in this document are provided only to illustrate the operation of semiconductor products and application examples. You are fully responsible for the incorporation or any other use of the circuits, software, and information in the design of your product or system. Renesas Electronics disclaims any and all liability for any losses and damages incurred by you or third parties arising from the use of these circuits, software, or information.
2. Renesas Electronics hereby expressly disclaims any warranties against and liability for infringement or any other disputes involving patents, copyrights, or other intellectual property rights of third parties, by or arising from the use of Renesas Electronics products or technical information described in this document, including but not limited to, the product data, drawing, chart, program, algorithm, application examples.
3. No license, express, implied or otherwise, is granted hereby under any patents, copyrights or other intellectual property rights of Renesas Electronics or others.
4. You shall not alter, modify, copy, or otherwise misappropriate any Renesas Electronics product, whether in whole or in part. Renesas Electronics disclaims any and all liability for any losses or damages incurred by you or third parties arising from such alteration, modification, copy or otherwise misappropriation of Renesas Electronics products.
5. Renesas Electronics products are classified according to the following two quality grades: "Standard" and "High Quality". The intended applications for each Renesas Electronics product depends on the product's quality grade, as indicated below.  
"Standard": Computers; office equipment; communications equipment; test and measurement equipment; audio and visual equipment; home electronic appliances; machine tools; personal electronic equipment; and industrial robots etc.  
"High Quality": Transportation equipment (automobiles, trains, ships, etc.); traffic control (traffic lights); large-scale communication equipment; key financial terminal systems; safety control equipment; etc.  
Renesas Electronics products are neither intended nor authorized for use in products or systems that may pose a direct threat to human life or bodily injury (artificial life support devices or systems, surgical implantations etc.), or may cause serious property damages (space and undersea repeaters; nuclear power control systems; aircraft control systems; key plant systems; military equipment; etc.). Renesas Electronics disclaims any and all liability for any damages or losses incurred by you or third parties arising from the use of any Renesas Electronics product for which the product is not intended by Renesas Electronics.
6. When using the Renesas Electronics products, refer to the latest product information (data sheets, user's manuals, application notes, "General Notes for Handling and Using Semiconductor Devices" in the reliability handbook, etc.), and ensure that usage conditions are within the ranges specified by Renesas Electronics with respect to maximum ratings, operating power supply voltage range, heat radiation characteristics, installation, etc. Renesas Electronics disclaims any and all liability for any malfunctions or failure or accident arising out of the use of Renesas Electronics products beyond such specified ranges.
7. Although Renesas Electronics endeavors to improve the quality and reliability of Renesas Electronics products, semiconductor products have specific characteristics such as the occurrence of failure at a certain rate and malfunctions under certain use conditions. Further, Renesas Electronics products are not subject to radiation resistance design. Please ensure to implement safety measures to guard them against the possibility of bodily injury, injury or damage caused by fire, and social damage in the event of failure or malfunction of Renesas Electronics products, such as safety design for hardware and software including but not limited to redundancy, fire control and malfunction prevention, appropriate treatment for aging degradation or any other appropriate measures by your own responsibility as warranty for your products/system. Because the evaluation of microcomputer software alone is very difficult and not practical, please evaluate the safety of the final products or systems manufactured by you.
8. Please contact a Renesas Electronics sales office for details as to environmental matters such as the environmental compatibility of each Renesas Electronics product. Please investigate applicable laws and regulations that regulate the inclusion or use of controlled substances, including without limitation, the EU RoHS Directive carefully and sufficiently and use Renesas Electronics products in compliance with all these applicable laws and regulations. Renesas Electronics disclaims any and all liability for damages or losses occurring as a result of your noncompliance with applicable laws and regulations.
9. Renesas Electronics products and technologies shall not be used for or incorporated into any products or systems whose manufacture, use, or sale is prohibited under any applicable domestic or foreign laws or regulations. You shall not use Renesas Electronics products or technologies for (1) any purpose relating to the development, design, manufacture, use, stockpiling, etc., of weapons of mass destruction, such as nuclear weapons, chemical weapons, or biological weapons, or missiles (including unmanned aerial vehicles (UAVs)) for delivering such weapons, (2) any purpose relating to the development, design, manufacture, or use of conventional weapons, or (3) any other purpose of disturbing international peace and security, and you shall not sell, export, lease, transfer, or release Renesas Electronics products or technologies to any third party whether directly or indirectly with knowledge or reason to know that the third party or any other party will engage in the activities described above. When exporting, selling, transferring, etc., Renesas Electronics products or technologies, you shall comply with any applicable export control laws and regulations promulgated and administered by the governments of the countries asserting jurisdiction over the parties or transactions.
10. Please acknowledge and agree that you shall bear all the losses and damages which are incurred from the misuse or violation of the terms and conditions described in this document, including this notice, and hold Renesas Electronics harmless, if such misuse or violation results from your resale or making Renesas Electronics products available any third party.
11. This document shall not be reprinted, reproduced or duplicated in any form, in whole or in part, without prior written consent of Renesas Electronics.
12. Please contact a Renesas Electronics sales office if you have any questions regarding the information contained in this document or Renesas Electronics products.  
(Note 1) "Renesas Electronics" as used in this document means Renesas Electronics Corporation and also includes its majority-owned subsidiaries.  
(Note 2) "Renesas Electronics product(s)" means any product developed or manufactured by or for Renesas Electronics.

(Rev.3.0-1 November 2016)



### SALES OFFICES

Renesas Electronics Corporation

<http://www.renesas.com>

Refer to "<http://www.renesas.com/>" for the latest and detailed information.

#### Renesas Electronics America Inc.

2801 Scott Boulevard Santa Clara, CA 95050-2549, U.S.A.  
Tel: +1-408-588-6000, Fax: +1-408-588-6130

#### Renesas Electronics Canada Limited

9251 Yonge Street, Suite 8309 Richmond Hill, Ontario Canada L4C 9T3  
Tel: +1-905-237-2004

#### Renesas Electronics Europe Limited

Dukes Meadow, Millboard Road, Bourne End, Buckinghamshire, SL8 5FH, U.K.  
Tel: +44-1628-585-100, Fax: +44-1628-585-900

#### Renesas Electronics Europe GmbH

Arcadiastrasse 10, 40472 Düsseldorf, Germany  
Tel: +49-211-6503-0, Fax: +49-211-6503-1327

#### Renesas Electronics (China) Co., Ltd.

Room 1709, Quantum Plaza, No.27 ZhiChunLu Haidian District, Beijing 100191, P.R.China  
Tel: +86-10-8235-1155, Fax: +86-10-8235-7679

#### Renesas Electronics (Shanghai) Co., Ltd.

Unit 301, Tower A, Central Towers, 555 Langao Road, Putuo District, Shanghai, P. R. China 200333  
Tel: +86-21-2226-0888, Fax: +86-21-2226-0999

#### Renesas Electronics Hong Kong Limited

Unit 1601-1611, 16/F., Tower 2, Grand Century Place, 193 Prince Edward Road West, Mongkok, Kowloon, Hong Kong  
Tel: +852-2265-6688, Fax: +852-2886-9022

#### Renesas Electronics Taiwan Co., Ltd.

13F, No. 363, Fu Shing North Road, Taipei 10543, Taiwan  
Tel: +886-2-8175-9600, Fax: +886-2-8175-9670

#### Renesas Electronics Singapore Pte. Ltd.

80 Bendemeer Road, Unit #06-02 Hyflux Innovation Centre, Singapore 339949  
Tel: +65-6213-0200, Fax: +65-6213-0300

#### Renesas Electronics Malaysia Sdn.Bhd.

Unit 1207, Block B, Menara Amcorp, Amcorp Trade Centre, No. 18, Jln Persiaran Barat, 46050 Petaling Jaya, Selangor Darul Ehsan, Malaysia  
Tel: +60-3-7955-9390, Fax: +60-3-7955-9510

#### Renesas Electronics India Pvt. Ltd.

No.777C, 100 Feet Road, HAL II Stage, Indiranagar, Bangalore, India  
Tel: +91-80-67208700, Fax: +91-80-67208777

#### Renesas Electronics Korea Co., Ltd.

12F., 234 Teheran-ro, Gangnam-Gu, Seoul, 135-080, Korea  
Tel: +82-2-558-3737, Fax: +82-2-558-5141