

HS411x

High Performance Relative Humidity and Temperature Sensor with Membrane and Analog Output

The HS411x series is a highly accurate, fully calibrated automotive-grade relative humidity and temperature sensor with a hydrophobic membrane. The membrane makes the HS411x dust resistant and waterproof. The MEMS sensor features a proprietary sensor-level protection, ensuring high reliability and long-term stability.

The high accuracy, fast measurement response time, and long-term stability combined with the small package size makes the HS411x series ideal for a wide number of applications ranging from portable devices to products designed for harsh environments.

The HS411x series digital sensor accurately measures relative humidity and temperature levels. The measured data is internally corrected and compensated for accurate operation over a wide range of temperature and humidity levels – user calibration is not required.

The HS411x series are digital sensors at their core. Measurements are then converted to ratio-metric analog output. This makes the HS411x suitable for high-noise environment applications.

Physical Characteristics

- Supply voltage: 1.71V to 3.6V
- Operating temperature: -40°C to +105°C
- 2.5 × 2.5 × 0.9 mm DFN-style 8-LGA package


Features

- Humidity range: 0% to 100%RH
- Automotive grade, AEC-Q100 qualified, Grade 2, -40°C to +105°C
- Industrial grade, JEDEC qualified, -40°C to +105°C
- Hydrophobic membrane, IP67 rating
- 10% to 90% ratio-metric analog output voltage
- RH accuracy: ±1.5% RH, typical (HS4111)
- Fast RH response time: 4 seconds time constant, typical
- Temperature sensor accuracy: ±0.2°C, typical (HS4111, -10 to +80°C)
- Very low current consumption: 92µA average (3.3V supply)
- Excellent stability against aging and volatile compounds
- Highly robust protection from harsh environmental conditions and mechanical shock

Applications

- Climate control systems
- Instrumentation
- Home appliances
- Weather stations
- Building automation
- HVAC systems
- Medical equipment
- Data logging systems

Product Image

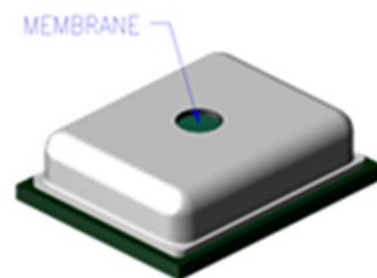

Contents

| | |
|---|-----------|
| 1. Pin Information | 4 |
| 1.1 Pin Assignments | 4 |
| 1.2 Pin Descriptions | 4 |
| 2. Specifications | 5 |
| 2.1 Absolute Maximum Ratings | 5 |
| 2.2 Recommended Operating Conditions | 5 |
| 3. Humidity and Temperature Sensor Performance | 6 |
| 3.1 Humidity Sensor Specifications | 6 |
| 3.2 Temperature Sensor Specifications | 6 |
| 3.3 Humidity Sensor Accuracy Graphs | 7 |
| 3.4 Temperature Sensor Accuracy Graphs | 7 |
| 4. Sensor Startup | 8 |
| 5. Application Circuit | 8 |
| 6. Converting Output Signal | 8 |
| 7. Soldering Information | 10 |
| 8. PCB Layout Guide | 11 |
| 9. Storage and Handling | 11 |
| 10. Quality and Reliability | 11 |
| 11. Package Outline Drawings | 12 |
| 12. Ordering Information | 12 |
| 13. Revision History | 12 |

List of Figures


| | |
|--|----|
| Figure 1. HS4111 RH Accuracy Tolerance at 25°C | 7 |
| Figure 2. HS4111 RH Accuracy over Temperature..... | 7 |
| Figure 3. HS4113 RH Accuracy Tolerance at 25°C | 7 |
| Figure 4. HS4113 RH Accuracy over Temperature..... | 7 |
| Figure 5. HS4111 Temperature Sensor Accuracy Tolerance | 7 |
| Figure 6. HS4113 Temperature Sensor Accuracy Tolerance | 7 |
| Figure 7. HS411x Application Circuit..... | 8 |
| Figure 8. Relative Humidity vs. VRH Output Analog Voltage..... | 9 |
| Figure 9. Temperature vs. VT Output Analog Voltage | 9 |
| Figure 10. Recommended Soldering Profile..... | 10 |
| Figure 11. Milled PCB Openings for Thermal Isolation | 11 |

List of Tables

| | |
|--|---|
| Table 1. Humidity Sensor Specifications, $T_A = +25^\circ\text{C}$, $V_{DD} = 1.71\text{V}$ to 3.6V | 6 |
| Table 2. Temperature Sensor Specifications, $T_A = +25^\circ\text{C}$, $V_{DD} = 1.71\text{V}$ to 3.6V | 6 |

1. Pin Information

1.1 Pin Assignments

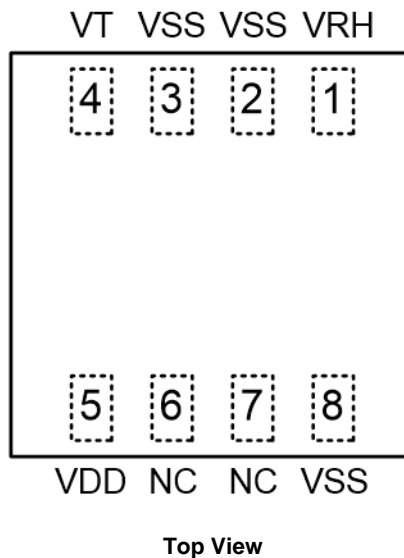

1.2 Pin Descriptions

| Pin Number | Pin Name | Type | Description |
|------------|--------------------|------|------------------------------------|
| 1 | VRH ^[1] | Out | Analog RH output voltage. |
| 2 | VSS | In | Ground. |
| 3 | VSS | In | Ground. |
| 4 | VT ^[1] | Out | Analog temperature output voltage. |
| 5 | VDD | In | Supply voltage. |
| 6 | NC ^[2] | - | Do not connect. |
| 7 | NC ^[2] | - | Do not connect. |
| 8 | VSS | In | Ground. |

1. VRH and VT requires a capacitor (see Application Circuit).
2. "NC" stands for not connected / no connection required / not bonded.

2. Specifications

2.1 Absolute Maximum Ratings

Caution: The absolute maximum ratings are stress ratings only. Stresses greater than those listed below can cause permanent damage to the device. Functional operation of the HS411x at absolute maximum ratings is not implied. Exposure to absolute maximum rating conditions might affect device reliability.

| Parameter | Conditions | Minimum | Maximum | Unit |
|---------------------------|-----------------------|---------|---------|------|
| Supply Voltage | - | - | 3.6 | V |
| Storage Temperature Range | Recommended 0 to 60°C | -40 | 125 | °C |

2.2 Recommended Operating Conditions

Important note: The HS411x series sensors are optimized to perform best in the more common temperature and humidity ranges of 10°C to 50°C and 20% RH to 80% RH, respectively. If operated outside of these conditions for extended periods, especially at high humidity levels, the sensors may exhibit an offset. In most cases, this offset is temporary and will gradually disappear once the sensor is returned to normal temperature and humidity conditions. The amount of the shift and the duration of the offset vary depending on the duration of exposure and the severity of the relative humidity and temperature conditions.^[1] The time needed for the offset to disappear can also be decreased by using the procedures described in sections 9 and 10.

| Parameter | Condition | Minimum | Typical | Maximum | Unit |
|-----------------------------|--------------------------------------|---------|---------|---------|------|
| Operating Supply Voltage | - | 1.71 | 3.3 | 3.6 | V |
| Average Current | V _{DD} = 1.8V | - | 82 | 95 | μA |
| | V _{DD} = 3.3V | - | 92 | 110 | |
| Measurement Time | Humidity and temperature measurement | - | 1.7 | 2.3 | ms |
| Operating Temperature Range | - | -40 | - | 105 | °C |

1. At T_A = +25°C, V_{DD} = +1.71V to +3.6V unless otherwise noted

3. Humidity and Temperature Sensor Performance

3.1 Humidity Sensor Specifications

Table 1. Humidity Sensor Specifications, T_A = +25°C, V_{DD} = 1.71V to 3.6V

| Parameter | Condition | | Minimum | Typical | Maximum | Unit |
|---|-------------------------|---------------|---------|---------|---------|--------|
| Range | - | | 0 | - | 100 | %RH |
| Accuracy ^{[1][2]} | HS4111 | 10% to 90% RH | - | ±1.5 | ±1.8 | %RH |
| | HS4113 | 20% to 80% RH | - | ±2.5 | ±3.5 | |
| Resolution | 14-bit | | - | 0.04 | 0.05 | %RH |
| Hysteresis | - | | - | - | ±1.0 | %RH |
| Non-Linearity from Response Curve | HS4111 | 10% to 90% RH | - | ±0.15 | ±0.25 | %RH |
| | HS4113 | 20% to 80% RH | | | | |
| Long-Term Stability | - | | - | ±0.1 | ±0.25 | %RH/Yr |
| Response Time Constant ^[3] (τ _H) | 20% to 80% RH Still Air | | 3.0 | 4.0 | 6.0 | sec |

1. Monotonic increases from 10 to 90% RH after sensor has been stabilized at 50% RH.
2. Refer to section 3.3 for additional details.
3. Initial value to 63% of total variation. Response time depend on system airflow.

3.2 Temperature Sensor Specifications

Table 2. Temperature Sensor Specifications, T_A = +25°C, V_{DD} = 1.71V to 3.6V

| Parameter | Condition | | Minimum | Typical | Maximum | Unit |
|---|-----------|---------------|---------|---------|---------|-------|
| Range | - | | -40 | - | 105 | °C |
| Accuracy ^[1] | HS4111 | -10°C to 80°C | - | ±0.2 | ±0.3 | °C |
| | HS4113 | 0°C to 70°C | - | ±0.25 | ±0.35 | |
| Resolution | - | | - | 0.01 | 0.02 | °C |
| Response Time Constant ^[2] (τ _T) | - | | - | >2.0 | - | sec |
| Long-Term Stability | - | | - | - | 0.03 | °C/Yr |
| Supply Voltage Dependency ^[3] | - | | - | 0.03 | 0.1 | °C/V |

1. Response time depends on system thermal mass (e.g. PCB dimensions and thickness) and airflow Refer to section 3.4 for additional details.
2. Initial value to 63% of total variation. Response time depends on system thermal mass and air flow.
3. Temperature accuracy can be optimized for specified supply voltages upon request.

3.3 Humidity Sensor Accuracy Graphs

The typical and maximum relative humidity sensor accuracy tolerances are shown in the following figures.

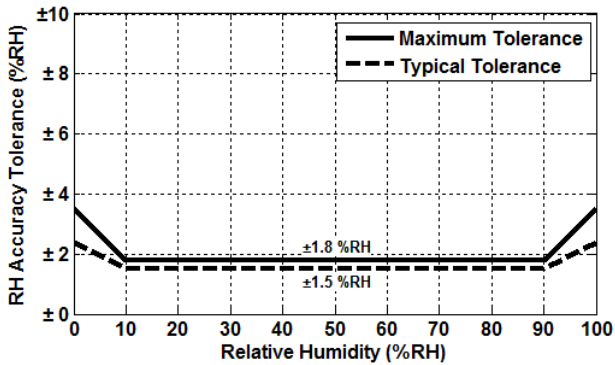


Figure 1. HS4111 RH Accuracy Tolerance at 25°C

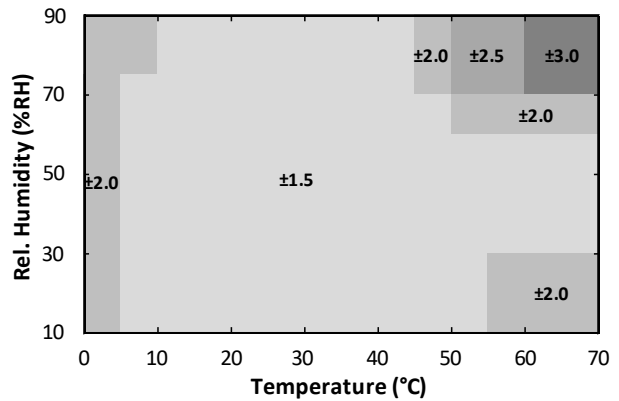


Figure 2. HS4111 RH Accuracy over Temperature

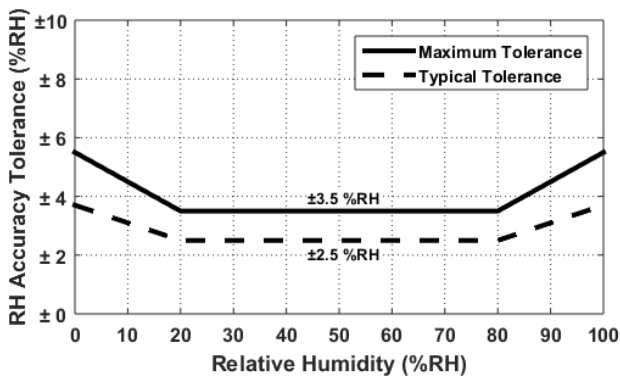


Figure 3. HS4113 RH Accuracy Tolerance at 25°C

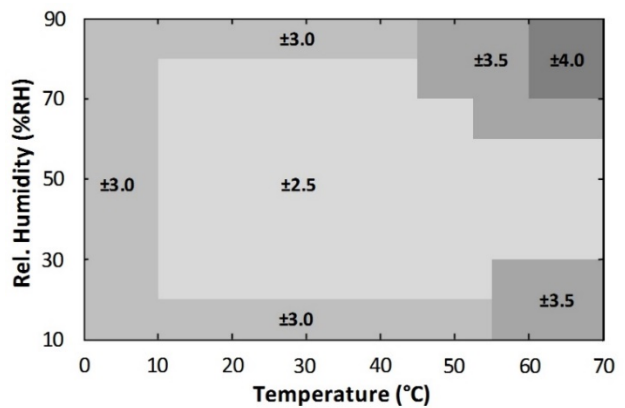


Figure 4. HS4113 RH Accuracy over Temperature

3.4 Temperature Sensor Accuracy Graphs

The typical and maximum temperature sensor accuracy tolerances are shown in the following figures.

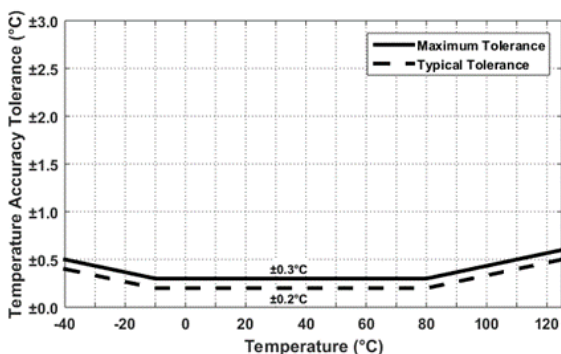


Figure 5. HS4111 Temperature Sensor Accuracy Tolerance

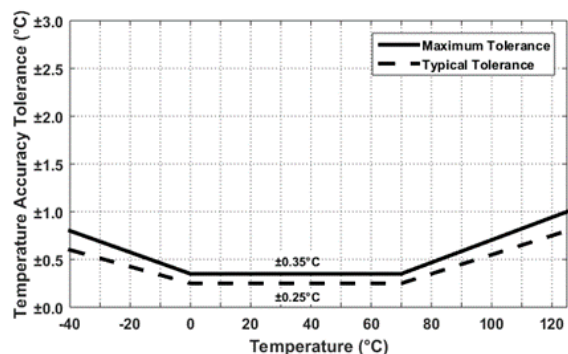


Figure 6. HS4113 Temperature Sensor Accuracy Tolerance

4. Sensor Startup

The HS411x sensor requires a typical 100ms to start up, after which temperature and relative humidity measurement data will be provided on the corresponding pins.

5. Application Circuit

The HS411x sensor requires a 2.2µF ceramic capacitor connected to the ground on both the VRH and VT outputs. It is also recommended to buffer the output of the relative humidity and temperature signals before processing the analog voltage. The buffer should have a low input leakage current, < 1nA, and a low input offset voltage, < 1mV, to ensure high signal integrity.

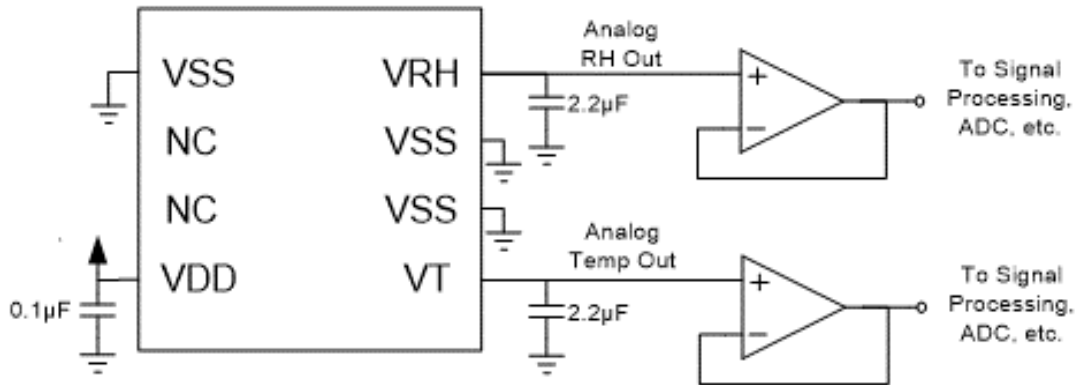


Figure 7. HS411x Application Circuit

6. Converting Output Signal

The voltage levels of the filtered analog output signal are ratio-metric with V_{DD} . The default output range for the relative humidity and temperature is from 10% to 90%.

Each HS411x sensor is individually calibrated, so that a standard linear fitting equation can be used to obtain the measured temperature and RH value.

Figure 8 and Figure 9 shows the RH and temperature graphically.

The relative humidity (in percent) and the temperature (in degrees Celsius) are calculated with Equation 1 and Equation 2, respectively.

$$\text{Humidity } [\%RH] = 125 * \frac{VRH}{VDD} - 12.5 \quad \text{Equation 1}$$

$$\text{Temperature } [^{\circ}C] = 181.25 * \frac{VT}{VDD} - 58.125 \quad \text{Equation 2}$$

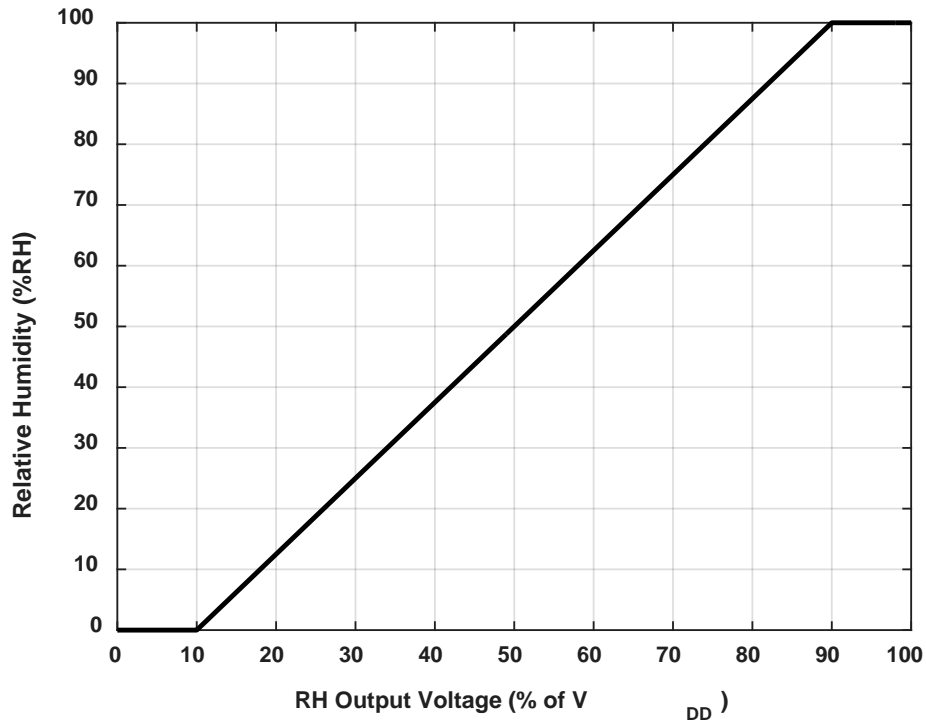


Figure 8. Relative Humidity vs. VRH Output Analog Voltage

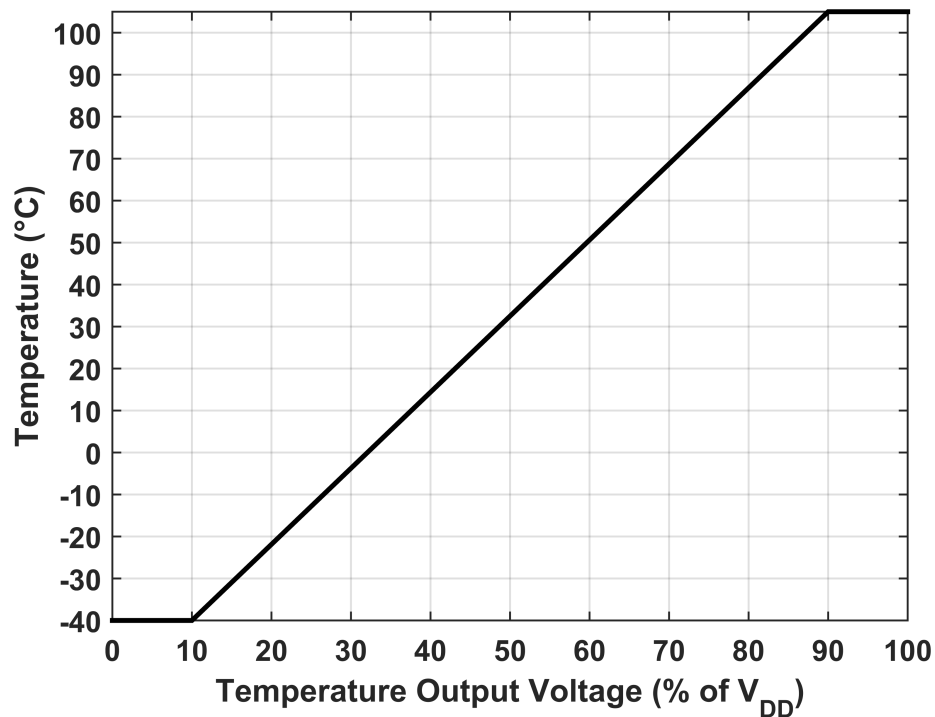


Figure 9. Temperature vs. VT Output Analog Voltage

7. Soldering Information

This section discusses soldering considerations for the HS411x.

Standard reflow ovens can be used to solder the HS411x series sensor to the PCB. The peak temperature (T_p) for use with the JEDEC J-STD-020D standard soldering profile is 260°C. For manual soldering, the contact time must be limited to 5 seconds at up to 350°C. In either case, if solder paste is used, it is recommended to use ‘no-clean’ solder paste to avoid the need to wash the PCB.

When a relative humidity sensor is exposed to the high heat associated with the soldering process, the sensor element tends to dry out. To avoid an offset in the relative humidity readings, the sensor element must be rehydrated after the soldering process. Care must also be taken when selecting the temperatures and durations involved in the soldering process to avoid irreversibly damaging the sensor element.

The recommended soldering profile for a lead-free (RoHS-compliant) process is shown below.

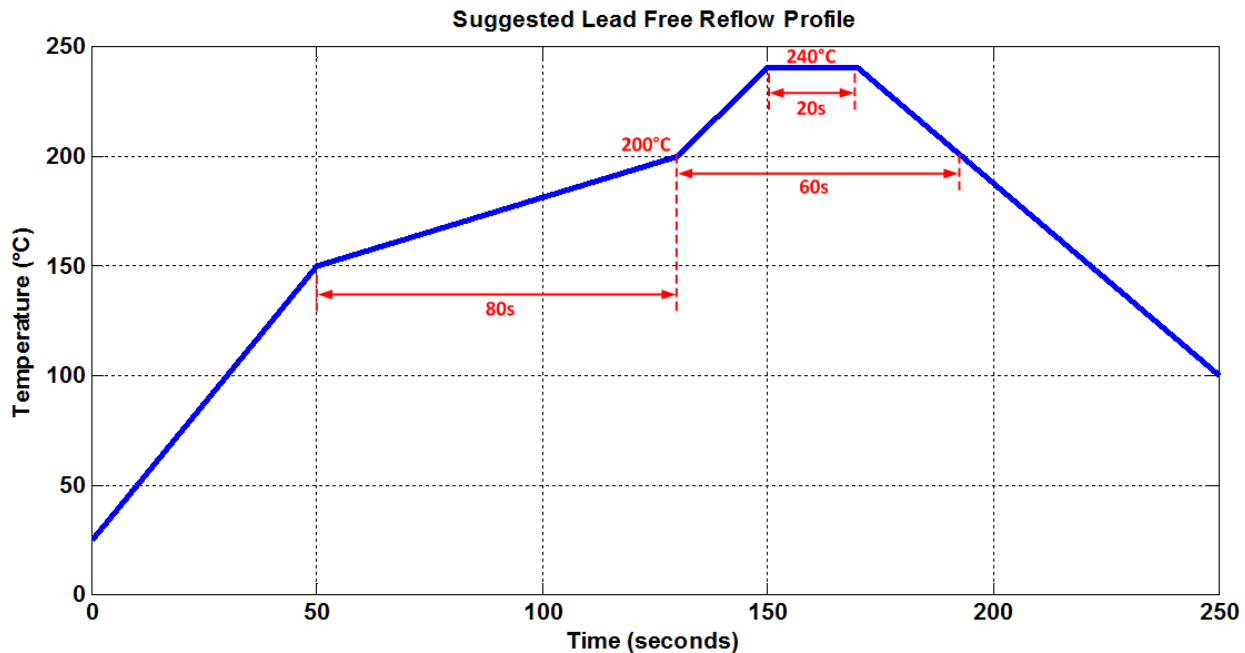


Figure 10. Recommended Soldering Profile

It is important to ensure this temperature profile is measured at the sensor itself. Measuring the profile at a larger component with a higher thermal mass means the temperature at the small sensor will be higher than expected.

For manual soldering, the contact time must be limited to **5 seconds** with a maximum iron temperature of **350°C**.

In either case, a board wash after soldering is **not** recommended. Therefore, if a solder paste is used, it is strongly recommended that a “**no-clean**” solder paste is used to avoid the need to wash the PCB.

After soldering, the recommended rehydration process should be done. Otherwise, there may be an initial offset in the relative humidity readings, which will slowly disappear as the sensor get exposed to ambient conditions.

Recommended rehydration process:

- A relative humidity of 75% RH at room temperature for at least 12 hours.
- or
- A relative humidity of 40% to 50% RH at room temperature for 3 to 5 days.

8. PCB Layout Guide

When designing the PCB, undesired heat transfer paths to the HS411x series must be minimized. Excessive heat from other components on the PCB will result in inaccurate temperature and relative humidity measurements. As such, **solid metal planes for power supplies should be avoided in the vicinity of the sensor** since these will act as thermal conductors. To further reduce the heat transfer from other components on the board, openings can be milled into the PCB as shown in Figure 11.

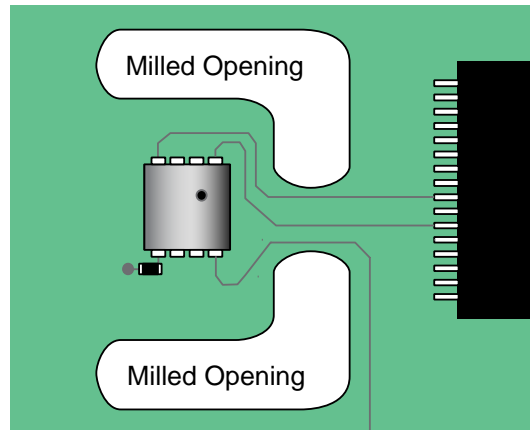


Figure 11. Milled PCB Openings for Thermal Isolation

9. Storage and Handling

Recommendation: Once the sensors are removed from their original packaging, store them in metal-in antistatic bags.

Avoid using polyethylene antistatic bags as they may affect sensor accuracy.

The nominal storage conditions are 10 to 50°C and humidity levels within 20% to 60% RH. If stored outside of these conditions for extended periods of time, the sensor readings may exhibit an offset. The sensor can be reconditioned and brought back to its calibration state by applying the following procedure:

1. Bake at a temperature of 100°C with a humidity < 10% RH for 10 to 12 hours.
2. Rehydrate the sensor at a humidity of 75% RH and a temperature between 20°C to 30°C for 12 to 14 hours.

10. Quality and Reliability

The HS411x series is available as a qualified product for consumer and industrial market applications. All data specified parameters are guaranteed if not stated otherwise.

11. Package Outline Drawings


The package outline drawings are located at the end of this document and are accessible from the Renesas website. The package information is the most current data available and is subject to change without revision of this document.

12. Ordering Information


| Part Number | Package Description | Carrier Type | Temperature Range |
|-------------|--|--------------|-------------------|
| HS4111 | Relative Humidity and Temperature Sensor, with Membrane, Analog Output. ±1.5% RH (Typical), 2.5 × 2.5 × 0.9 mm, 8-LGA | Reel | -40°C to +105°C |
| HS4113 | Relative Humidity and Temperature Sensor, with Membrane, Analog Output. ±2.5% RH (Typical), 2.5 × 2.5 × 0.9 mm, 8-LGA | Reel | -40°C to +105°C |

13. Revision History


| Revision | Date | Description |
|----------|--------------|---|
| 1.03 | Mar 29, 2023 | <ul style="list-style-type: none"> ▪ Removed HS4112 and HS4114 ▪ Added maximum supply voltage |
| 1.02 | Apr 28, 2022 | <ul style="list-style-type: none"> ▪ Added AEC-Q100 qualified, -40°C to +105C ▪ Added Industrial JEDEC qualified, -40°C to +105C ▪ Completed other minor changes |
| 1.01 | Apr 14, 2022 | Added AEC-Q100. |
| 1.00 | Feb 4, 2022 | Initial release. |

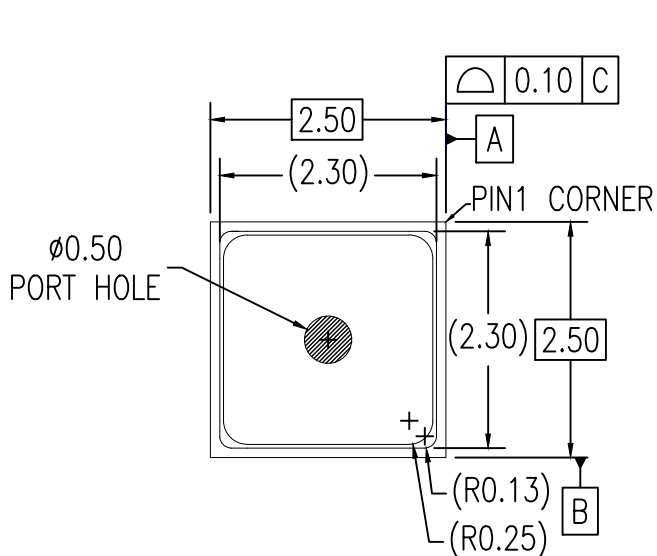

TOP VIEW

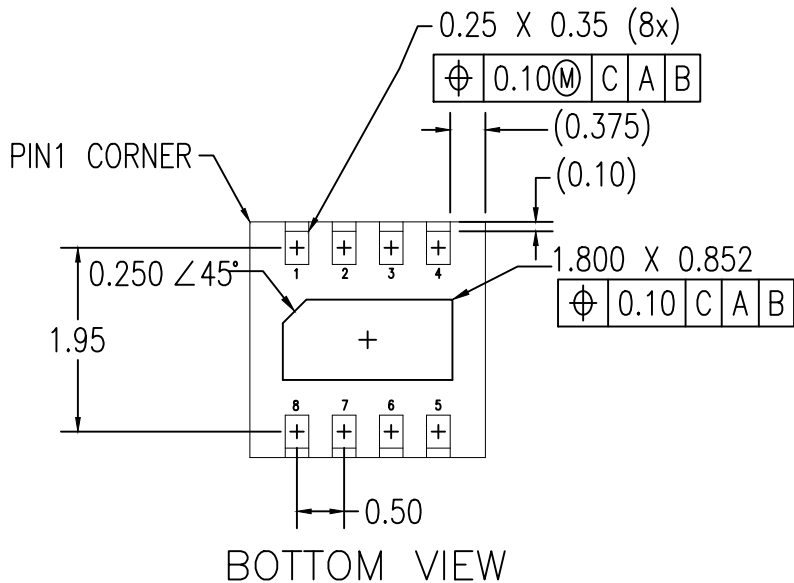


BOTTOM VIEW

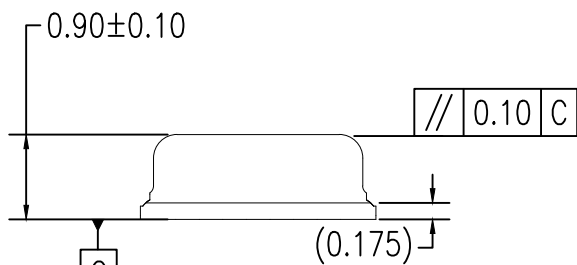

SIDE VIEW

NOTES:

DIMENSIONS AND TOLERANCES IN MM.

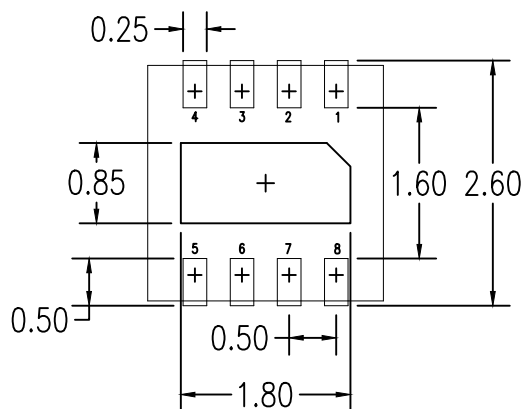

RECOMMENDED LAND PATTERN DIMENSION

NOTES:

1. ALL DIMENSION ARE IN MM. ANGLES IN DEGREES.
2. LAND PATTERN RECOMMENDATION PER IPC-7351B
GENERIC REQUIREMENT FOR SURFACE MOUNT DESIGN
AND LAND PATTERN.

| Package Revision History | | |
|--------------------------|---------|-----------------|
| Date Created | Rev No. | Description |
| Sep t 6, 2020 | 00 | Initial Release |
| | | |

IMPORTANT NOTICE AND DISCLAIMER

RENESAS ELECTRONICS CORPORATION AND ITS SUBSIDIARIES (“RENESAS”) PROVIDES TECHNICAL SPECIFICATIONS AND RELIABILITY DATA (INCLUDING DATASHEETS), DESIGN RESOURCES (INCLUDING REFERENCE DESIGNS), APPLICATION OR OTHER DESIGN ADVICE, WEB TOOLS, SAFETY INFORMATION, AND OTHER RESOURCES “AS IS” AND WITH ALL FAULTS, AND DISCLAIMS ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING, WITHOUT LIMITATION, ANY IMPLIED WARRANTIES OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, OR NON-INFRINGEMENT OF THIRD PARTY INTELLECTUAL PROPERTY RIGHTS.

These resources are intended for developers skilled in the art designing with Renesas products. You are solely responsible for (1) selecting the appropriate products for your application, (2) designing, validating, and testing your application, and (3) ensuring your application meets applicable standards, and any other safety, security, or other requirements. These resources are subject to change without notice. Renesas grants you permission to use these resources only for development of an application that uses Renesas products. Other reproduction or use of these resources is strictly prohibited. No license is granted to any other Renesas intellectual property or to any third party intellectual property. Renesas disclaims responsibility for, and you will fully indemnify Renesas and its representatives against, any claims, damages, costs, losses, or liabilities arising out of your use of these resources. Renesas' products are provided only subject to Renesas' Terms and Conditions of Sale or other applicable terms agreed to in writing. No use of any Renesas resources expands or otherwise alters any applicable warranties or warranty disclaimers for these products.

(Rev.1.0 Mar 2020)

Corporate Headquarters

TOYOSU FORESIA, 3-2-24 Toyosu,
Koto-ku, Tokyo 135-0061, Japan
www.renesas.com

Contact Information

For further information on a product, technology, the most up-to-date version of a document, or your nearest sales office, please visit:
www.renesas.com/contact/

Trademarks

Renesas and the Renesas logo are trademarks of Renesas Electronics Corporation. All trademarks and registered trademarks are the property of their respective owners.